

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

CHILD SEATS:

Dorel Juvenile Group (Dorel) is recalling certain Maxi-Cosi Pria 85 Convertible child seats. When the seat is installed in the forward facing position and secured to the car using the lap belt without also using the top tether, the seat may not adequately protect the child from head injury in the event of a crash. As such, these child seats fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." If the seat is installed with only the lap belt, the child has an increased risk of injury in the event of a crash. No remedy has been established at this time. Owner notification letters are expected to be mailed October 18, 2021. Owners may contact Dorel customer service at 1-877-657-9546.

21C-003

EQUIPMENT:

Bendix Commercial Vehicle Systems, LLC (Bendix) is recalling certain Intellipark Dash Electronic Control Units (DECU) with part number K183042R000. The DECU may fail to activate the parking brake, causing the vehicle to unintentionally move. Unintentional vehicle movement can increase the risk of a crash. Dealers will update the software, or replace the DECU, free of charge. Owner notification letters were mailed September 30, 2021. Owners may contact Bendix customer service at 1-877-345-9526.

21E-070

Enerco Group, Inc. is recalling certain Enerco and Mr. Heater propane regulators with model numbers 73766 and 73836(G). Please see attached model listing for all affected part numbers. The LP regulator that controls the LP gas pressure may fail, allowing excessive gas pressure that causes the appliance flame to increase. Excessive gas pressure and a larger than intended appliance flame can increase the risk of a fire. Enerco will notify retailers, and replace the propane regulators with high capacity regulators, free of charge. Notification letters were mailed August 27, 2021. Owners may contact Enerco Group customer service at 1-800-964-4328.

21E-071

S&S Truck Parts, Inc. (S&S Truck) is recalling certain Ningbo Fuding Industrial triangle kits, model number RT069. The triangle kits may be insufficiently visible, and not warn road users as intended. As such these triangle kits fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) 125, "Warning Devices." The warning triangles may be insufficiently visible to oncoming vehicles, potentially increasing the risk of a crash. No remedy has been established at this time. The manufacturer has not yet provided a schedule for recall notification. Owners may contact S&S Truck customer service at 1-800-621-1553 ext. 2125.

21E-073

Chrysler (FCA US, LLC) is recalling certain Mopar right and left-side Crew Cab, Quad Cab, Mega Cab, and Standard Cab side air bag inflatable curtains (SABIC) sold as replacement parts. Please see the part 573 report for a list of affected part numbers. The SABIC inflator end cap may detach from the inflator, or the inflator sidewall may rupture. A separated inflator end cap or inflator rupture can allow compressed gas to escape, resulting in the end cap or other components being propelled towards a person, or into a vehicle, increasing the risk of injury or crash. Dealers will inspect and replace as necessary, the SABIC assemblies, free of charge.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

Interim owner notification letters were mailed on October 4, 2021. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is Y56.

21E-074

Cummins, Inc. (Cummins) is recalling certain generator sets, model 6RBAB, 10RBAB, 15RBAB, and 8RBAB. The lifting cables may be improperly crimped. An improperly crimped cable may come out of place during a lifting operation, possibly causing the generator set to fall, increasing the risk of injury. Dealers will inspect the lifting cable, and either replace the cable, or install a warning label, free of charge. Owner notification letters are expected to be mailed in October 2021. Owners may contact Cummins customer service at 1-800-286-6467. Cummins number for this recall is 4495.

21E-075

Palfinger, Inc. (Palfinger) is recalling certain Knuckle Boom Cranes, models PW38001, 42001, and 50001. The crane base may crack over time from normal crane use. A cracked crane base could fail and pull away from the truck mount, increasing the risk of injury. The remedy has not yet been identified. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Palfinger customer service at 1-712-256-9347.

21E-076

Space Craft MFG (Space Craft) is recalling certain Lippert (Hehr) 6400 series vented windows, sold as aftermarket parts. The adhesive that bonds the vented portion of the window may fail. Adhesive failure may cause the vent portion of the window to detach, increasing the risk of a crash or injury. Space Craft will inspect the windows, and replace the vent if necessary, free of charge. Owners may contact Space Craft customer service at 1-660-463-7520.

21E-077

Rigid Hitch, Inc. (Rigid Hitch) is recalling certain DHB-4 4" Drop, DHB-6 6" Drop or 6" Rise, DHB-10 10" Drop/10" Rise, and DHB-8 8" Drop/8" Rise tow hitches. The torch angle or temperature setting used to apply the weld may have been incorrect. Incorrect torch angle or weld temperature setting could cause the weld to fail, causing loss of control, increasing the risk of a crash. Rigid Hitch will provide a full reimbursement for all returned units, free of charge. Owner notification letters were mailed September 3, 2021. Owners may contact Rigid Hitch customer service at 1-952-895-5001.

21E-079

Key Safety Systems, Inc. (DBA Joyson) is recalling certain HPH-A curtain air bag inflators. Moisture introduced during the manufacturing process can cause corrosion inside the pressure vessel, causing the inflator to rupture. An inflator rupture can cause fragments to enter the cabin, increasing the risk of injury. Joyson will work with the affected vehicle manufacturers to replace the curtain air bag module, free of charge. Purchasers may contact Joyson customer service at 475-6111. Joyson's number for this recall is QN10584 and QN20023.

21E-080

Takata (TK Global LLC) is recalling certain Non-Azide driver-side air bag inflators (NADI). These inflators were used by certain vehicle manufacturers and included in recall expansions under NHTSA numbers 21V-401

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

and 21V-470. Due to a manufacturing issue, the NADI inflators may absorb moisture, causing the inflators to explode or the air bag cushion to underinflate. During air bag deployment, an inflator explosion may result in metal fragments striking the driver or other occupants. An underinflated air bag may not properly protect the occupant. Either of these scenarios can increase the risk of serious injury or death. Takata will work with the affected vehicle manufacturers who have filed their own recalls, and their dealers will replace the inflators, free of charge.

21E-082

TIRES:

Bridgestone Americas Tire Operations (Bridgestone) is recalling certain Bridgestone Dueler H/L 422 Ecopia P245/60R18, Dueler H/L Alenza 275/55R20, Ecopia H/L 422 Plus 235/55R20, Turanza EL440 235/60R18, and Firestone Destination LE3 225/65R17 tires with DOT code 2821. These tires may have been manufactured with a pinhole in the outboard side of the tire. As such, these tires fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 139, "New Pneumatic Radial Tires for Light Vehicles." Tires containing a pinhole may slowly leak air, and the continued loss of air may increase the risk of a vehicle crash. Bridgestone will notify owners and replace affected tires with a comparable Bridgestone or Firestone brand tire, free of charge. Owner notification letters were mailed on September 17, 2021. Owners may contact BATO customer service at 1-800-847-3272.

21T-012

Cooper Tire & Rubber Co. (Cooper Tire) is recalling certain Evolution H/T 245/70R16 tires. The Tire Identification Number (TIN) states the incorrect manufacture date of the tire. The correct code is 2317, and the subject tires are incorrectly marked with 1723. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 139, "New Pneumatic Radial Tires For Light Vehicles" and number 574, "Tire Identification & Recordkeeping." An incorrect manufacture date may cause the tire to be used beyond its recommended service life, increasing the risk of tire failure and crash. Cooper Tire will replace the tires, free of charge. Owner notification letters were mailed on September 23, 2021. Owners may contact Cooper Tire customer service at 1-800-854-6288. Cooper Tire's number for this recall is 171.

21T-014

Cooper Tire & Rubber Co. (Cooper Tire) is recalling certain Hercules Roadtour 455 Sport 225/50R17 tires with DOT code 0721. Due to a manufacturing issue, the tire may experience a belt separation. Belt separation could lead to loss of vehicle control, increasing the risk of a crash. Cooper Tire will replace the tires, free of charge. Owner notification letters were mailed beginning September 10, 2021. Owners may contact Cooper Tire customer service at 1-800-854-6288. Cooper Tire's number for this recall is 181.

21T-015

VEHICLES:

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021 Audi E-Tron Quattro and E-Tron

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

Sportback Quattro vehicles. The right hinge pin for the glove box cover may not be properly secured, allowing the glove box lid trim to interfere with the knee air bag during deployment. An air bag that does not deploy properly can increase the risk of injury in a crash. Dealers will inspect the glove box, and secure the hinge pin as necessary, free of charge. Owner notification letters were mailed August 27, 2021. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 68H6.

21V-595

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2022 Outlander vehicles. The front and second-row passenger seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect, and replace as necessary, the right front seat belt assembly, and the right and left second-row seat belt assemblies, free of charge. Owner letters were mailed September 28, 2021. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-21-007.

21V-596

Volvo Bus Corporation (Volvo Bus) is recalling certain 2009-2021 Volvo 9700 vehicles equipped with wheelchair lifts. When the lift's outer barrier is fully deployed, it may not withstand a sufficient amount of force, which could cause it to fail. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 403, "Platform Lift Systems" and 404, "Platform Lift Installations." In the event that a mobility device pushes into the outer barrier, the barrier may fail, increasing the risk of injury for the lift occupant. Volvo Bus will reinforce the outer barrier with additional supports, free of charge. Interim owner notification letters were mailed on September 28, 2021. Owners may contact Volvo Bus customer service at 1-866-870-2046.

21V-597

BMW of North America, LLC (BMW) is recalling certain 2020 M340i, M340i xDrive, 540i, 540i xDrive, X3 M40i, 2020-2021 X4 M40i, 745Le xDrive, 2019-2021 Z4 M40i, and 2020-2021 Toyota Supra vehicles. During engine start, the engine management software may cause loss of braking assist. Full mechanical braking (without assist) remains available. Loss of braking assist can increase the risk of a crash. Dealers will update the engine management software, free of charge. Owner notification letters were mailed on September 17, 2021. Owners may contact BMW customer service at 1-800-525-7417.

21V-598

Nissan North America, Inc. (Nissan) is recalling certain 2021 Infinity Q50, Q60, and QX80 vehicles. A software error may deactivate the audio/video control unit screen, preventing the rear-view image from displaying. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility." A rear-view camera that does not display an image reduces the driver's rear view, increasing the risk of a crash. Dealers will update the control unit software, free of charge. Owner notification letters were mailed September 14, 2021. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's number for this recall is R21A9.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

21V-599

PACCAR Incorporated (PACCAR) is recalling certain 2021-2022 Peterbilt 536, 537, 548 and Kenworth T270, T280, T370, T380, T440, T470, and T480 vehicles equipped with Cummins L9 diesel engines. A fuel leak may occur from the fuel hose between the fuel pump and the remote fuel filter head. A fuel leak in the presence of an ignition source increases the risk of a fire. Cummins will replace the fuel hoses, free of charge. Owner notification letters are expected to be mailed in October 2021. Owners may contact PACCAR's customer service at 1-425-828-5888 (Kenworth) and 1-940-591-4220 (Peterbilt). PACCAR's numbers for this recall are 21PBG and 21KWF.

21V-601

Spector Manufacturing, Inc. (Spector) is recalling certain 2019 Spectec SEC4896102 trailers equipped with Dexter Axle Ingersoll Smart-Steer self-steer axles. The steering arm may detach from the steering knuckle during certain low-speed, high-side loading maneuvers. A detached steering arm may cause a loss of steering control. In addition, attachment hardware may fall and become a road hazard. Both of these scenarios can increase the risk of a crash. Dexter Axle will inspect the steering arm and apply welds, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Spector's customer service at 1-570-429-2510.

21V-602

Lamborghini (Automobili Lamborghini) is recalling certain 2021 Urus vehicles. The middle-rear passenger seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect, and replace as necessary, the affected seat belt assemblies, free of charge. Owner notification letters are expected to be mailed in October 2021. Owners may contact Lamborghini customer service at 1-866-681-6276. Lamborghini's number for this recall is L636-R.04.21.

21V-603

Newmar Corporation (Newmar) is recalling certain 2021-2022 Dutch Star, New Aire, and Ventana motorhomes equipped with Cummins L9 diesel engines. A fuel leak may occur from the fuel hose between the fuel pump and the remote fuel filter head. A fuel leak in the presence of an ignition source increases the risk of a fire. Cummins will replace the fuel hoses, free of charge. Owner notification letters were mailed on September 16, 2021. Owners may contact Newmar's customer service at 1-800-731-8300. Newmar's number for this recall is Cummins 21E-063.

21V-604

Bentley Motors, Inc. (Bentley) is recalling certain 2021 Bentayga vehicles. The front passenger seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicles Safety Standard number 208, "Occupant Crash Protection." An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect the front passenger seat belt assemblies, and if necessary, replace the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

seat belts free of charge. Owner notification letters were mailed on September 30, 2021. Owners may contact Bentley customer service at 1-800-777-6923. Bentley's number for this recall is RE21/31 (RC13).

21V-605

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021 Volkswagen ID4, Audi A4 Allroad, A4 Sedan, A5 Cabriolet, A5 Coupe, A5 Sportback, A6 Allroad, A6 Sedan, A7, A8, E-Tron Quattro, E-Tron Sportback Quattro, Q3, Q5, Q5 Sportback, Q7, Q8, RS5 Sportback, RS5 Coupe, RS6 Avant, RS7, RSQ8, S4 Sedan, S5 Cabriolet, S5 Coupe, S5 Sportback, S6 Sedan, S7, S8, SQ5, SQ5 Sportback, SQ7, SQ8, and 2021-2022 S3 Sedan vehicles. The rear seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect, and replace as necessary, the middle-rear seat belt assemblies, free of charge. Owner notification letters were mailed August 27, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298 and Audi customer service at 1-800-253-2834. Volkswagen's numbers for this recall are 69CR (VW) and 69CS (Audi).

21V-606

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021 ID4 vehicles. Incorrect rear outboard seat belt assemblies without an automatic locking retractor (ALR) function may have been installed, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect, and replace as necessary, the rear outboard seat belt assemblies, free of charge. Owner notification letters were mailed August 27, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 69CQ.

21V-607

Porsche Cars North America, Inc. (Porsche) is recalling certain 2021 911 Carrera Coupe, 911 Carrera S Coupe, 911 Carrera 4 Coupe, 911 Carrera 4S Coupe, 911 Turbo Coupe, 911 Turbo S Coupe, Panamera, Panamera 4 E-Hybrid, Panamera 4S, Panamera GTS, Panamera Turbo S, Taycan, Taycan 4S, Taycan Turbo, and Taycan Turbo S vehicles. The seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect and replace the seat belt assemblies, as necessary, free of charge. Owner notification letters were mailed October 1, 2021. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AMB6.

21V-608

PACCAR Incorporated (PACCAR) is recalling certain 2020 Peterbilt 220 vehicles equipped with Meritor 14Xe ePowertrains. The stator assembly wires may have been insufficiently crimped, causing high resistance, overheating, and preventing the high voltage system from starting. A loss of power to the system may cause loss of drive power, increasing the risk of a crash. PACCAR has already inspected and replaced the stator parts on

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

the affected vehicles. Owners may contact Peterbilt's customer service at 1-940-591-4220. PACCAR's number for this recall is 21PBH.

21V-609

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain 2017-2022 Wayfarer motorhomes. Continuous stress on the frame rail hitch extensions may cause them to fail. Extension failure can cause the hitch to detach from the motorhome, increasing the risk of a crash. The remedy is still under development. Owners were notified of the defect on September 16, 2021. A second final remedy letter will be mailed once a remedy is finalized. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is WAY-101.

21V-610

General Motors, LLC. (GM) is recalling certain 2020-2022 Cadillac CT4 and CT5 vehicles. The roof rail side-curtain air bags may not have been installed correctly, which could result in an improper air bag deployment during a crash. Air bags that do not deploy properly can increase the risk of injury in a crash. Dealers will inspect both left and right-side roof rail air bags and reinstall the air bags, as necessary, free of charge. Owner notification letters were mailed on August 30, 2021. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is N212342780.

21V-611

General Motors, LLC (GM) is recalling certain 2021-2022 Chevrolet Equinox and GMC Terrain vehicles equipped with certain Hankook tires. The tires may have been manufactured with an insufficient amount of curative agent, which could cause tread separation. Tread separation can result in a loss of vehicle control, increasing the risk of a crash. Dealers will inspect the tire DOT numbers, and replace any affected tires, free of charge. Owner notification letters were mailed on August 31, 2021. Owners may contact GMC customer service at 1-800-462-8782; and Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N212343560.

21V-612

Maserati North America, Inc. (Maserati) is recalling certain 2021 Quattroporte Trofeo and Ghibli Trofeo vehicles equipped with optional 21-inch tires. The tire placard may have incorrect tire pressure information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 110, "Tire Selection and Rims." Tires that are inflated to the incorrect pressure could lead to a loss of vehicle stability and control, increasing the risk of a crash. Dealers will replace the placard and update the tire pressure monitoring system, free of charge. Owner notification letters were mailed September 10, 2021. Owners may contact Maserati customer service at 1-877-696-2737. Maserati's number for this recall is 432.

21V-613

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2022 Taos vehicles equipped with all-wheel drive. The engine control unit (ECU) software may cause a stall when coming to a stop. An engine stall increases the risk of a crash. Dealers will update the ECU software, free of charge. Owner notification letters were mailed October 5, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 24HH.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

21V-615

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021 Atlas and Atlas Cross Sport vehicles. Damaged relays may have been installed in the engine compartment fuse box, which could inadvertently activate the horn or engine starter. A horn or starter that remains activated for an extended period of time can overheat, increasing the risk of fire. Dealers will inspect and as necessary, replace the relays, free of charge. Owner notification letters were mailed August 27, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 97FR.

21V-616

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2019-2020 Yaris, Yaris Hatchback, and Yaris Sedan vehicles. An impeller within the low-pressure fuel pump may crack and deform, potentially causing the fuel pump to fail. A fuel pump failure may cause an engine stall, increasing the risk of a crash. Dealers will replace the low-pressure fuel pump assembly, free of charge. Interim notification letters informing owners of the safety risk were mailed September 24, 2021. Owners will receive a second notice when the remedy becomes available. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's numbers for this recall are 21TB05 and 21TA05.

21V-617

Custom Fire Apparatus, Inc. (Custom Fire) is recalling certain 2019-2021 Spartan Gladiator and Metrostar emergency vehicles. Pressure may build in the power steering pump and break the shaft seal, resulting in a loss of power steering assist. A loss of power steering assist may increase the risk of a crash. Spartan will remove and replace the power steering pump, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Custom Fire's customer service at 1-715-294-2555.

21V-618

Hyundai Motor America (Hyundai) is recalling certain 2017-2018 Sonata, 2016-2018 Sonata Hybrid, 2018-2020 Accent, and 2016-2017 Azera vehicles. The trunk latch may become damaged, preventing the opening of the trunk from the inside. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 401, "Internal Trunk Release." A person inside the trunk compartment may become trapped, increasing their risk of injury. Dealers will replace the trunk latch assembly, free of charge. Owner notification letters are expected to be mailed in October 2021. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 208.

21V-619

Custom Fire Apparatus, Inc. (Custom Fire) is recalling certain 2017-2021 Peterbilt 348, Freightliner M2, Kenworth T370, and T880 emergency vehicles equipped with Cummins L9 diesel engines. The sealing washer may not seat correctly in the pilot boreholes, allowing the high-pressure fuel rail assembly to leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Cummins will inspect the rail threads and fuel lines, and replace the rail as necessary, free of charge. Owner notification letters were mailed on August 9, 2021. Owners may contact Custom Fire's customer service at 1-715-294-2555.

21V-620

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

Forest River, Inc. (Forest River) is recalling certain 2019-2021 Salem, Wildwood and 2020-2021 Stealth EVO travel trailers. The fresh water tank may not be properly secured to the vehicle's frame. A fresh water tank that detaches from the frame could increase the risk of a crash. Dealers will properly secure the holding tank, free of charge. Owner notification letters were mailed August 23, 2021. Owners may contact Forest River customer service at 1-503-831-5410. Forest River's number for this recall is 22-1400.

21V-621

Kia Motors America (Kia) is recalling certain 2016-2018 Forte 4-door, Forte Koup 2-door, and 2018-2019 Rio 4-door vehicles. The trunk latch may become damaged, preventing the opening of the trunk from the inside. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 401, "Internal Trunk Release." A person inside the trunk compartment may become trapped, increasing their risk of injury. Dealers will replace the trunk latch assembly, free of charge. Interim owner notification letters were mailed on October 5, 2021. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC216.

21V-622

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Starcraft Allstar XL transit buses equipped with Cummins B6.7 diesel engines. The electric fuel heater within the fuel module may overheat, causing plastic in the fuel heater to melt and potentially catch fire. It may also lead to engine stalling. A fire increases the risk of injury. An engine stall can increase the risk of a crash. The remedy is still under development. Owner notification letters were mailed August 18, 2021. Owners may contact Forest River customer service at 1-800-348-7440. Forest River's number for this recall is 05-1401.

21V-623

NRC Modifications, Inc. (NRC) is recalling certain 2018-2019 NRC Motorhomes equipped with Hehr 6400 Series windows. The adhesive that bonds the vented portion of the window may fail. Adhesive failure may cause the vent portion of the window to detach, increasing the risk of a crash or injury. Dealers will inspect the windows, and replace the vent if necessary, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact NRC customer service at 1-574-825-3646.

21V-624

Ford Motor Company (Ford) is recalling certain 2021 Escape, Lincoln Corsair, and 2021-2022 Bronco Sport vehicles. The fuel delivery module may leak inside the fuel tank, causing low fuel pressure which could result in an engine stall. An engine stall increases the risk of a crash. Dealers will replace the fuel delivery module, free of charge. Interim notification letters (remedy not available) were mailed on September 30, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21S38.

21V-625

Cottrell, Inc. (Cottrell) is recalling certain 2018-2021 1-Car Carrier trailers. These trailers were manufactured without side and rear reflex reflectors. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment." Without the proper reflective equipment, the trailers may have reduced visibility, increasing the risk of a crash. Cottrell will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

provide 4 reflex reflectors and installation instructions to owners, free of charge. Owner notification letters were mailed on August 11, 2021. Owners may contact Cottrell's customer service at 1-770-532-7251. Cottrell's number for this recall is 2021 1-Car Reflector.

21V-626

KTM North America, Inc. (KTM) is recalling certain 2018-2020 Husqvarna Motorcycle 701 Vitpilen and 2019-2020 701 Svartpilen motorcycles. The gear teeth on the license plate holder and swingarm may be positioned incorrectly, possibly resulting in a loose rear axle nut, causing the license plate holder to contact the rear wheel. License plate bracket interference with the rear wheel can increase the risk of a crash or injury. Dealers will inspect and realign the gear teeth on the license plate holder and swingarm, and inspect the tightness of the rear wheel axle collar, free of charge. Owner notification letters were mailed on October 1, 2021. Owners may contact KTM customer service at 1-888-985-6090. KTM's number for this recall is HTB2106.

21V-627

Custom Fire Apparatus, Inc. is recalling certain 2009-2021 Spartan Gladiator, MetroStar, and MetroStarX emergency vehicles. The fire water pump solenoid may corrode internally, causing a loss of power to the pump control module. A loss of power to the pump control module can cause a loss of water pressure for fighting fires, increasing the risk of injury. Dealers will remove and replace the pump shift solenoid, free of charge. Owners may contact Custom Fire's customer service at 1-715-294-2555.

21V-628

Polaris, Inc. (Polaris) is recalling certain 2020-2021 Slingshot vehicles. The rear wheel studs may not have been fully pressed into the axle, possibly causing them to come loose. Loose rear wheel studs could result in wheel detachment, increasing the risk of a crash. Dealers will inspect and as necessary, replace the rear axle/stud assembly, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is T-21-01.

21V-629

Custom Fire Apparatus, Inc. (Custom Fire) is recalling certain 2017-2021 Spartan Gladiator, MetroStar, and MetroStarX emergency vehicles equipped with Cummins L9 diesel engines. The sealing washer may not seat correctly in the pilot boreholes, allowing the high pressure fuel rail assembly to leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Cummins will inspect the rail threads and fuel lines, and replace the rail as necessary, free of charge. Owner notification letters were mailed on August 8, 2021. Owners may contact Custom Fire's customer service at 1-715-294-2555.

21V-630

Ford Motor Company (Ford) is recalling certain 2015-2020 Transit vehicles. An incorrect driveshaft torsional damper service kit may have been installed, which can allow the damper shield to contact the parking brake cable, possibly resulting in parking brake failure. Parking brake failure can result in unintended vehicle movement, increasing the risk of a crash. Dealers will replace the passenger side parking brake cable with a cable that provides sufficient clearance to the damper shield, free of charge. Interim owner notification letters were mailed on September 24, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

this recall is 21S39.

21V-631

Chrysler (FCA US, LLC) is recalling certain 2015-2020 Ram 1500 Classic, 2015-2016 Ram 3500, and Ram 2500 vehicles, and 2016 Ram 3500 Cab Chassis with a gross vehicle weight rating less than 10,000 lbs. The side air bag inflatable curtain (SABIC) inflator end cap may detach from the inflator, or the inflator sidewall may rupture. A separated inflator end cap or inflator rupture can allow compressed gas to escape, resulting in the end cap or other components being propelled into the vehicle, increasing the risk of injury or crash. Dealers will inspect and replace as necessary, the SABIC assemblies, free of charge. Interim owner notification letters were mailed on October 4, 2021. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is Y55.

21V-632

General Motors, LLC (GM) is recalling certain 2013 Buick Regal, Chevrolet Malibu, and Buick Lacrosse vehicles sold or ever registered in Connecticut, Delaware, the District of Columbia, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, or Wisconsin. These vehicles may have rear toe links that received excessive electrocoating (e-coat) corrosion protection, which could cause the e-coat to become brittle and break away when contacted by road debris. Over time, the e-coat may chip away, exposing the metal toe link and making it more susceptible to corrosion. Corrosion may eventually cause the toe link to thin and ultimately to fracture. A rear toe link fracture may reduce the driver's ability to control the vehicle, increasing the risk of a crash. Dealers will replace the rear suspension toe links and adjuster fasteners, free of charge. Interim owner notification letters were mailed on September 30, 2021. Owners may contact Buick customer service at 1-800-521-7300 or Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N212330130.

21V-633

Luxe Trucks dba Utility Bodywerks (Utility Bodywerks) is recalling certain 2019-2020 Ram 4500 and 5500 Cab Chassis vehicles. The rear brake caliper flexible lines may have been improperly routed, which could allow chafing against suspension components, and result in a brake fluid leak. A brake fluid leak can cause a loss of brakes and increase the risk of a crash. Dealers will modify the rear brake caliper flexible line mounting, and replace the rear brake caliper flexible line as needed, free of charge. Owner notification letters are expected to be mailed in October 2021. Owners may contact Utility Bodywerks' customer service at 1-574-522-8422.

21V-634

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2010-2013 Range Rover Sport and 2010-2016 LR4 vehicles equipped with 3.0L V6 or 5.0L V8 engines. The fuel outlet flange mounted on the fuel tank may crack, possibly resulting in a fuel leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Dealers will replace the fuel outlet flange, free of charge. Owner notification letters are expected to be mailed in October 2021. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N623.

21V-635

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

Grand Design RV, LLC (Grand Design) is recalling certain 2021 Imagine recreational trailers equipped with Dexter D30 axles. The axles may have been assembled with incorrect inner bearings. Incorrect inner bearings can cause the wheels to lock up or reduce stopping ability, increasing the risk of a crash. Dealers will inspect the axles for incorrect bearings and replace the bearings as necessary, free of charge. Owner notification letters were mailed August 24, 2021. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 910024.

21V-636

PL Custom Emergency Vehicles (PL Custom) is recalling certain 2016 Freightliner M2 emergency vehicles equipped with Code 3 7x9 Stop-Tail-Turn Reverse All-in-One LED lights. The lights may be too bright, exceeding the maximum light output allowed which may adversely affect the vision of drivers. As such, these lights fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The excessive brightness may affect the vision of other drivers, increasing the risk of a crash. PL Custom will notify the owners, and provide instructions on how to obtain a filter kit from the light manufacturer, free of charge. Owners may contact PL Custom's customer service at 1-732-223-1411.

21V-637

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2015-2016 E400 Coupe, 2012-2015 C250 Coupe, C350 Coupe, C63 AMG Coupe, 2011-2014 E350 Coupe, and 2012-2014 E350 Cabrio vehicles. An incorrect front passenger air bag may have been installed during a prior repair. An incorrect air bag may not function properly in a crash, increasing the risk of injury. Dealers will replace the front passenger air bag on the affected vehicles, free of charge. Owner notification letters were mailed on September 10, 2021. Owners may contact MBUSA customer service at 1-800-367-6372.

21V-638

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2020 GLB250 vehicles. In the event of a crash, the air bag control unit software may not activate the front seat belts and front passenger air bag properly. Air bags and seat belts that do not function properly can increase the risk of injury in a crash. Dealers will update the air bag control unit software, free of charge. Owner notification letters were mailed on September 17, 2021. Owners may contact MBUSA customer service at 1-800-367-6372.

21V-639

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling one 2020 Igniter emergency vehicle equipped with a Weldon V-Mux Vista IV Standard Liquid Crystal Display (LCD) used for controlling emergency vehicle lighting and HVAC functions. The display may experience low voltage spikes, and cause the LCD to lock up or become nonfunctional, due to varying electrical installations. A locked up or non-functional LCD can delay emergency efforts, which can increase the risk of injury. Ferrara will replace the display, free of charge. Owners may contact Ferrara's customer service at 1-225-567-7100.

21V-640

Alexis Fire Equipment Company (Alexis Fire) is recalling certain 2015-2020 Alexis Fire Equipment emergency

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

vehicles equipped with Code 3 7x9 Stop-Tail-Turn Reverse All-in-One LED lights. The lights may be too bright, exceeding the maximum light output allowed which may adversely affect the vision of drivers. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The excessive brightness may affect the vision of other drivers, increasing the risk of a crash. Alexis Fire will notify owners, and provide instructions on how to obtain a filter kit from the light manufacturer, free of charge. Owner notification letters were mailed on September 8, 2021. Owners may contact Alexis Fire's customer service at 1-309-482-6121.

21V-641

Newmar Corporation (Newmar) is recalling certain 2021-2022 Dutch Star, New Aire, and Ventana vehicles equipped with Cummins L9 diesel engines. A fuel leak may occur from the fuel hose between the fuel pump and the remote fuel filter head. A fuel leak in the presence of an ignition source increases the risk of a fire. Cummins will replace the fuel hoses, free of charge. Owner notification letters are expected to be mailed on October 16, 2021. Owners may contact Newmar's customer service at 1-800-731-8300 or Cummins' customer service at 1-800-286-6467. Newmar's number for this recall is DTNA #21V556/FL-897.

21V-642

Swab Wagon Company, Inc. (Swab Wagon) is recalling certain 2017 Chevrolet 2500 HD, 2018-2019 Chevrolet 3500 HD, and 2019 Ford F-350 Swab Pioneer medic vehicles equipped with Code 3 7x9 Stop-Tail-Turn Reverse All-in-One LED lights. The lights may be too bright, exceeding the maximum light output allowed which may adversely affect the vision of drivers. As such, these lamps fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The excessive brightness may affect the vision of other drivers, increasing the risk of a crash. Swab Wagon will provide instructions on how to obtain a filter kit from the light manufacturer, free of charge. Owner notification letters were mailed on August 26, 2021. Owners may contact Swab Wagon's customer service at 1-800-834-7922.

21V-643

Kibbi, LLC (Kibbi) is recalling certain 2018-2020 Renegade Vienna, IKON, Classic, Toters, and Garage recreational vehicles equipped with Lippert Hehr 6400 series windows. The adhesive that bonds the vented portion of the window may fail. Adhesive failure may cause the vent portion of the window to detach, increasing the risk of a crash or injury. Dealers will inspect the windows, and replace the vent if necessary, free of charge. Owner notification letters were mailed on September 1, 2021. Owners may contact Kibbi's customer service at 1-574-966-0196.

21V-644

Kibbi, LLC (Kibbi) is recalling certain 2019-2021 Vienna and Villagio recreational vehicles. Exhaust temperatures may cause the storage box to melt or catch on fire. The storage box may melt or catch on fire, increasing the risk of injury. Dealers will add a heat shield under the storage compartment box, free of charge. Owner notification letters are expected to be mailed in October 2021. Owners may contact Kibbi's customer service at 1-574-966-0196.

21V-645

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

BMW of North America, LLC (BMW) is recalling certain X4 xDrive30i vehicles. The tire label may contain the wrong tire size and pressure information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 110, "Tire Selection and Rims." Incorrect tire size and pressure information could result in the wrong tires being installed, or improperly inflated tires, increasing the risk of a crash. Dealers will replace the tire information label, free of charge. Owners may contact BMW customer service at 1-800-525-7417.

21V-646

Bentley Motors, Inc. (Bentley) is recalling certain 2021 Bentayga vehicles. Incorrect software for the chassis control module may cause the Electronic Stability Control (ESC) system to malfunction. A malfunctioning ESC system can cause a loss of vehicle control, increasing the risk of a crash. Dealers will update the chassis control module with the correct software, free of charge. Owner notification letters were mailed on October 5, 2021. Owners may contact Bentley customer service at 1-800-777-6923. Bentley's number for this recall is Re21/31.

21V-647

PACCAR, Inc. (PACCAR) is recalling certain 2021-2022 Peterbilt 367, 389, 567, and 579 vehicles. The cross member mounted Hill Start Assist valve assembly may have insufficient clearance to the rear axle, causing damage to the rear brake hose and loss of the rear brake signal. If loss of the rear brake signal occurs, the vehicle could experience reduced rear braking capability or loss of brakes to the rear axle(s), increasing the risk of a crash. Dealers will inspect for clearance and re-work the assembly to conform with an updated design, free of charge. Owner notification letters are expected to be mailed on October 18, 2021. Owners may contact PACCAR's customer service at 1-940-591-4220 (Peterbilt). PACCAR's number for this recall is 21PBJ.

21V-648

General Motors, LLC (GM) is recalling certain 2016-2021 Chevrolet Malibu and 2019-2021 Cadillac XT4 vehicles. The rear seat belt retractors may be improperly secured with loose or missing fasteners. An improperly secured seat belt retractor may not function properly in a crash, increasing the risk of injury. Dealers will inspect and tighten the rear seat belt retractors, as necessary, free of charge. Owner notification letters were mailed on September 17, 2021. Owners may contact Chevrolet customer service at 1-800-222-1020 and Cadillac customer service at 1-800-458-8006. GM's number for this recall is N212333380.

21V-649

General Motors, LLC (GM) is recalling certain 2020-2022 Chevrolet Bolt EV and 2022 Chevrolet Bolt EUV vehicles. The high voltage battery could catch fire when charged to full or nearly full capacity. A battery fire increases the risk of injury. Defective battery modules will be replaced by GM, free of charge. Owners are advised to take the following interim steps: Set the Target Charge Level feature in their vehicle to limit the charge level to 90%, charge their vehicle more frequently, avoid depleting the battery to 70 miles range remaining, park outside after charging, and do not charge the vehicle indoors overnight.

Interim notification letters notifying owners of the safety risk were mailed September 10, 2021. A second letter will be mailed once the final remedy is available. Owners may contact the Bolt EV Concierge Team at 1-833-382-4389. This recall is an expansion of NHTSA recall 21V-560. GM's number for this recall is

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

N212345940.

21V-650

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2022 Taos vehicles. The underhood fuel supply quick-connector may detach from the fuel supply line causing a fuel leak in the engine compartment. A fuel leak may cause a stall, increasing the risk of a crash. A fuel leak also increases the risk of fire in the presence of an ignition source. Dealers will inspect the connection and replace the fuel supply line and connector as necessary, free of charge. Owner notification letters were mailed August 31, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 20DB.

21V-651

Ford Motor Company (Ford) is recalling certain 2021 Explorer and Lincoln Aviator vehicles. The side air bag attachment weld studs could detach during the deployment of the side air bag, resulting in an improper deployment. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard 214, "Side Impact Protection". Improper deployment of a side air bag increases the risk of injury during a crash. Dealers will replace the side air bag assemblies, free of charge. Owner notification letters were mailed September 10, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21C19.

21V-652

Ford Motor Company (Ford) is recalling certain 2021 F-150 Super Cab vehicles. The front seatbelt webbing may be incorrectly routed. A misrouted seatbelt may not adequately restrain an occupant in a crash, increasing the risk of injury. Owners are advised to perform a preliminary self-inspection of the front seatbelts. If the passenger-side seatbelt fails inspection, owners should not use the passenger seat until the repair is performed. If the driver-side seatbelt fails inspection, owners should not drive their vehicle until the repair is performed. Dealers will inspect the front seatbelts and, if the webbing is misrouted, will replace the seatbelt retractor and pretensioner, free of charge. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21C20.

21V-653

PL Custom Emergency Vehicles (PL Custom) is recalling one 2021 Ford E-450 emergency vehicle equipped with a Weldon V-Mux Vista IV Standard Liquid Crystal Display (LCD) used for controlling emergency vehicle lighting and HVAC functions. These displays may experience low voltage spikes and cause the LCD to freeze or become nonfunctional, due to varying electrical installations. If the LCD freezes or becomes non-functional, emergency efforts can be delayed, increasing the risk of injury. Dealers will replace the IV Standard LCD, free of charge. Owners may contact PL Custom's customer service at 1-732-223-1411.

21V-654

Reitnouer, Inc. (Reitnouer) is recalling certain 2017-2019 Steer Axle trailers equipped with Dexter Ingersoll Smart-Steer self-steer axles. The steering arm may detach from the steering knuckle during certain low-speed, high-side loading maneuvers. A detached steering arm may cause a loss of steering control. In addition, attachment hardware may fall and become a road hazard. Both of these scenarios can increase the risk of a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

crash. Dealers will inspect the steering arm and apply welds, free of charge. Owners may contact Reitnouer's customer service at 1-610-929-4856.

21V-655

Crane Carrier Company (Crane Carrier) is recalling certain 2020-2021 LET2 vehicles equipped with L9 Diesel Engines, equipped with remote Stage 2 fuel filters and pressurized hoses. A fuel leak may occur from the fuel hose between the fuel pump and the remote fuel filter head. A fuel leak in the presence of an ignition source increases the risk of a fire. Cummins will replace the fuel hoses, free of charge. The manufacturer has not yet provided a schedule for recalled notification. Owners may contact Crane Carrier's customer service at 1-877-546-2537.

21V-656

PL Custom Emergency Vehicles (PL Custom) is recalling certain 2019 Dodge RAM 5500 emergency vehicles equipped with the LiquidSpring Compressible Liquid Adaptive Suspension Systems (C.L.A.S.S.). In the affected suspension systems, the rear brake caliper flexible line may have been routed so that it contacts a suspension component, possibly causing excessive wear and a loss of rear brakes. As such, these parts fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 105, "Hydraulic and Electric Brake Systems." A brake fluid leak may cause partial or complete loss of the rear brakes, increasing the risk of a crash. Dealers will inspect the rear brake caliper flexible lines for wear and install a kit to modify the rear brake caliper flexible line mounting, and if necessary, a kit to replace worn brake lines, free of charge. Owners may contact PL Custom's customer service at 1-732-223-1411.

21V-657

Summit Trailer Sales, Inc. (Summit Trailer) is recalling one 2017 AD45 trailer equipped with Dexter Ingersoll Smart-Steer self-steer axles. The steering arm may detach from the steering knuckle during certain low-speed, high-side loading maneuvers. A detached steering arm may cause a loss of steering control. In addition, attachment hardware may fall and become a road hazard. Both of these scenarios can increase the risk of a crash. A dealer will inspect the steering arm and apply welds, free of charge. Owners may contact Summit Trailer's customer service at 1-570-754-3511.

21V-658

Daimler Trucks North America, LLC (DTNA) is recalling certain 2016-2021 Thomas Built Buses Saf-T-Liner HDX school buses equipped with an ISL or L9 engine. The power steering hose may be routed with inadequate clearance between the hose and the power cables. A worn power steering hose increases the risk of a fire. DTNA will inspect the power steering hose routing and modify it as necessary, free of charge. Owner notification letters are expected to be mailed on October 17, 2021. Owners may contact DTNA's customer service at 1-800-547-0712. DTNA's number for this recall is FL898.

21V-659

Daimler Trucks North America, LLC (DTNA) is recalling certain 2016-2021 Thomas Built Buses Saf-T-Liner HDX transit buses equipped with an ISL or L9 engine. The power steering hose may be routed with inadequate clearance between the hose and the power cables, potentially damaging the power steering hose. A damaged

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

power steering hose can leak, and increase the risk of a fire. DTNA will inspect the power steering hose routing and modify it as necessary, free of charge. Owner notification letters are expected to be mailed on October 17, 2021. Owners may contact DTNA's customer service at 1-800-547-0712. DTNA's number for this recall is FL898.

21V-660

Daimler Truck North America, LLC (DTNA) is recalling certain 2022 Thomas Built Buses Minotour school buses. Adhesive may not have been properly applied between the lower interior side panel and the seat rail, resulting in insufficient joint strength. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 221, "School Bus Body Joint Strength." A school bus cabin with insufficient joint strength increases the risk of injury in a crash. DTNA will add additional mechanical fasteners to the joint, free of charge. Owner notification letters are expected to be mailed on October 17, 2021. Owners may contact DTNA's customer service at 1-800-547-0712. DTNA's number for this recall is FL-899.

21V-661

Space Craft MFG (Space Craft) is recalling certain 2019-2021 travel, fifth-wheel, and semi-trailers (see recall report for specific model numbers). The adhesive that bonds the vented portion of the window may fail. Adhesive failure may cause the vent portion of the window to detach, increasing the risk of a crash or injury. Space Craft will inspect the windows, and replace the vent if necessary, free of charge. Owners may contact Space Craft customer service at 1-660-463-7520.

21V-662

Coach House, Inc. (Coach House) is recalling certain 2019-2022 Platinum II and 2022 Platinum recreational vehicles. The adhesive that bonds the vented portion of the window may fail. Adhesive failure may cause the vent portion of the window to detach, increasing the risk of a crash or injury. On behalf of Coach House, Lippert will send owners an inspection tool with instructions to inspect the window. Affected windows will be replaced by Lippert, free of charge. Owner notification letters were mailed October 6, 2021. Owners may contact Coach House customer service at 1-800-235-0984.

21V-663

Chrysler (FCA US, LLC) is recalling certain 2021 Dodge Challenger vehicles. The affected vehicles do not illuminate their safety system status indicators sufficiently in both daylight and nighttime driving conditions. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 101, "Control and Displays." Without visible safety system indicators, a driver may not receive information regarding vehicle safety, increasing the risk of injury or a crash. Dealers will re-program instrument clusters with the correct software version, free of charge. Owner notification letters are expected to be mailed October 15, 2021. Owners may contact FCA US LLC customer service at 1-800-853-140. FCA US LLC's number for this recall is Y58.

21V-664

Chrysler (FCA US, LLC) is recalling certain 2020 Jeep Wrangler vehicles equipped with the 2.0 Liter engine. A cracked fuel supply line connector may leak fuel into the engine compartment. A fuel leak in the presence of an

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

ignition source increases the risk of fire. Dealers will inspect and replace the fuel supply line as needed, free of charge. Owner notification letters were mailed on September 10, 2021. Owners may contact FCA US LLC customer service at 1-800-853-140. FCA US LLC's number for this recall is Y10.

21V-665

Escape Trailer (Escape Trailer) is recalling certain 2019 E17A, E17B, E19, E21C, E21NE, and E5.0 recreational trailers. The adhesive that bonds the vented portion of the window may fail. Adhesive failure may cause the vent portion of the window to detach, increasing the risk of a crash or injury. Dealers will inspect the windows, and replace the vent if necessary, free of charge. Owners may contact Escape Trailer customer service at 1-604-703-1650.

21V-666

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2021-2022 F-Type, 2020-2021 F-Pace, and 2021 XF vehicles. The seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect and replace the seat belt assemblies as necessary, free of charge. Owner notification letters are expected to be mailed October 22, 2021. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H378.

21V-667

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2021 Range Rover, 2022 Range Rover Sport, 2020-2021 Range Rover Velar, Discovery Sport, 2020-2022 Discovery, and Defender vehicles. The seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect and replace the seat belt assemblies as necessary, free of charge. Owner notification letters are expected to be mailed October 22, 2021. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N630.

21V-668

Boise Mobile Equipment is recalling one 2016 International 4400 type 3 fire truck equipped with Ecco Code 3 7x9 Stop-Tail-Turn Reverse All-in-One LED lights. The lights may be too bright, exceeding the maximum light output allowed which may adversely affect the vision of drivers. As such, these lights fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The excessive brightness may affect the vision of other drivers, increasing the risk of a crash. Boise Mobile Equipment will assist the owner in obtaining filter kits from the light manufacturer, free of charge. Owners may contact Boise Mobile Equipment's customer service at 1-208-338-1444. Boise Mobile Equipment's number for this recall is 52606.

21V-669

KZRV, L.P. (KZRV) is recalling certain 2018-2022 Camplite, Confluence, Connect, Connect SE, Connect Lite, Durango, Durango Gold, Durango Half Ton, Durango Sport, Durango 1500, Quicksilver, Sonic, Sonic X, Sportsmen, Sportsmen FW, Sportsmen LE, Sportsmen SE, Sportsmen Sportster, Sportster, SportTrek,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

SportTrek Touring, Spree, Stratus, Venom, and Venom V Series recreational vehicles, equipped with Winntec model 6020 two-stage propane regulators. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator and pigtail hoses, free of charge. Owner notification letters are expected to be mailed October 26, 2021. Owners may contact KZRV customer service at 1-800-768-4016 ext. 154 or 153. KZRV's number for this recall is KZ-2021-05.

21V-670

Airstream, Inc. (Airstream) is recalling certain 2021 Flying Cloud, Bambi, Caravel, Classic, Globetrotter, and International recreational vehicles, equipped with Winntec model 6020 two-stage propane regulators. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will inspect and replace the regulator, as necessary, and test the propane system for leaks, free of charge. Owner notification letters are expected to be mailed October 26, 2021. Owners may contact Airstream customer service at 1-877-596-6505 or 1-937-596-6111 ext. 7401 or 7411.

21V-671

Gracie Ind. LLC d/b/Bolt Custom Trucks (Bolt Custom Trucks) is recalling certain 2018-2021 Custom Sleepers trucks equipped with Lippert Hehr 6400 Series windows. The adhesive that bonds the vented portion of the window may fail. Adhesive failure may cause the vent portion of the window to detach, increasing the risk of a crash or injury. Dealers will inspect the windows, and replace the vent if necessary, free of charge. Owner notification letters are expected to be mailed in October 2021. Owners may contact Bolt Custom Trucks' customer service at 260-748-0314.

21V-672

Triple E Recreational Vehicles (Triple E) is recalling certain 2020-2021 Unity U24IB, U24TB, U24RL, Wonder W24RL, and W24RTB vehicles. The 12-volt wire for the illuminated assist handle is routed too close to the refrigerator exhaust, which could melt the wire and blow the fuse. A melted wire and blown fuse can increase the risk of a fire. Dealers will install foil tape over the 12-volt wire, free of charge. Owner notification letters were mailed September 14, 2021. Owners may contact Triple E customer service at 1-877-992-9906. Triple E's number for this recall is CA#9949-1.

21V-673

Vermeer Manufacturing Company (Vermeer) is recalling certain 2021 BC900XL, BC1000XL, and BC1200XL brush chippers. The chipper discharge chute may separate, and fall off the trailer. A separated chipper discharge chute can become a road hazard, increasing the risk of injury or crash. Dealers will install a field remedy kit, free of charge. Owner notification letters are expected to be mailed on October 21, 2021. Owners may contact Vermeer's customer service at 1-800-829-0051 ext. 7060. Vermeer's number for this recall is IK4126.

21V-674

Subaru of America, Inc. (Subaru) is recalling certain 2021 Impreza vehicles. The left-front lower control arm weld may fail, allowing the control arm to separate from the crossmember. A separated control arm may cause

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2021**

Published October 6, 2021

the tire to contact the wheel well, resulting in a loss of control and increasing the risk of a crash. Owners are advised not to drive their vehicle until the repair is complete. Dealers will inspect and replace the control arm as necessary, free of charge. Owner notification letters were mailed September 3, 2021. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WRI-21.

21V-675

Utility Trailer Manufacturing Company (Utility Trailer) is recalling certain 2022 VS2RA trailers. The incorrect tape was installed on the top foil, which could result in the sealer plate separating from the roof. A separated sealer plate can become a road hazard, increasing the risk of a crash. Dealers will inspect the adhesive, and replace it if necessary, free of charge. Owner notification letters were mailed on September 2, 2021. Owners may contact Utility Trailer's customer service at 1-800-423-6591. Utility Trailer's number for this recall is SB-19-009.

21V-676

Autocar, LLC (Autocar) is recalling certain 2021 Xpeditor and 2020-2021 Legend vehicles. A machining defect may cause the power steering pump to fail, resulting in a loss of power steering assist. A loss of power steering assist can increase the risk of a crash. Autocar will inspect the power steering pump, and replace it if necessary, free of charge. Owner notification letters are expected to be mailed on October 28, 2021. Owners may contact Autocar's customer service at 1-888-218-3611 or 1-877-973-3486. Autocar's number for this recall is ACX-2104 DC-2104.

21V-677

KTM North America, Inc. (KTM) is recalling certain 2022 Husqvarna FE 350s and Husqvarna FE 501s motorcycles. The brake pad retaining clips on the front brake caliper may have been mounted incorrectly, which could result in loose front brake pads. Loose front brake pads can reduce braking performance, increasing the risk of a crash or injury. Dealers will inspect and repair the brake pad retaining clips, as necessary, free of charge. Owners are advised to not ride their motorcycles until the repair has been performed. Owners may contact KTM customer service at 1-888-985-6090. KTM's number for this recall is HTB2108.

21V-678