

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

**CHILD SEATS:**

Diono is recalling certain Radian R100, Radian R120, Radian RXT, Olympia, Pacifica, and Rainier convertible and booster car seats. When the seat is installed in the forward facing position and secured to the car using the lap belt without also using the top tether, the seat may not adequately protect the child from injury in the event of a crash. As such, these child seats fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." Only seats manufactured between November 25, 2013, and September 5, 2017, are affected by this recall campaign. If the seat is installed with only the lap belt, the child has an increased risk of a chest injury in the event of a crash. Diono will notify owners, and provide a free remedy kit with an updated instruction manual, an energy absorbing pad, as well as a new chest clip, free of charge. The recall is expected to begin November 22, 2017. Owners may contact Diono customer service at 1-855-215-4951.

**17C-003**

**EQUIPMENT:**

J-Tech Corporation (J-Tech) is recalling certain Icon Alliance Dark, Alliance GT Rubatone, and Alliance GT Horror motorcycle helmets in sizes XS, S, M, L, XL, XXL, and XXXL. The helmets may have faulty stitching on the webbing possibly allowing the D-rings to separate from the chin strap. In the event of a crash, the helmet may not stay secured to the rider's head, increasing the risk of injury. J-Tech will notify owners, and will provide replacement helmets, free of charge. The recall is expected to begin in October 2017. Owners should contact Parts Unlimited at 1-800-369-1000 or by email at helmets@parts-unltd.com for information on returning the helmet for a replacement one.

**17E-050**

Curt Manufacturing LLC (Curt) is recalling certain Class 1 trailer hitches, part number 11451, sold for installation on 2016-2018 Mini Cooper Clubman and Countryman vehicles. The vehicles may have inadequate structure points for the trailer hitch mounting, causing the hitch to sag under to certain loads and possibly separate from the vehicle. If the trailer hitch sags or separates from the vehicle, there would be an increased risk of a crash. Curt will notify owners, and dealers will provide a replacement hitch, free of charge. The recall began on October 20, 2017. Owners may contact Curt customer service at 1-800-798-0813.

**17E-051**

Bearing Technologies Ltd (Bearing) is recalling certain Duralast Wheel Spindles, part number DL930676K, sold as a service part for the front wheel hub spindle of 2007-2010 Ford Edge vehicles. The affected wheel spindles have wheel mounting studs with an oversized shoulder that can prevent the wheel from being installed correctly. If the wheel is installed incorrectly, the wheel may vibrate or wobble, increasing the risk of a crash. Bearing will notify the distributors of the spindles. If the studs on a defective spindle are not loose, Bearing will replace the studs at no charge. If the studs on a defective spindle are loose, Bearing will replace the spindle assembly at no charge. Bearing will also pay shop labor for the remedy. The recall is expected to begin in mid-October 2017. Owners may contact Bearing Technologies customer service at 1-800-597-3486 or visit [www.recall17E053.com](http://www.recall17E053.com).

**17E-053**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

YSN Imports Inc. (YSN) is recalling certain Flame King RV outdoor cooktop stoves, model number HT-600. These cooktops have a corrugated U-shaped cover inside the stove top that can burn if the flame inverts. If the inside cover burns, it can increase the risk of a fire. YSN will notify the vehicle manufacturers that equipped their RVs with the stove, and their dealers will provide replacement aluminum covers, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact YSN customer service at 1-310-715-1122.

**17E-054**

**TIRES:**

Trek Tire LLC (Trek Tire) is recalling certain Dunlop GrandTrek PT3A tires, size 275/50R21, manufactured between December 1, 2016, and December 7, 2016, which fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 139, "New Pneumatic Radial Tires for Light Vehicles." The affected tires lack the complete DOT identification marking prefix for radial tires and light vehicles. The lack of complete DOT identification markings can lead to inappropriate use of the tires, possibly increasing the risk of a crash. Dealer Tire LLC will notify owners and the noncompliant tires will be replaced free of charge. The recall is expected to begin during October 2017. Owners may contact Trek Tire at 1-207-200-6967.

**17T-015**

Max-Trac Tire Co., Inc. (Max-Trac) is recalling certain Avon Viper Stryke tires, sizes 120/70R14, 120/70R15, 160/60R14, and 160/60R15, manufactured from January 4, 2015, through April 8, 2017. A bulge may develop in the tread or the tread may separate from the tire. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 119, "New Pneumatic Tires-Other than Passenger Cars." A bulge in the tread or a tread separation can cause a loss of vehicle control, increasing the risk of a crash. Max-Trac will notify owners, and dealers will replace the tires, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Avon Motorcycle Tyres North America at 1-800-642-7470 extension 3159. Max-Trac's number for this recall is 169.

**17T-016**

**VEHICLES:**

Keystone RV Company (Keystone) is recalling certain 2016-2018 Springdale and Summerland recreational trailers. The wiring for the electric stabilizer jacks were incorrectly connected to the unprotected side of the breaker. An electrical short in the wiring for the electric stabilizer jack can increase the risk of a fire. Keystone will notify owners, and dealers will inspect the installation of the electrical stabilizer jack wiring, correcting it as necessary, free of charge. The recall began on September 22, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-299.

**17V-549**

Metro Worldwide LLC (Metro Worldwide) is recalling certain 2016-2017 Metro Link 28WC and 28SH transit buses. In certain configurations, if the bus is fully loaded, the vehicle may exceed the Gross Vehicle Weight

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

Rating (GVWR) and Gross Axle Weight Rating (GAWR) capacity. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Being overloaded can cause a loss of vehicle control, premature tire wear, or failure of suspension and braking systems, increasing the risk of a crash. Metro Worldwide will notify owners, and dealers will inspect the vehicles, removing a seat as necessary to get the vehicles within the GVWR and GAWR requirements, free of charge. Owners may contact Metro Worldwide customer service at 1-641-903-7369.

**17V-550**

Forest River, Inc. (Forest River) is recalling certain 2018 Prime Time Tracer recreational trailers. The Federal Placard on these vehicles may not list the correct tire pressure information of 65 PSI and 448 kPa. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims," and the requirements of 49 CFR Part 567, "Certification." Following the incorrect tire pressure information can cause the tires to prematurely fail, causing a loss of vehicle control and increasing the risk of a crash. Forest River will notify owners, and dealers will provide corrected Federal Placards, free of charge. The recall is expected to begin October 27, 2017. Owners may contact Forest River customer service at 1-574-862-1025. Forest River's number for this recall is 48-0514.

**17V-551**

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Prime Time Wildcat fifth-wheel recreational trailers. The water heater may have been installed too close to the underside of the slideroom possibly allowing carbon monoxide to enter the vehicle. If carbon monoxide enters the vehicle through the slideroom opening, it can increase the risk of injury. Forest River will notify owners, and dealers will install a kit to remedy the water heater's location, free of charge. The recall is expected to begin November 2, 2017. Owners may contact Forest River customer service at 1-574-862-1025. Forest River's number for this recall is 61-0515.

**17V-552**

Seagrave Fire Apparatus, LLC (Seagrave) is recalling certain 2017 Aerialscope emergency vehicles, equipped with Spicer D-Series and E-Series steer axles. The castellated nut on the steer axles may not be properly torqued, allowing the tie rod to loosen. If the tie rod loosens, it may disconnect from the steering knuckle, causing a complete loss of steering and increasing the risk of a crash. Seagrave will notify owners, and dealers will inspect the torque of the castellated nut and tie rod, tightening it as necessary. If the tie rod stud and knuckle on units cannot be sufficiently torqued, the dealer will replace the knuckle and tie rod end assembly, free of charge. The recall began on September 22, 2017. Owners may Seagrave for more information at 1-715-823-2141 extension 1910.

**17V-553**

PACCAR Incorporated (PACCAR) is recalling certain 2009-2010 Peterbilt 210 and 220 trucks; 2012-2018 Peterbilt 210, 220, 330 and 337 trucks; and 2010-2018 Kenworth K270 and K370 trucks. These LFNA trucks have a front axle sway bar link that may come loose on the frame rail end and fall into the path of the drag link, possibly binding the steering system. If the sway bar link detaches and falls into the drag link, it may impact the ability of the vehicle to steer properly, increasing the risk of a crash. PACCAR will notify owners, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

dealers will inspect the upper sway bar link attachment for a hardened washer installed between the bushing and the nut, installing a washer if it is missing, free of charge. The recall is expected to begin October 30, 2017. Owners may contact Kenworth customer service at 1-425-828-5000 or Peterbilt customer service at 1-940-591-4220. PACCAR's numbers for this recall are 817-D and 17KWE.

**17V-554**

Thor Motor Coach (TMC) is recalling certain 2014-2016 Ace, Challenger, Daybreak, Hurricane, Miramar, Outlaw, Windsport, Palazzo, Tuscany, and Tuscany XTE motorhomes. The windshield wipers may fail due to the system being incorrectly installed or secured. If the windshield wipers cannot be used, driver visibility would be reduced, increasing the risk of a crash. TMC will notify owners, and dealers will inspect the wiper system to verify it is installed correctly, repairing or replacing the system as necessary, free of charge. The recall began on September 27, 2017. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000146. Note: Although some of the vehicles included in this recall have previously been remedied under recalls 17V-096 or 17V-162, the vehicles may need additional repairs under this campaign.

**17V-555**

KZRV, L.P. (KZRV) is recalling certain 2017-2018 Sport Trek, Spree, and Connect recreational trailers. These vehicles may have been manufactured without a 2 amp fuse in the circuit for the awning lights. Without the fuse, excessive current can cause the wire to overheat, increasing the risk of a fire. KZRV will notify owners, and dealers will install a 2 amp fuse assembly as necessary, free of charge. The recall is expected to begin November 2, 2017. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2017-06.

**17V-556**

Eldorado National-California, Inc. (Eldorado National) is recalling certain 2015 35-foot and 40-foot Axess transit buses. The front suspension link rod clamps may not be properly torqued, allowing the link rod to loosen. A loose link rod can decrease steering ability, increasing the risk of a crash. Eldorado National will notify owners, and dealers will inspect the clamp for proper torque, installing new bolts as necessary, free of charge. The recall is expected to begin November 1, 2017. Owners may contact Eldorado National customer service at 1-909-591-9557.

**17V-557**

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2016 G5 school buses, equipped with CE White QS11 Series Convertible School Bus Seats. These seats were manufactured with integral D-Ring mounting studs that may have inadequate padding between the occupant and the D-ring mounting stud. In the event of a rear end collision, the seat occupant's head may contact the D-ring mounting stud, increasing the risk of injury. Micro Bird will notify owners, and the seat manufacturer will provide a remedy kit, free of charge. The recall began on October 23, 2017. Owners may contact the seat manufacturer at 1-419-492-2157 extension 243 or Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 17-071-CUS.

**17V-558**

Gillig LLC (Gillig) is recalling certain 2013-2016 Hybrid and all Electric Low Floor buses with electro-hydraulic

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

power steering assist. The coupler between the high-voltage electric motor and hydraulic steering pump shafts may fail, resulting in a loss of power steering assist. A loss of power steering assist will cause the need for increased steering effort, increasing the risk of a crash. Gillig will notify owners, and dealers will replace the steering motor-pump assemblies, free of charge. The recall began October 24, 2017. Owners may contact Gillig customer service at 1-800-735-1500.

**17V-559**

Altec Industries Inc. (Altec) is recalling certain 2011-2017 Altec LS63 Aerial Devices. The jib mast on these vehicles may bend under load. The jib mast may bend and fail, increasing the risk of injury to those nearby. Altec will notify owners and test the jib mast, replacing any that fail, free of charge. The recall began on October 13, 2017. Owners may contact Altec customer service at 1-205-991-7733. Altec's number for this recall is CSN 664.

**17V-560**

Highland Ridge RV (Highland Ridge) is recalling certain 2018 Open Range 3X fifth wheel recreational trailers. The labels on these vehicles may not list the correct tire size information of 235/85R16. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If the tire size information is incorrect, the operator may replace the tires with tires that are an incorrect size, increasing the risk of a crash. Highland Ridge has notified owners and provided corrected labels, free of charge. The recall began on September 22, 2017. Owners may contact Highland Ridge customer service at 1-260-768-7771. Highland Ridge's number for this recall is 9904359.

**17V-561**

Chrysler (FCA US LLC) is recalling certain 2013-2017 RAM 2500, 3500, 3500 Cab Chassis, 4500 Cab Chassis, and 5500 Cab Chassis vehicles, equipped with Cummins 6.7L Turbo Diesel engines that have Concentric-brand water pumps without a vent hole. These water pumps may leak coolant. The leaking water pump can increase the risk of an engine compartment fire. Chrysler will notify owners, and dealers will replace the water pumps, free of charge. The recall is expected to begin November 1, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T51.

**17V-562**

Cruiser RV (Cruiser) is recalling certain 2018 Shadow Cruiser Ultra Lite recreational trailers, models ID225RBS, ID240BHS, ID263RLS, ID279DBS, ID280QBS and ID289RBS. The axles on these vehicles were installed backwards, possibly reducing the braking ability or causing the brakes to temporarily lock up. Improper brake function can increase the risk of a crash. Cruiser has notified owners, and dealers will correct the axle installation, free of charge. The recall began on September 20, 2017. Owners may contact Cruiser customer service at 1-866-277-5630. Cruiser's number for this recall is 99.03.13.

**17V-563**

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain 2018 Sundance XLT TT recreational trailers, models ID221RB, ID241BH, ID273RL, ID281DB, ID283RB and ID291QB. The axles on these vehicles were installed backwards, possibly reducing the braking ability or causing the brakes to temporarily lock

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

up. Improper brake function can increase the risk of a crash. Heartland has notified owners, and dealers will correct the axle installation, free of charge. The recall began on September 20, 2017. Owners may contact Heartland customer service at 1-574-206-7920 or by email at [warranty@heartlandrvs.com](mailto:warranty@heartlandrvs.com). Heartland's number for this recall is 99.01.35.

**17V-564**

Kimble Mixer has recalled one model year 2014 Mixer Custom Chassis equipped with a Marmon-Herrington drive axle. The hex nuts were improperly torqued where the flange mounts to the yoke. The loose hex nuts may allow the driveshaft to disconnect from the drive axle, resulting in a loss of propulsion and increasing the risk of a crash. The affected vehicle for this recall has been repaired, therefore, a notification letter will not be issued. Owners may contact Kimble Mixer customer service at 1-918-286-2424. Kimble Mixer's number for this recall is 15E-065.

**17V-565**

Halcore Group, Inc. (Halcore) is recalling certain 2016-2017 American Emergency Vehicles (AEV) Traumahawk type III ambulances, equipped with door striker bolts that may fail under load. As such, these bolts fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 206, "Door locks and door retention components." If the door striker bolts fail under load, the door may open in a crash, increasing the risk of injury. AEV will notify owners, and dealers will replace the striker bolts, free of charge. The recall is expected to begin in October 2017. Owners may contact AEV customer service at 1-800-374-9749. Halcore's number for this recall is 17E-038.

**17V-566**

Volvo Bus Corporation (Volvo) is recalling certain 2017-2018 Prevost 9700 transit buses. The buses may not react when the accelerator pedal is pushed. If the vehicle does not accelerate when commanded, there would be an increased risk of a crash. Volvo will notify owners, and dealers will replace the accelerator pedals, free of charge. The recall is expected to begin in October 2017. Owners may contact Volvo customer service at 1-866-870-2046. Volvo's number for this recall is SR17-82.

**17V-568**

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain 2004-2006 Lancer and Lancer Evolution vehicles and 2004 Lancer Sportback vehicles. These vehicles are equipped with a passenger side frontal air bag that may be susceptible to moisture intrusion which, over time, could cause the inflator to rupture. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. Mitsubishi will notify owners, and dealers will replace the front passenger air bag inflator with a different inflator, free of charge. The recall began on October 12, 2017. Owners may contact Mitsubishi customer service at 1-888-648-7820. Mitsubishi's number for this recall is SR-17-001. Note: This recall supersedes recall 15V-321.

**17V-569**

Pierce Manufacturing (Pierce) is recalling certain 2015-2016 Arrow XT, Enforcer, Impel, Quantum, Saber, and Velocity vehicles, equipped with certain Spicer D-Series and E-Series steer axles. The castellated nut on the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

steer axles may not be properly torqued, allowing the tie rod to loosen. If the tie rod loosens, it may disconnect from the steering knuckle, causing a complete loss of steering and increasing the risk of a crash. Pierce will notify owners, and dealers will inspect the torque of the castellated nut and tie rod, tightening it as necessary. If the tie rod stud and knuckle on units cannot be sufficiently torqued, the dealer will replace the knuckle and tie rod end assembly, free of charge. The recall is expected to begin in October 2017. Owners may contact Pierce customer service at 1-414-832-3000.

**17V-570**

Nissan North America (Nissan) is recalling certain 2017 Infiniti Q50 and Q50 Hybrid vehicles. The driver's frontal air bag inflator may have been improperly welded. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator may crack and release the gas needed to properly deploy the air bag, increasing the risk of injury. Nissan will notify owners, and dealers will replace the driver side air bag inflator, free of charge. The recall is expected to begin October 30, 2017. Owners may contact Infiniti customer service at 1-800-662-6200, option 7.

**17V-571**

Chrysler (FCA US LLC) is recalling certain 2011-2014 Dodge Durango and Jeep Grand Cherokee vehicles. The affected vehicles had brake booster shields installed under a previous campaign to prevent water from entering the brake booster and limiting braking ability. This recall is to verify that the brake booster shield installation was performed properly. If the brake booster shield was not installed properly, the vehicle's braking ability may be reduced, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect the brake booster shield, correcting the installation as necessary, free of charge. The recall is expected to begin November 7, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T59.

**17V-572**

Forest River, Inc. (Forest River) is recalling certain 2015-2018 Vibe, and 2016-2018 Rainier recreational trailers. The liquid propane (LP) line may have insufficient clearance above the axle shackle. Without adequate clearance, the LP line may be damaged, resulting in a propane leak, increasing the risk of a fire. Forest River will notify owners, and dealers will replace the LP line with a longer one, routing it away from the axle hangers, free of charge. The recall is expected to begin November 10, 2017. Owners may contact Forest River customer service at 1-541-644-8063. Forest River's number for this recall is 64-0516.

**17V-573**

Mercedes-Benz USA, LLC. (MBUSA) is recalling one 2017 C43 AMG, one E300 4Matic sedan, one GLC300, and one E43 AMG 4Matic sedan. These vehicles have electrical power steering control units with improperly welded contact pins. The improperly welded pins may lose contact, deactivating the power steering assist and increasing the risk of a crash. MBUSA will notify owners, and dealers will replace the electric power steering rack, free of charge. The recall is expected to begin November 10, 2017. Owners may contact MBUSA customer service at 1-877-496-3691.

**17V-574**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

Navistar, Inc. (Navistar) is recalling certain 2016 International DuraStar, LoneStar, ProStar, TerraStar, TranStar, WorkStar, 9900i, and IC Bus HC vehicles equipped with certain Spicer D or E series steer axles. The castellated nut on the steer axles may not be properly torqued, allowing the tie rod to loosen. If the tie rod loosens, it may disconnect from the steering knuckle, causing a complete loss of steering, increasing the risk of a crash. Navistar will notify owners, and dealers will inspect the torque of the castellated nut and tie rod, tightening it as necessary, free of charge. The recall is expected to begin November 17, 2017. Owners may contact Navistar customer service at 1-331-332-1590. Navistar's number for this recall is 17507.

**17V-575**

Porsche Cars North America, Inc. (Porsche) is recalling certain 2003-2006 Cayenne S and Cayenne Turbo vehicles, 2004-2006 Cayenne vehicles, and 2006 Cayenne S "Titanium" Edition vehicles. These gasoline-powered vehicles have a fuel pump flange that may crack, allowing fuel to leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Porsche will notify owners, and dealers will replace the fuel filter flanges with new filter flanges that have a protective film, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AH10.

**17V-576**

Hyundai Motor America (Hyundai) is recalling certain 2018 Santa Fe Sport vehicles. The front coil springs may have been improperly manufactured and, as a result, may fracture under certain loads while driving. If the coil spring fractures, it can puncture the tire, causing a loss of vehicle control and increasing the risk of a crash. All of the affected vehicles are currently unsold on dealer lots. Dealers will replace both front coil springs, free of charge prior to the vehicle's sale. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 167.

**17V-577**

Hyundai Motor America (Hyundai) is recalling certain 2017 Santa Fe vehicles equipped with 3.3L engines. The crankshaft assemblies may have been produced with surface irregularities in the crankshaft pin, causing engine bearing wear. The engine bearing wear may cause the vehicle to stall, increasing the risk of a crash. Hyundai will notify all owners, and dealers will inspect and replace the engine, as necessary, free of charge. The recall is expected to begin October 18, 2017. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 168.

**17V-578**

Navistar, Inc. (Navistar) is recalling certain 2018-2019 IC Bus CE school buses. The hydraulic brake hose on the steer axle may be improperly routed and, as a result, the brake hose may contact the tire. Contact with the tire may cause the hose to leak brake fluid, affecting braking performance and increasing the risk of a crash. Navistar will notify owners, and dealers will correctly route the drop hose, replacing the drop hose if damage is found, free of charge. The recall began on October 11, 2017. Owners may contact Navistar customer service at 1-331-332-1590. Navistar's number for this recall is 17505.

**17V-579**



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

Navistar, Inc. (Navistar) is recalling certain 2016 IC Bus CE school buses equipped with certain Spicer D or E series steer axles. The castellated nut on the steer axles may not be properly torqued, allowing the tie rod to loosen. If the tie rod loosens, it may disconnect from the steering knuckle, causing a complete loss of steering, increasing the risk of a crash. Navistar will notify owners, and dealers will inspect the torque of the castellated nut and tie rod, tightening it as necessary, free of charge. The recall is expected to begin November 17, 2017. Owners may contact Navistar customer service at 1-331-332-1590. Navistar's number for this recall is 17508.

**17V-580**

Rosenbauer Motors (Rosenbauer) is recalling one model year 2017 Commander emergency vehicle equipped with a Cummins X15 diesel engine. This engine has a fuel pump whose drive gear may slip on its drive shaft, resulting in a loss of fuel pump function. Failure of the fuel pump will result in a sudden engine stall with no warning, and with no ability to restart, increasing the risk of a crash. Rosenbauer has notified the owner and the vehicle has been repaired, therefore, an owner notification letter will not be issued for this campaign. Owners may contact Rosenbauer customer service at 1-651-462-1000.

**17V-581**

Double K Inc. (Double K) is recalling certain 2016-2017 Hometown Trolley Villager, Mainstreet, and Streetcar trackless trolley buses, equipped with Recaro Commercial Bus Driver Seats, models Ergo R, Ergo D, AM71, AM72 and AM80. In the affected seats, the seat belt buckle may be stuck in the locked position, preventing the seat belt tongue from being able to be inserted and locked. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 209, "Seat Belt Assemblies." If the seat belt cannot be latched, the bus may be operated without the seat belt being used, increasing the risk of injury in the event of a crash. Double K will notify owners, and dealers will replace the buckle housings, free of charge. The recall is expected to begin in October 2017. Owners may contact Recaro customer service at 1-248-364-3818 or Double K customer service at 1-715-478-5090. Double K's number for this recall is 17E035.

**17V-582**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2004-2007 Touareg vehicles. These gasoline-powered vehicles have a fuel filter flange that may crack, allowing fuel to leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Volkswagen will notify owners, and dealers will inspect the fuel filter flange for cracks, replacing the flange if cracks are found. If no cracks are found, a protective cover will be installed onto the filter flange. These repairs will be performed free of charge. Parts are not currently available, but owners will be notified of the recall beginning November 19, 2017. A second notice will be sent when remedy parts become available. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 20Ai.

**17V-583**

REV Recreation Group (REV) is recalling certain 2013-2015 Fleetwood Bounder and 2013-2016 Fleetwood Southwind recreational vehicles. The welds attaching the battery tray may be insufficient. As a result, the tray may separate from underneath the chassis. An unsecured battery tray can cause a battery acid leak or an electrical short, increasing the risk of a fire or injury. REV will notify owners, and dealers will inspect the battery tray, and install fasteners, if necessary, to secure the battery tray, free of charge. The recall is expected to begin

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

November 20, 2017. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 170914REV.

**17V-584**

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Glaval Bus Apollo, Commute, Concorde II, Entourage, Legacy, Primetime, Titan II, Titan II Low Floor, and Universal transit buses. The seats were mounted with washers that may crack and dislodge, resulting in the seats being not securely mounted. If the seat is loose at the base there would be an increased risk of injury in the event of a sudden stop or crash. Forest River will notify owners, and dealers will replace the defective washers, free of charge. The recall is expected to begin November 17, 2017. Owners may contact Forest River customer service at 1-574-343-5167. Forest River's number for this recall is 35-0497.

**17V-585**

Kia Motors America (Kia) is recalling certain 2017 Sorento vehicles equipped with 3.3L engines. The engine crankshaft may have been improperly heat treated and may fail. If the crankshaft fails, the engine will stall, increasing the risk of a crash. A failed crankshaft also increases the risk of a fire. Kia will notify owners, and dealers will inspect the crankshaft, and, as necessary, replace the engine sub assembly, free of charge. The recall is expected to begin November 6, 2017. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC153.

**17V-586**

Daimler Trucks North America LLC (DTNA) is recalling certain 2014-2018 Thomas Built Buses Saf-T-Liner HDX and Saf-T-Liner C2 school buses. A reinforcement bracket may be missing from the seats that have 3-point seat belts. Without the reinforcement bracket, the seat may not be adequately secured, increasing the risk of injury in a crash. DTNA will notify owners, and dealers will inspect the seats, installing any missing reinforcement brackets, free of charge. The recall is expected to begin November 19, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-747.

**17V-587**

Daimler Trucks North America LLC (DTNA) is recalling certain 2013-2018 Western Star 4700 trucks. The battery cable may contact the all wheel drive axle yoke. Battery cable contact with the axle yoke may cause the cable to chafe and short, increasing the risk of a fire. DTNA will notify owners, and dealers will inspect the battery cables, repairing them as needed, free of charge. The recall is expected to begin November 17, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-746.

**17V-588**

Daimler Trucks North America LLC (DTNA) is recalling certain 2014-2018 Thomas Built Buses Saf-T-Liner HDX and Saf-T-Liner C2 transit buses. A reinforcement bracket may be missing from the seats that have 3-point seat belts. Without the reinforcement bracket, the seat may not remain adequately secured, increasing the risk of injury in a crash. DTNA will notify owners, and dealers will inspect the seats, installing any missing reinforcement brackets, as needed, free of charge. The recall is expected to begin November 19, 2017.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-747.

**17V-589**

Jayco, Inc. (Jayco) is recalling certain 2016-2017 Greyhawk motorhomes, model 29ME. Damage to the liquid propane (LP) line can occur by the line being melted by the vehicle's exhaust pipe, contacting the drive shaft, or being kinked at the p-clamp. A damaged LP line can increase the risk of a fire. Jayco will notify owners, and dealers will inspect the LP lines, correcting them or replacing them as necessary, free of charge. The recall began on October 13, 2017. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9903361.

**17V-590**

BMW of North America, LLC (BMW) is recalling certain 2014-2016 F800 GT and 2015-2016 F800 R motorcycles. The rear side reflex reflectors on these vehicles may not be properly visible in certain traffic conditions. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Obscured reflectors may reduce the visibility of the motorcycle, increasing the risk of a crash. BMW will notify owners, and dealers will modify the license plate holder to reposition the rear side reflex reflectors, free of charge. The recall is expected to begin November 13, 2017. Owners may contact BMW customer service at 1-800-525-7417.

**17V-591**

Daimler Vans USA, LLC (DVUSA) is recalling certain 2016 Mercedes-Benz Sprinter 2500/3500 vehicles. The affected vehicles were manufactured without a driveshaft catch strap, allowing a loose driveshaft to strike the fuel tank. A loose driveshaft may strike and puncture the gas tank, resulting in a fuel leak, increasing the risk of a fire. DVUSA will notify owners, and dealers will install the missing catch strap for the driveshaft, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267.

**17V-592**

PACCAR Incorporated (PACCAR) is recalling certain 2016 Peterbilt 220, 320, 325, 330, 337, 348, 365, 367, 382, 384, 386, 389, 389G, 567, 579 and 587 trucks and Kenworth K170, T170, T270, T370, T440, T470, T660, T680, T800, T880, and W900 trucks equipped with certain Spicer D or E series steer axles. The castellated nut on the steer axles may not be properly torqued, allowing the tie rod to loosen. If the tie rod loosens, it may disconnect from the steering knuckle, causing a complete loss of steering and increasing the risk of a crash. PACCAR will notify owners, and dealers will inspect the torque of the castellated nut and tie rod, tightening it as necessary. If the tie rod stud and knuckle on units cannot be sufficiently torqued, the dealer will replace the knuckle and tie rod end assembly, free of charge. The recall is expected to begin November 10, 2017. Owners may contact Peterbilt customer service at 1-940-591-4000 or Kenworth customer service at 1-425-828-5000. PACCAR's number for this recall is P817-C.

**17V-593**

Ford Motor Company (Ford) is recalling certain 2015 F-650 and F-750 trucks, equipped with certain Spicer D-Series and E-Series steer axles. The castellated nut on the steer axles may not be properly torqued, allowing

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

the tie rod to loosen. If the tie rod loosens, it may disconnect from the steering knuckle, causing a complete loss of steering and increasing the risk of a crash. Ford will notify owners, and dealers will inspect the torque of the castellated nut and tie rod, tightening it as necessary, free of charge. The recall is expected to begin November 20, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S30.

**17V-594**

Daimler Vans USA, LLC (DVUSA) is recalling certain model year 2015-2017 Mercedes-Benz Metris vans. These vehicles have electrical power steering control units with improperly welded contact pins. The improperly welded pins may lose contact, deactivating the power steering assist and increasing the risk of a crash. DVUSA will notify owners, and dealers will replace the electric power steering rack, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Daimler's customer service at 1-877-762-8267.

**17V-595**

Forest River, Inc. (Forest River) is recalling certain 2014 Starcraft Bus Prodigy School Buses. The affected buses were assembled with an inconsistent application of adhesive to the roof panels. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard FMVSS 221, "School Bus Body Joint Strength." Without a consistent application of adhesive, the panels may separate in the event of a crash, increasing the risk of injury. Forest River will notify owners, and dealers will inspect the joints for the proper amounts of adhesive, fixing them as necessary, free of charge. The recall is expected to begin November 20, 2017. Owners may contact Forest River customer service at 1-800-348-7440. Forest River's number for this recall is 05-0527.

**17V-596**

Keystone RV Company (Keystone) is recalling certain 2008-2009 Raptor recreational vehicles, models 3110 and 3018, equipped with IOTA ITS-50R transfer switches. These transfer switches may fail when exposed to elevated electrical loads in higher ambient temperatures. If the transfer switch fails, it can increase the risk of a fire. Keystone will notify owners, and dealers will replace the transfer switch, free of charge. The recall is expected to begin October 9, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-301.

**17V-597**

Ford Motor Company (Ford) is recalling certain 2018 Ford F-150 Raptor Super Cab pick-up trucks not equipped with a moonroof. The structural roof braces may be missing rivets at the attachment of the roof rail, thereby reducing the structural integrity. If the structural integrity is reduced, in the event of a rollover crash, there may be an increased risk of injury. Ford will notify owners, and dealers will install the rivets for the roof brace attachments, free of charge. The recall began October 17, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S29.

**17V-598**

Ford Motor Company (Ford) is recalling certain 2017 Ford F-150, F-250, F-350, F-450, and F-550 trucks

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

with manually-adjusted front passenger seats. The seat belt anchor may not be adequately welded to the seat cushion frame. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages," and 207, "Seating Systems." The seat belt buckle weld may fail, preventing the occupants from being properly restrained in the event of a crash, increasing the risk of injury. Ford will notify owners, and dealers will replace the front passenger manual seat track, free of charge. The recall is expected to begin November 6, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17C17.

**17V-599**

Trail King Industries, Inc. (Trail King) is recalling certain 2013-2018 Flatbed Trailers, model numbers TK20, TKT20, TK24, TKT24, and TK32. The axles on these vehicles may have been installed incorrectly, reducing the braking ability of the electric brakes. The brakes may not be able to be applied to full strength, increasing the risk of a crash. Trail King has notified owners, and dealers will inspect the orientation of the brakes, correcting them if necessary, free of charge. The recall began on October 4, 2017. Owners may contact Trail King customer service at 1-800-843-3324.

**17V-600**

Chrysler (FCA US LLC) is recalling certain 2015-2017 RAM ProMaster City vehicles. These vehicles have incorrect information on the tire placard including incorrect vehicle capacity weight, total number of occupants, tire pressure and/or "None" designation for the spare tire size when a full size spare tire is present. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect tire placard can cause the operator to exceed the vehicle's weight capacity, or inflate the tires to an incorrect pressure, affecting vehicle handling, which can increase the risk of a crash. Chrysler will notify owners, and dealers will replace the incorrect tire placard with a corrected one, free of charge. The recall is expected to begin November 15, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T62.

**17V-601**

C & M Trailers Inc. (C&M) is recalling certain 2015-2016 cargo trailers that are over 80 inches wide. The affected trailers were built with side marker lamps mounted over 60 inches high. As such, these trailers fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Other motorists may not be able to identify the correct length of a trailer, increasing the risk of a crash. C&M will notify owners, and dealers will correct the height of the markers, free of charge. The recall is expected to begin November 1, 2017. Owners may contact C&M's customer service at 1-972-875-4528.

**17V-602**

Wabash National Corporation (Wabash) is recalling certain 2012-2013 converter dolly trailers. The affected trailers have fasteners connecting the counter weight tube to the body that may wear and/or loosen over time allowing the detachment of the counterweight tube from the converter dolly body while in motion. Detachment of the counter weight while the dolly is in motion can increase the risk of a crash. Wabash will notify owners, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

dealers will weld the counter weight permanently to the structure, free of charge. The recall began October 12, 2017. Owners may contact Wabash customer service at 1-765-771-5404.

**17V-603**

Polar Tank Trailer, LLC. (Polar) is recalling certain 2018 SRJ7 trailers manufactured with Meritor MTA/MTP trailer suspensions. The brake caliper bolts on these axles may not be properly torqued which can allow the caliper to detach from the mounting flange. If the caliper bolts are improperly torqued and the caliper detaches from the mounting flange, a loss of braking ability would occur, increasing the risk of a crash. Polar has notified the vehicle owners, instructing them to check the caliper bolts per the supplied bulletin, receiving reimbursement from Meritor. The recall began on October 4, 2017. Owners may contact Polar customer service at 1-320-746-2255 or Meritor at 1-866-668-7221. Polar's number for this recall is C17AB.

**17V-604**

BMW of North America, LLC (BMW) is recalling certain 2006-2010 BMW X3 2.5i, X3 3.0i and X3 xDrive30i Sports Activity Vehicles. The front passenger seat occupant detection mat that determines if, and how, the passenger frontal air bag should deploy in a crash may fatigue and develop cracks which could lead to a system failure. Should the system fail, in the event of a crash, the front passenger air bag would be deactivated, increasing the risk of personal injury. BMW will notify owners, and dealers will replace the front passenger seat occupant detection mat, free of charge. The recall is expected to begin November 20, 2017. Owners may contact BMW customer service at 1-800-525-7417.

**17V-605**

Silver Eagle Manufacturing Company (Silver Eagle) is recalling certain 2018 Vast20W converter dolly trailers, equipped with MPA/MTA suspensions and Meritor EX225 brakes. The brake caliper bolts on these axles may not be properly torqued which can allow the caliper to detach from the mounting flange. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the caliper bolts are improperly torqued and the caliper detaches from the mounting flange, a loss of braking ability would occur, increasing the risk of a crash. Silver Eagle has notified owners, and fleets will be reimbursed by Meritor to inspect the bolts, and replacing any loose or missing ones. The recall began on October 10, 2017. Owners may contact Silver Eagle customer service at 1-800-547-6792 or the Meritor call center at 1-866-668-7221.

**17V-606**

Hino Motor Sales U.S.A., Inc. (Hino) is recalling certain 2011-2012 NE8J, NJ8J, and NV8J trucks. The engines have a wrist pin bushings in the connecting rods that may shift and cause excessive cylinder wear. Excessive wear of the cylinders can result in engine failure, increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin around November 30, 2017. Owners may contact Hino customer service at 1-248-699-9300. Hino's number for this recall is AA860.

**17V-607**

Kia Motors America (Kia) is recalling certain 2014-2016 Soul and Soul EV vehicles. The pinion plug may allow the pinion gear to separate from the steering gear assembly. If the pinion gear separates, steering will be lost,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING SEPTEMBER 2017**

*Published October 27, 2017*

increasing the risk of a crash. Kia will notify owners, and dealers will inspect and secure the pinion plug or replace the steering gear assembly, as necessary, free of charge. The recall is expected to begin November 16, 2017. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC155. Note: This recall supersedes campaigns 14V-332 and 15V-736. Vehicles previously remedied under those numbers are being recalled again under this campaign.

**17V-608**

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2015-2017 Outlander, 2015-2016 Lancer and Outlander Sport, and 2015 Lancer Evolution vehicles. These vehicles may have defective relays that can result in an engine stall, reduced engine power or the engine overheating. If the engine stalls, there is an increased the risk of a crash. MMNA will notify owners, and dealers will replace the affected relays, free of charge. The recall began October 24, 2017. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-17-005.

**17V-609**

Maserati North America, Inc. (Maserati) is recalling certain 2015-2017 Quattroporte GTS vehicles equipped with a V8 3.8 liter engine. A resistor in the low pressure fuel pump resistor may fail, causing a loss of engine power or a stall. A stall can increase the risk of a crash. Maserati will notify owners, and dealers will replace the fuel pump resistor cable assembly, free of charge. The recall is expected to begin November 13, 2017. Owners may contact Maserati customer service at 1-201-510-2369. Maserati's number for this recall is 359.

**17V-610**