

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

CHILD SEATS:

None during September 2018.

EQUIPMENT:

AXN Heavy Duty LLC (AXN) is recalling certain Trailer Axles. The wheel end nut locking device on these trailers may not be properly installed, allowing the wheel end to separate from the axle. If the wheel end separates from the axle, it can increase the risk of a crash. AXN has notified the trailer manufacturers that purchased the axles, and dealers for those manufacturers will inspect the locking clip to ensure its proper installation, correcting it as necessary, free of charge. The recall began on August 29, 2018. Owners may contact AXN customer service at 1-502-882-9122.

18E-088

Sunright International of America, Inc. (Sunright) is recalling certain Rodia RHD200 and Rodia RHD200V helmets in all sizes manufactured August 1, 2008-July 31, 2018. When load is applied to the helmet such as in the event of a crash, the chin strap may stretch, allowing the helmet to separate from the rider's head. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 205, "Motorcycle Helmets." If the helmet does not remain secured to the rider's head in the event of a crash, it can increase the risk of injury. The remedy for this recall is still under development. The recall began October 12, 2018. Owners may contact Sunright customer service at 1-770-682-3035.

18E-089

Dexter Axle Company (Dexter Axle) is recalling certain Torsion Trailer Axles, models #10, #10F and #11. The brake mounting flanges may be incorrectly oriented, possibly resulting in premature brake failure. Premature brake failure can increase the risk of a crash. Dexter Axle will notify the trailer manufacturers that purchased the axles, and dealers for those manufacturers will inspect the axles and replace the entire axle, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Dexter customer service at 1-574-295-7888.

18E-090

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain Toyota Racing Development (TRD) brake kits, part numbers PTR09-21111 and PTR09-52080, sold by Toyota as an optional accessory for model year 2008-2015 Scion xB, and 2011-2016 Scion tC vehicles. Over time, the brake hoses in these kits may fatigue and fail. Failure of a brake hose will reduce braking performance and increase the risk of a crash. Toyota will notify all known owners of the Scion xB and Scion tC vehicles upon which an involved optional TRD Brake Kit could have been installed. If the vehicle is equipped with one of the TRD brake kits, it will be replaced with a standard equipment brake kit, free of charge. The recall is expected to begin November 12, 2018. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is J0U.

18E-091

BMW of North America, LLC (BMW) is recalling certain BMW TurboCord Portable Chargers, part number

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

61442448670, and MINI TurboCord Portable Chargers, part number 61440003082. Capacitors within these charging systems may fail, possibly resulting in a shock hazard or a fire. An electrical shock or a fire can increase the risk of injury or death. BMW will notify owners, and dealers will inspect the charging cable, and replace it if necessary, free of charge. The recall is expected to begin November 12, 2018. Owners may contact BMW customer service at 1-800-525-7417 and MINI customer service at 1-866-825-1525.

18E-092

Ioxus Corporation (Ioxus) is recalling certain uStart energy storage modules, part number UST12V1100G31-ISA. The overlay seal may delaminate over time, allowing moisture to enter. If moisture enters the storage module, it can cause an electrical short, increasing the risk of a fire. Ioxus will notify owners. A remedy plan has not yet been provided. The manufacturer has not yet provided a notification schedule. Owners may contact Ioxus customer service at 1-877-751-4222.

18E-093

TIRES:

Continental Tire the Americas, LLC (Continental Tire) is recalling certain Conti Hybrid HS3 tires, size 11R22.5 LI 146/143, Load Range H with DOT codes A33TKWUY 0818 through A33TKWUY 1318. These tires may have cords visible through the innerliner. Tires that have cords visible through the innerliner can have sudden air loss, causing a loss of vehicle control, increasing the risk of a crash. Continental Tire will notify owners, and dealers will provide replacement tires, free of charge. Owners may contact Continental customer service at 1-800-726-7113.

18T-012

VEHICLES:

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2016-2018 Toyota Prius vehicles. A portion of the engine wire harness connected to the hybrid Power Control Unit (PCU), could contact the cover at this connection and wear, causing an electrical short circuit. An electrical short can increase the risk of a fire. Toyota will notify owners, and dealers will inspect the engine wire harness assembly and replace it if damage is found. A protective sleeve or protective tape will be included to prevent any future damage. These repairs will be performed free of charge. The recall is expected to begin October 2018. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is J0T.

18V-579

Collins Bus Corporation (Collins Bus) is recalling certain 2012-2018 School Buses, equipped with Ricon S-Series and K-Series Titanium Wheelchair Lifts. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle floor height. If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. Collins Bus will notify owners and Ricon dealers will replace the injection molded cam with an aluminum machined cam, free of charge. The recall is expected to begin October 2018. Owners may contact

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

Collins Bus customer service at 1-800-533-1850 extension 424 or Ricon Customer Service at 1-800-322-2884.

18V-584

Trailstar International Inc. (Trailstar) is recalling certain 2019 Dump trailers. The locking device on the wheel end nut may be improperly installed, which can cause the wheel to separate from the axle. If the wheel separates from the axle, it can increase the risk of a crash. Trailstar has notified owners, and dealers will inspect the retaining clip on the Pro Torque nuts, properly securing it as necessary, free of charge. The recall begins on September 17, 2018. Owners may contact Trailstar customer service at 1-330-821-9900 or AXN Heavy Duty at 1-502-882-9122.

18V-585

General Motors LLC (GM) is recalling certain 2015 Chevrolet Silverado 1500, Tahoe and Suburban, GMC Sierra 1500 and Yukon, and Cadillac Escalade vehicles. Electric power steering (EPS) assist may be lost momentarily, followed by a sudden return of EPS assist. If EPS assist is lost and then suddenly returns, the driver may have difficulty steering the vehicle, especially at low speeds, increasing the risk of a crash. GM will notify owners, and dealers will update the EPS module software, free of charge. The recall began October 12, 2018. Owners may contact Cadillac customer service at 1-800-458-8006, Chevrolet customer service at 1-800-222-1020 and GMC customer service at 1-800-462-8782. GM's number for this recall is 18289.

18V-586

Midwest Fire Equipment & Repair Company (Midwest) is recalling certain 2017-2019 Midwest All-Poly Series and Quick Attack emergency vehicles, equipped with certain Whelen accessory brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Midwest will notify owners, and Whelen will replace the brake lights, free of charge. The recall began September 15, 2018. Owners may contact Midwest customer service at 1-800-344-2059.

18V-587

Navistar, Inc. (Navistar) is recalling certain 2017-2018 International ProStar and 9900i trucks, 2018-2019 International LT trucks, 2017-2019 International LoneStar and HX trucks and 2017 International PayStar trucks, equipped with Cummins ISX15 or X15 diesel engines. In certain driving conditions, such as on a long down-hill grade, the fuel line may burst if the fuel pump cooling circuit screen becomes restricted. If the fuel line bursts, fuel may leak onto the road resulting in a roadway hazard for other motorists. The engine may also stall without warning, resulting in the vehicle's inability to restart, increasing the risk of a crash. Cummins will notify the affected owners. The remedy for this recall is still under development. Navistar issued owners an interim notification on October 11, 2018. Owners may contact Navistar customer service at 1-800-448-7825, or Cummins customer service at 1-800-286-6467.

18V-588

Volvo Car USA LLC (Volvo) is recalling certain 2019 Volvo XC60 hybrid electric vehicles, equipped with certain AeroVironment electric vehicle TurboCord and TurboDock/TurboDX charging systems. Capacitors

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

within these charging systems may fail, possibly resulting in a shock hazard or a fire. An electrical shock or a fire can increase the risk of injury or death. Volvo will notify owners, and dealers will inspect the charge cord, replacing it as necessary, free of charge. The recall is expected to begin November 5, 2018. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R39901. Note: Owners are advised not to use the charging cord until it is inspected.

18V-589

Fabform Industries, Inc. (Fabform) is recalling certain 2017-2018 Fabform Power Tilt dump trailers. The hinges welded on the bottom frame may fracture and the dump box may unexpectedly fall. If the dump box falls unexpectedly, it can increase the risk of injury or death. Fabform will notify owners, and dealers will install gussets with reinforced welds to the existing hinges, free of charge. The recall began on September 13, 2018. Owners may contact Fabform customer service at 1-541-679-2920.

18V-590

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2018-2019 Mitsubishi Outlander vehicles equipped with 18-inch alloy wheels. The Certification Label lists an incorrect rear wheel rim size. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect rim size information on the label can cause the operator to replace the rim with an incorrect rim size, increasing the risk of a crash. MMNA will notify owners and send them a corrected certification label, free of charge. Owners can also choose to have the label replaced by a dealer, free of charge. The recall began September 26, 2018. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-18-006.

18V-591

Ford Motor Company (Ford) is recalling certain 120V Convenience charge cords that were supplied with and sold for use with 2013-2015 Ford C-Max Energi and Fusion Energi vehicles and 2012-2015 Ford Focus Electric vehicles. Cords with part numbers FM58-10B706-AA, FM58-10B706-AB, FM58-10B706-AC, FM58-10B706-AD, FM58-10B706-AE and FM58-10B706-AF were manufactured without thermistors, and during vehicle charging, increased resistance in the house's outlet or wiring can cause the cord to overheat and melt. An overheated cord can increase the risk of a fire. Ford will notify owners, and dealers will replace the current cord with a new 120V convenience cord with a thermistor, free of charge. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S24.

18V-592

Nissan North America, Inc. (Nissan) is recalling certain 2019 INFINITI QX50 vehicles. In the event of a crash in very cold temperatures, the trim cover may separate unexpectedly from the passenger-side knee air bag module instead of splitting at the trim cover tear seam as designed. If the passenger-side knee air bag cover detaches during deployment, it can increase the risk of injury. INFINITI will notify owners, and retailers will replace the passenger-side knee air bag module, free of charge. The recall is expected to begin October 2018. Owners may contact INFINITI customer service at 1-800-662-6200.

18V-593

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

Halcore Group, Inc. (Halcore) is recalling certain 2017-2018 AEV Traumahawk Type I & Type III ambulances, equipped with Whelen accessory brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Halcore will notify owners, and Whelen will replace the brake lights, free of charge. The recall is expected to begin October 2018. Owners may contact Halcore customer service at 1-800-447-0343.

18V-594

General Motors LLC (GM) is recalling certain 2014-2016 Cadillac CTS vehicles, equipped with heated front seats. The flexible heating mats in the front seats may be damaged over time, resulting in the seat heaters producing excessive heat. In cold ambient temperatures, the seat heaters in these vehicles can turn on automatically when the vehicle is remotely started. If a damaged seat heater is turned on while no one is inside the vehicle, the damaged seat heater can overheat, increasing the risk of a fire. GM will notify owners, and dealers will recalibrate the body control module, disabling the automatic activation of the heated seat when the vehicle is remotely started, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for the recall is 18286.

18V-595

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2018 Micro Bird MBII school buses equipped with certain NextGen School Bus seats with Integrated Child Restraint Systems. These seats may be missing a warning label on the lower restraint strap. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." Without a warning label, the seat may be used improperly, increasing the risk of injury. Micro Bird will notify owners, and the seat manufacture will provide the missing labels and instructions for their installation, free of charge. The recall began October 18, 2018. Owners may contact Micro Bird customer service at 1-819-477-2012 or Hickory Springs customer service at 1-419-492-2157 extension 243. Micro Bird's number for this recall is 18-076-IUS.

18V-596

Navistar, Inc. (Navistar) is recalling certain 2019 International HX, DuraStar, WorkStar, HV, LoneStar, LT, MV, and RH vehicles, and IC Bus HC, CE, and RE vehicles equipped with long stroke brake chambers and spring actuated parking brakes. The spring actuated parking brake may be improperly crimped to the long stroke service brake chamber, causing a service brake air leak and the possible separation of the spring brake chamber from the service brake section. An air leak or separation of the spring brake chamber can increase the needed stopping distance, increasing the risk of a crash. Navistar will notify owners, and dealers will replace the brake chamber assemblies from the suspected lot, free of charge. The recall is expected to begin November 6, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18512.

18V-597

Navistar, Inc. (Navistar) is recalling certain 2019 IC Bus CE and RE school buses equipped with long stroke

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

brake chambers and spring actuated parking brakes. The spring actuated parking brake may be improperly crimped to the long stroke service brake chamber, causing a service brake air leak and the possible separation of the spring brake chamber from the service brake section. If there is an air leak or separation of the spring brake chamber, it can lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Navistar will notify owners, and dealers will replace the brake chamber assembly, free of charge. The recall is expected to begin November 6, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18513.

18V-598

Honda (American Honda Motor Co.) is recalling certain 2017 Acura NSX vehicles. Road vibrations may cause the metal screws that secure the printed circuit board for the high mounted center brake light to loosen and contact the circuitry, possibly resulting in the brake light fuse blowing and the brake lights not functioning. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Brake lights that do not work increase the risk of a crash. Honda will notify owners, and dealers will replace the center high mount brake light, free of charge. The recall is expected to begin November 6, 2018. Owners may contact Acura Client Relations at 1-844-682-2872. Honda's number for this recall is B2B.

18V-599

Honda (American Honda Motor Co.) is recalling certain 2017-2018 Acura NSX vehicles. The crossover pipe couplers between the left and right fuel tanks may leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. Honda will notify owners, and dealers will replace the left and right fuel tanks, free of charge. The recall is expected to begin November 6, 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are U29, and Z28.

18V-600

Nissan North America, Inc. (Nissan) is recalling certain 2015-2017 Nissan Murano, 2016-2017 Nissan Maxima, 2017-2018 Nissan Pathfinder, and 2017 Infiniti QX60 vehicles. The Anti-Lock Brake (ABS) actuator pumps may allow brake fluid to leak onto an internal circuit board. A brake fluid leak on the circuit board may result in an electrical short, increasing the risk of a fire. Nissan will notify owners, and dealers will inspect the serial number on the ABS actuator, replacing it as necessary, free of charge. Owners may contact Nissan customer service at 1-800-867-7669. Note: When brake fluid has leaked onto the circuit board, the ABS warning lamp will remain illuminated for more than 10 seconds after engine start up. If this occurs, owners are advised to park the vehicle outdoors away from other vehicles or structures and to not drive the vehicle.

18V-601

REV Ambulance Group Orland, Inc. (REV) is recalling certain 2017-2018 Road Rescue, Marque, Wheeled Coach, Frontline, and McCoy Miller Type I and Type III ambulances, equipped with Whelen accessory brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. REV will notify owners,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

and Whelen will replace the brake lights, free of charge. The recall began October 19, 2018. Owners may contact REV customer service at 1-855-661-9232.

18V-602

Turtle Top is recalling certain 2013-2018 Turtle Top Odyssey, VanTerra, and Terra Transit transit buses, equipped with Ricon S-Series and K-Series Titanium Wheelchair Lifts. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle floor height. If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Turtle Top customer service at 1-800-296-2105.

18V-603

Halcore Group, Inc. (Halcore) is recalling certain 2017-2018 Horton Type I and Type III ambulances, equipped with Whelen accessory brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Halcore will notify owners, and Whelen will replace the brake lights, free of charge. The recall began on September 5, 2018. Owners may contact Halcore customer service at 1-800-447-0343.

18V-605

E-One Incorporated (E-One) is recalling certain 2017-2019 Cyclone II, Typhoon and Quest II emergency vehicles, equipped with Whelen accessory brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. E-One will notify owners, and dealers will replace the brake lights, free of charge. The recall is expected to begin November 1, 2018. Owners may contact E-One customer service at 1-352-861-3612.

18V-606

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2018 Mercedes Benz S63 AMG 4MATIC and S65 AMG vehicles. The software calibration for the Active Lane Keeping Assist may be incorrect, and as a result, the system may not intervene in the event of an unintended lane departure while traveling faster than 65 miles an hour. If the Active Lane Keeping Assist does not intervene as expected above 65 miles per hour, there would be an increased risk of a crash. MBUSA will notify owners, and dealers will update the multipurpose camera software, free of charge. The recall began October 5, 2018. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number for this recall is 2018090008.

18V-607

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 Mercedes-Benz C300, C300 4MATIC, C63 AMG, and C63S AMG vehicles. Incorrect bonding of the rear window may cause the window to loosen and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

detach from the vehicle. If the window detaches from the vehicle, it can become a road hazard, increasing the risk of a crash. MBUSA will notify owners, and dealers will rework the rear window bonding, free of charge. The recall is expected to begin November 2, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-608

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 Mercedes-Benz E63S AMG 4MATIC vehicles. The front passenger seat can be adjusted beyond its intended limit. If the passenger seat is adjusted beyond its intended limit, the occupant may have an increased risk of injury in the event of a crash. MBUSA will notify owners, and dealers will inspect the adjustment range, and if needed, install a mechanical adjustment range limitation or update the seat control unit software, free of charge. The recall is expected to begin October 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-609

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 GLC300 4MATIC Coupe, GLC300, GLC300 4MATIC, GLC350e 4MATIC, GLC43 AMG 4MATIC Coupe, and GLC43 AMG 4MATIC vehicles equipped with LED headlights. The front turn signals may have an incorrect color of pink or violet. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Turn signals that are the wrong color may not be as easily recognized by other drivers, increasing the risk of a crash. MBUSA will notify owners, and dealers will inspect the color of the turn signal, replacing the LED module as necessary, free of charge. The recall is expected to begin November 9, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-610

Coach and Equipment Mfg Corp. (Coach and Equipment) is recalling certain 2013-2014 Coach and Equipment Condor LT, 2013-2017 Phoenix and Metro Lite and 2015 Pegasus transit buses, equipped with Ricon S-Series and K-Series Titanium Wheelchair Lifts. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle floor height. If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. Coach and Equipment has notified owners, and Ricon servicing dealers will replace the input cam, free of charge. The recall began September 27, 2018. Owners may contact Coach and Equipment customer service at 1-800-724-8464 or Ricon customer service at 1-800-322-2884 or by emailing the Ricon at Admin18E044@wabtec.com.

18V-611

Ford Motor Company (Ford) is recalling certain 2018 Ford Edge and Lincoln MKX vehicles. These vehicles may have door striker bolts that are shorter than intended. Vehicles with shorter door striker bolts fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 206, "Door Locks and Door Retention Components" potentially resulting in the doors opening in the event of a crash. If the doors open in the event of a crash, there is an increased risk of injury. Ford will notify owners, and dealers will replace the door striker bolts, free of charge. The recall is expected to begin October 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18C06.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

18V-612

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain 2017-2019 Ferrara Inferno, Igniter, Cinder, Ultra, and Intruder emergency vehicles equipped with Whelen accessory brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Ferrara will notify owners, and dealers will replace the brake lights, free of charge. The recall is expected to begin November 1, 2018. Owners may contact Ferrara customer service at 1-800-443-9006.

18V-613

BMW of North America, LLC (BMW) is recalling certain 2018-2019 BMW X6 sDrive35i, X6 xDrive35i, X6 xDrive50i, and X6M vehicles. The wheel bolts on these vehicles may not have been properly tightened. The improperly tightened wheel bolts may loosen and break, affecting vehicle handling and control and increasing the risk of a crash. BMW will notify owners, and dealers will replace and tighten all of the wheel bolts, free of charge. The recall is expected to begin November 1, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-614

New Flyer of America Inc. (New Flyer) is recalling certain 2016-2018 New Flyer XDE60, XDE40, and 2017 XDE35 transit buses, equipped with certain Allison transmission hybrid drive units. The pressure switches on these drive units may fail, possibly resulting in a loss of drive. A loss of drive can disable the vehicle unexpectedly, increasing the risk of a crash. New Flyer will notify owners, and Allison Transmission service centers will replace the C1 and C2 pressure switches, free of charge. The recall began on September 25, 2018. Owners may contact New Flyer customer service at 1-204-224-6706. New Flyer's number for this recall is R18-014.

18V-615

Highland Ridge RV (Highland Ridge) is recalling certain 2019 Highland Ridge Open Range Ultra Lite, Mesa Ridge, and Open Range Lite travel trailers. The axles may be missing inner bearing races on the hubs, which can cause the bearing to burnout or cause the hub to overheat. The missing bearing race may cause premature hub bearing failure, possibly resulting in a separation of the hub from the axle, thereby increasing the risk of a crash. Highland Ridge will notify owners, and dealers will replace the defective hubs with new hubs or replace the axles, free of charge. The recall began October 18, 2018. Owners may contact Highland Ridge customer service at 1-260-768-7771. Highland Ridge's number for this recall is 9904410.

18V-616

Altec Industries Inc. (Altec) is recalling certain 2018 Altec AC18, AC23, AC30, AC40, AC45 Cranes, D2045, DT65 Digger Derricks, and AA55 Aerial Devices. The rotation platform fasteners may have been overtightened, possibly resulting in the fasteners breaking. If the fasteners break, the pedestal or turntable may separate from the vehicle, increasing the risk of injury. Altec has notified owners, and the rotation bearing

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

fasteners will be replaced, free of charge. The recall began on September 21, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is MAB 692.

18V-617

Jayco, Inc. (Jayco) is recalling certain 2019 Jayco White Hawk, Jay Flight, and Jay Flight SLX travel trailers. The axles may be missing inner bearing races on the hubs, which can cause the bearing to burnout or cause the hub to overheat. The missing bearing race may cause premature hub bearing failure, possibly resulting in a separation of the hub from the axle, thereby increasing the risk of a crash. Jayco will notify owners, and dealers will replace the defective hubs with new hubs or replace the axles, free of charge. The recall began October 18, 2018. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901410.

18V-618

Lakota Corporation (Lakota) is recalling certain 2018-2019 Lakota Bighorn, Charger and Colt trailers equipped with a 6 or 8 cubic foot refrigerator installed in main living area with a roof vent. The refrigerator roof vent may be blocked by insulation. A blocked roof vent may increase the risk of a fire or can cause carbon monoxide to enter the living quarters increasing the risk of injury. Lakota has notified owners, and dealers will inspect the vent to make sure that it is not blocked, correcting it as necessary, free of charge. The recall began September 25, 2018. Owners may contact Lakota customer service at 1-574-848-1636.

18V-619

Mitsubishi Motors North America (MMNA) is recalling certain 2018 Mitsubishi Outlander PHEV, Outlander Sport, 2018-2019 Eclipse Cross, and 2017-2018 Outlander vehicles equipped with a Forward Collision Mitigation (FCM) system that detects pedestrians. Due to incorrect software, the FCM-ECU (Electronic Control Unit) may apply braking for longer than needed, even after a pedestrian is no longer detected. If the FCM-ECU software activates the brake for longer than necessary, the driver may react by applying additional braking. The resulting rapid deceleration of the vehicle can increase the risk of a rear-end collision. MMNA will notify owners, and dealers will reprogram the FCM-ECU software with updated software, free of charge. The recall began October 16, 2018. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-18-007.

18V-620

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2018 Mitsubishi Outlander Sport vehicles equipped with a Forward Collision Mitigation (FCM) system and 2018 Mitsubishi Outlander PHEV and Eclipse Cross vehicles and 2017-2018 Outlander vehicles equipped with an Adaptive Cruise Control (ACC) system and/or an Electric Parking Brake (EPB) system. The software for the Hydraulic Unit Electronic Control Unit (ECU) may be incorrect, possibly preventing the intervention of a safety system such as automatic emergency braking, Anti-lock Braking (ABS), Electronic Stability Control (ESC), or the Brake Auto Hold (BAH) function when any of these systems are in use. If the safety systems do not function as intended, it can increase the risk of a crash. MMNA will notify owners, and dealers will update the Hydraulic Unit-ECU software, free of charge. The recall began October 16, 2018. Owners may contact MMNA customer service at 1-888-648-7820.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

MMNA's number for this recall is SR-18-008.

18V-621

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2017-2019 Commercial Pumper, Commercial Rescue, Commercial Tanker, Commercial Wildland, 2018-2019 Predator Aerial, Predator Panther Pumper, Predator Pumper, Predator Rescue, Predator SS Pumper, Predator Tanker, 2018 Predator Panther Aerial, Predator Panther Tanker, Predator SS Aerial, Predator SS TDA, and Predator TDA vehicles equipped with Whelen accessory brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. KME will notify owners, and dealers will replace the brake lights, free of charge. The recall is expected to begin November 1, 2018. Owners may contact KME customer service at 1-800-235-3928.

18V-622

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River Berkshire motorhomes. The affected vehicles have entry doors with latch rods that may be improperly adjusted, allowing the door to open while moving. If the door opens while moving it can increase the risk of injury or a crash. Forest River will notify owners, and dealers will readjust the door latch rod, free of charge. The recall began October 9, 2018. Owners may contact Forest River customer service at 1-574-522-1368. Forest River's number for this recall is 40-0853.

18V-623

Forest River, Inc. (Forest River) is recalling certain 2019 Coachmen Catalina and Apex travel trailers and Forest River Shasta, Wildwood, Salem, Vibe, Sierra, Sandpiper, XLR and Prime Time travel trailers. The axles may be missing inner bearing races on the hubs, which can cause the bearing to burnout or cause the hub to overheat. The missing bearing race may cause premature hub bearing failure, possibly resulting in a separation of the hub from the axle, thereby increasing the risk of a crash. Forest River will notify owners, and dealers will replace the defective hubs with new hubs or replace the axles, free of charge. The recall began October 9, 2018. For customer service, Catalina owners may contact Coachmen at 1-574-825-8657, Apex owners should call 1-574-358-0401, Shasta owners: 1-574-825-8717, Wildwood and Salem owners: 1-574-534-3167, Vibe owners: 1-574-296-2084, Sierra and Sandpiper owners: 1-574-534-4574, XLR owners: 1-574-642-0432, Prime Time owners: 1-574-862-1025. Forest River's number for this recall is 51-0851.

18V-624

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2018 Land Rover Range Rover, Land Rover Range Rover Sport and Land Rover Discovery vehicles. The Autonomous Emergency Braking (AEB) system may be disabled without warning the driver that the system is not functional. If the AEB does not intervene when needed, without warning, there would be an increased risk of a crash. Land Rover will notify owners, and dealers will update the vehicle software, free of charge. The recall began October 17, 2018. Owners may contact Land Rover customer service at 1-800-637-6837, Option 9. Land Rover's number for this recall is N227.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

18V-625

Subaru of America, Inc. (Subaru) is recalling certain 2010-2014 Subaru Legacy and Outback vehicles equipped with a manual transmission. The electronic parking brake (EPB) may not engage as intended, allowing the vehicle to rollaway if the transmission is not in the proper gear when parked. A vehicle rollaway can increase the risk of a crash. Subaru will notify owners, and dealers will replace the EPB actuator assembly, free of charge. The recall is scheduled to begin November 7, 2018. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WTV-81.

18V-626

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River East to West travel trailers. These vehicles may have been manufactured without a carbon monoxide detector, preventing occupants from being warned if carbon monoxide levels become too high. Exposure to high levels of carbon monoxide can increase the risk of injury. Forest River will notify owners, and dealers will install a battery-powered carbon monoxide detector, free of charge. The recall began October 10, 2018. Owners may contact Forest River customer service at 1-574-264-6664 extension 50008. Forest River's number for this recall is 500-0855.

18V-627

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River East to West travel trailers, model 27KNS. Incorrect axle shackles may have been installed on these vehicles, allowing the tires to contact the floor or wheel well while moving. If the tires contact a part of the trailer, they may be damaged and fail, causing a loss of vehicle control and increasing the risk of a crash. Forest River will notify owners, and dealers will install a taller equalizer to the suspension to add length to the shackle, free of charge. The recall began October 10, 2018. Owners may contact Forest River customer service at 1-574-264-6664 extension 50008. Forest River's number for this recall is 500-0856.

18V-628

Honda (American Honda Motor Co.) is recalling certain 2018 Honda Accord and 2019 Honda Insight vehicles. In certain scenarios, the back-up camera center display may not function properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rearview Mirrors." If the rearview camera display does not show what is behind the vehicle, it can increase the risk of a crash. Honda will notify owners, and dealers will reprogram the display audio unit software, free of charge. The recall is expected to begin November 5, 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are K2G and V2F.

18V-629

Honda (American Honda Motor Co.) is recalling certain 2018 Honda CRF250L motorcycles. The wiring harness may have been inappropriately installed, potentially resulting in damage to the wiring harness and affecting the operation of safety components such as the exterior lighting, horn, and instrument panel. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment," and 123, "Motorcycle Control Displays." Lack of exterior lights can reduce the visibility of the motorcycle to traffic. A non-functioning horn can cause the inability

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

to alert traffic of an impending crash, and a non-functioning instrument panel will not display the speed or fuel level. A damaged wiring harness can also result in an engine stall, increasing the risk of a crash. Honda will notify owners, and dealers will inspect the wiring harness, replacing it as necessary, free of charge. The recall is expected to begin November 5, 2018. Owners may contact Honda customer service at 1-866-784-1870. Honda's number for this recall is KJ7.

18V-630

Mazda North American Operations (Mazda) is recalling certain 2009-2010 Mazda Mazda6 vehicles sold, or ever registered in Connecticut, Delaware, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, Wisconsin and the District of Columbia. The front cross member may corrode after exposure to road salt. Corrosion may weaken the mounting point for the passenger side lower control arm, unexpectedly changing the steering alignment and increasing the risk of a crash. Mazda will notify owners, and dealers will inspect the cross member and either install a side member and drain hose and apply wax to protect from rust, or install a drain hose and an improved front cross member, free of charge. The recall is expected to begin November 12, 2018. Owners may contact Mazda customer service at 1-800-222-5500 Option 4. Mazda's number for this recall is 2818I.

18V-631

Bentley Motors, Inc. (Bentley) is recalling certain 2018 Bentley Mulsanne and 2018 Bentayga vehicles. When reverse gear has been selected, the rearview camera display may be obstructed or may not be fully visible within two seconds. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rearview Mirrors." If the full camera view is obstructed or delayed and the driver does not check their surroundings before backing up, there may be an increased risk of a crash. Bentley will notify owners, and dealers will reprogram the software in the infotainment system, free of charge. The recall began October 19, 2018. Owners may contact Bentley customer service at 1-800-777-6923. Bentley's number for this recall is RE 18/11.

18V-632

Cruiser RV (Cruiser) is recalling certain 2019 Embrace, Fun Finder Xtreme Lite, MPG, Radiance Ultra Lite and Shadow Cruiser Ultra Lite travel trailers. The axles may be missing inner bearing races on the hubs, which can cause the bearing to burnout or cause the hub to overheat. The missing bearing race may cause premature hub bearing failure, possibly resulting in a separation of the hub from the axle, thereby increasing the risk of a crash. Cruiser will notify owners, and dealers will replace the defective hubs with new hubs or replace the axles, free of charge. The recall began October 9, 2018. Owners may contact Cruiser customer service at 1-574-206-7920. Cruiser's number for this recall is 99.03.15.

18V-633

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain 2019 Heartland Mallard, Pioneer, Sundance XLT, Wilderness, North Trail, Prowler and Trail Runner travel trailers. The axles may be missing inner bearing races on the hubs, which can cause the bearing to burnout or cause the hub to overheat. The missing bearing race may cause premature hub bearing failure, possibly resulting in a separation of the hub from

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

the axle, thereby increasing the risk of a crash. Heartland will notify owners, and dealers will replace the defective hubs with new hubs or replace the axles, free of charge. The recall began October 9, 2018. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99.01.40.

18V-634

Chrysler (FCA US LLC) is recalling certain 2018-2019 Alfa Romeo Stelvio Quadrifoglio vehicles. The engine cooling hose may have inadequate webbing material allowing a coolant leak. A loss of coolant can cause the engine to overheat and the vehicle to stall, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the coolant hose, free of charge. The recall began October 10, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U99.

18V-635

Chrysler (FCA US LLC) is recalling certain 2017-2018 Alfa Romeo Giulia and 2018 Alfa Romeo Stelvio vehicles, equipped with 2.0L engines. These engines may misfire causing the catalytic converter to overheat, possibly resulting in damage to the nearby wiring and engine components. Heat damage to the engine compartment wiring or components can increase the risk of a fire or it can cause an engine stall, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect the vehicles for diagnostic codes, and update the engine control module software, free of charge. The recall began October 10, 2018. Owners may contact Chrysler customer service at 1-844-253-2872. Chrysler's number for this recall is UA4.

18V-636

Grand Design RV (Grand Design) is recalling certain 2019 Grand Design Reflection travel trailers, model 295RL. The outside 110V outlet was not correctly wired to a ground-fault (GFI) protected circuit. In the event of an electrical issue with an appliance or component that is plugged into the outside electrical outlet, an electrical shock may result, increasing the risk of injury. Grand Design will notify owners, and dealers will install a new correctly wired ground fault receptacle, free of charge. The recall began October 8, 2018. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 900014.

18V-637

Trail King Industries, Inc. (Trail King) is recalling certain 2016-2018 Trail King ACS and AACS trailers with aluminum cross members over the suspension. The aluminum cross members may crack in the welded corners where the cross member attaches to the frame beam, potentially causing the suspension to loosen from the frame. If the suspension loosens the frame, it can increase the risk of a crash. Trail King will notify owners, and dealers will replace the cross members, free of charge. The recall began October 24, 2018. Owners may contact Trail King customer service at 1-800-843-3324. Trail King's number for this recall is TK201802.

18V-638

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017-2018 Audi R8 Spyder and R8 Coupe vehicles. Transmission fluid may leak from the gearbox ventilation hose after certain high speed and maneuvering situations. If leaked transmission fluid contacts hot engine parts, it can increase the risk of a fire. Audi will notify owners, and dealers will replace the single gearbox ventilation hose with a double ventilation hose, free of charge. The recall began October 18, 2018. Owners may contact Audi customer service at 1-800-253-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

2834. Volkswagen's number for this recall is 34J1.

18V-639

Forest River, Inc. (Forest River) is recalling certain 2012-2016 Elkhart Coach ECII, Glaval Apollo and Sport buses, 2017-2018 Glaval Commute buses, 2012-2018 Glaval Entourage, Titan and Universal, StarCraft Bus Allstar and Starlite buses, 2013-2018 Glaval Legacy, Primetime and Titan II buses, 2015-2016 Allstar XL MVP buses, 2014-2016 StarCraft Prodigy buses, 2014 StarCraft Quest and Starquest buses, 2017 StarCraft Quest buses and 2016 StarCraft Senator II buses. These vehicles are equipped with certain Ricon S-Series and K-Series Titanium Wheel chair Lifts that have a wheelchair lift positioning input cam that may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. Forest River will notify owners, and Ricon dealers will replace the wheelchair lift positioning input cam, free of charge. The recall began October 10, 2018. Owners may contact Ricon customer service at 1-800-322-2884. Forest River's number for this recall is 51-0852.

18V-640

Daimler Trucks North America, LLC (DTNA) is recalling certain 2019 Freightliner 108SD, 114SD, 122SD and Business Class M2 trucks and Western Star 4700 and 4900 trucks, equipped with certain Bridgestone M854 tires with date codes 2418-2518, Bridgestone M860A tires with date code 2518, and Bridgestone M864 tires with date codes 2318-2418, all of size 425/65R22.5. The sidewall steel body cords may be exposed, which can cause unexpected, rapid air loss during use. Rapid air loss can increase the risk of a crash. DTNA will notify owners, and dealers will inspect and replace the affected tires, as necessary, free of charge. The recall is expected to begin November 16, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL790.

18V-641

Heil Environmental (Heil) is recalling certain 2014-2016 Rear Loader, Side Loader, Front End Loader and Rolloff Body/Hoist garbage trucks. The hydraulic oil tank brackets may crack, causing the oil tank to detach from the chassis frame rails and leak hydraulic oil. Hydraulic oil leaking onto the roadway can increase the risk of a crash. Heil will notify owners, and dealers will replace both oil tank supporting brackets, free of charge. The recall is expected to begin in October 2018. Owners may contact Heil customer service at 1-866-275-4345. Heil's number for this recall is BRACKET.

18V-642

Livin' Lite Recreational Vehicles (Livin' Lite) is recalling certain 2017-2019 Livin' Lite CampLite travel trailers, models 21BHS, 21RBS, 23RKS and 23RLS. The drawbar of the trailer may crack resulting in the trailer separating from the tow vehicle. If the trailer separates from the tow vehicle, it can increase the risk of a crash. Livin' Lite will notify owners, and dealers will inspect and repair the welds, as necessary, and install an additional tube to reinforce the drawbar, free of charge. The recall is expected to begin November 5, 2018. Owners may contact Livin' Lite customer service at 1-800-768-4016 extension 154 or 153.

18V-643

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

Navistar, Inc. (Navistar) is recalling certain 2019 International MV and 2018-2019 International HV trucks equipped with option for combined trailer stop and turn lights. When a trailer is connected to one of the affected vehicles, the trailer brake lights may not illuminate when the truck's brakes are used. If the trailer brake lights fail to illuminate, other drivers may not be warned of the vehicle slowing, increasing the risk of a crash. Navistar will notify owners, and dealers will relocate the trailer brake light circuits from the trailer turn signal circuits to the vehicle brake light circuits, free of charge. The recall began October 23, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18514.

18V-644

Daimler Trucks North America LLC (DTNA) is recalling certain 2018-2019 Freightliner 108SD, 114SD, and Business Class M2 vehicles. The steering shaft assembly may have been installed incorrectly, which can cause a loss of connection between the steering wheel and the front wheels. A loss of connection between the steering wheel and front wheels can cause a loss of vehicle control, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect and repair the steering shaft assembly, as necessary, free of charge. The recall is expected to begin November 16, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-791.

18V-646

Spartan Motors USA (Spartan) is recalling certain 2018-2019 Spartan Metrostar emergency vehicles. The wheel studs may have not been properly heat treated causing them to fail. If enough of the improperly heat treated studs fail on the same steer axle hub, the wheel may detach, increasing the risk of a crash. All affected vehicles have been repaired, therefore owner notification letters will not be mailed. The recall began June 26, 2018. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 18027.

18V-647

Lion Electric Company (Lion) is recalling certain 2016 Lion Lion C electric school buses. In the event of a crash, the ceiling joints may separate due to being assembled incorrectly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 221, "School Bus Body Joint Strength." If the ceiling joint separates in the event of a crash, it can increase the risk of injury. Lion will notify owners, and dealers will install rivets and glue to secure the joints, free of charge. The recall is expected to begin in October 2018. Owners may contact Lion customer service at 1-855-546-6706. Lion's number for this recall is 2018RECALL01.

18V-648

Multiquip, Inc. (Multiquip) is recalling certain 2018 Water trailers, models WTE5C and WTE5HP. These trailers have axles that have incorrect Gross Axle Weight Ratings (GAWR) of 2,470lbs instead of the intended 3,500lbs. The incorrect axles may fail from being overloaded, increasing the risk of a crash. Multiquip will notify owners, and dealers will replace the axle assemblies, free of charge. The recall began October 1, 2018. Owners may contact Multiquip customer service at 1-800-421-1244.

18V-649

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

Newmar Corporation (Newmar) is recalling certain 2019 Newmar Dutch Star motorhomes. The brake pedal assembly may catch on the dash, preventing the brake pedal from fully releasing. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 105, "Hydraulic and Electric Brake Systems." If the brake pedal does not properly release, it can increase the risk of a crash. Newmar has notified owners, and dealers will reroute the brake adjustment cable, free of charge. The recall began November 3, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

18V-650

Keystone RV Company (Keystone) is recalling certain 2016-2019 Keystone Impact and Fuzion recreational trailers. The wiring for the electric brakes may contact the tires or wheels, causing damage to the wires, potentially reducing the trailer's braking ability. A loss of braking ability can increase the risk of a crash. Keystone will notify owners, and dealers will inspect the wiring for damage, making repairs as necessary, install wiring protection and re-route the wiring, free of charge. The recall began October 22, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-330.

18V-651

BMW of North America, LLC (BMW) is recalling certain 2018 BMW 330e iPerformance, i3 Rex, i3 Sport Rex, X5 xDrive40e, i3 BEV, i3 Sport BEV and 2019 i8 and i8 Roadster vehicles and 2018-2019 530e iPerformance, 530e xDrive iPerformance and 740Le xDrive iPerformance vehicles. Capacitors within the TurboCord Portable Chargers may fail, possibly resulting in a shock hazard or a fire. An electrical shock or a fire can increase the risk of injury or death. BMW will notify owners, and dealers will inspect the charging cable, and replace it if necessary, free of charge. The recall is expected to begin November 12, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-652

Dennis Eagle Inc. (Dennis Eagle) is recalling certain 2017-2018 Dennis Eagle Elite garbage trucks. The ignition barrels on these vehicles may have been improperly secured, allowing the housing to rotate freely and ignition wiring to become detached, possibly resulting in a stall. A vehicle stall can increase the risk of a crash. Dennis Eagle will notify owners, and dealers will install a metal anti-rotation ring to keep the ignition barrel secured, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Dennis Eagle customer service at 1-813-440-8136.

18V-653

Spartan Motors USA (Spartan) is recalling certain 2017-2019 Spartan MetroStar and Gladiator emergency vehicles equipped with Whelen accessory brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Spartan will notify owners, and dealers will replace the brake lights, free of charge. The recall is expected to begin October 2018. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 18026.

18V-654

General Motors LLC (GM) is recalling certain 2016-2018 Chevrolet Express and GMC Sierra vehicles

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

equipped with a single, manual, rear climate control module (CCM). If the temperature is set to maximum heat or the mode knob is set to maximum floor vent and an electrical short occurs, components within the CCM may overheat. If the CCM overheats, there is an increased risk of a fire in the vehicle's headliner. GM will notify owners, and dealers will remove the electrical insulation from a wiring connector within the CCM to remove the fire risk, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 18299.

18V-655

Kia Motors America (Kia) is recalling certain 2018 Kia Sorento vehicles. The cowl crossbar that connects to the Motor Driven Power Steering (MDPS) steering column may be improperly welded, allowing the steering column to separate. If the steering column separates, it can cause a loss of steering ability, increasing the risk of a crash. Kia will notify owners, and dealers will replace the cowl crossbar, free of charge. The recall is expected to begin October 2018. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC167.

18V-656

PACCAR Incorporated (PACCAR) is recalling certain 2017-2019 Kenworth C500, T600, T660, T680, T800, T880 and W900 trucks, as well as Peterbilt 367, 386, 389, 567, 579 and 587 trucks, equipped with Cummins ISX15 or X15 diesel engines. In certain driving conditions, such as on a long down-hill grade, the fuel line may burst if the fuel pump cooling circuit screen becomes restricted. If the fuel line bursts, fuel may leak onto the road resulting in a roadway hazard for other motorists. The engine may also stall without warning, resulting in the vehicle's inability to restart, increasing the risk of a crash. Cummins will notify owners, and dealers will replace the suspect fuel pump cooling circuit screen, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact PACCAR customer service at 1-940-591-4220. PACCAR's number for this recall is 18E081.

18V-657

Grand Design RV, LLC (Grand Design) is recalling certain 2019 Grand Design Reflection, Imagine and Transcend travel trailers. These axles may be missing inner bearings on the hubs, which can cause the bearing to burnout or cause the hub to overheat. If the bearings prematurely wear, it can cause the hub to overheat and smoke, increasing the risk of a fire. Grand Design will notify owners, and dealers will replace the defective hubs with new hubs or replace the axles, free of charge. The recall began October 22, 2018. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 910015.

18V-658

Winnebago Industries, Inc (Winnebago) is recalling certain 2019 Winnebago Horizon vehicles. The affected vehicles have entry doors that have latch rods that may be improperly adjusted, allowing the door to open while moving. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 206, "Door Locks and Door Retention Components." If the door opens while moving, it can increase the risk of injury or a crash. Winnebago has notified owners, and dealers will readjust the door latch rod, free of charge. The recall began on October 12, 2018. Owners may contact Winnebago customer service

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

at 1-641-585-6939 or 1-800-537-1885. Winnebago's number for this recall is 154.

18V-659

Fontaine Trailer Company (Fontaine) is recalling certain 2019 Fontaine Infinity trailers. These trailers were built with an under ride guard compliant for a wheels back trailer configuration, however, due to the customers design changes, the wheel set was moved forward and the vehicles no longer meet the definition of a wheels back trailer. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 223, "Rear Impact Guards," and 224, "Rear Impact Protection." The incorrect rear impact guards may not adequately reduce the possibility of a car traveling under the trailer in the event of a crash, increasing the risk of injury to the car driver. Fontaine will notify owners, and dealers will remove the C-channel style horizontal member and replace it with a 4-inch tube and reinforcement gusset, free of charge. The recall began September 14, 2018. Owners may contact Fontaine customer service at 1-877-345-9526.

18V-660

Honda (American Honda Motor Co.) is recalling certain 2014 Honda Insight and Acura TSX and TSX Wagon, 2014-2015 Honda Crosstour and Pilot vehicles nationwide, as well as certain 2014 Honda FCX Clarity and Fit EV vehicles in Florida, Hawaii, Puerto Rico, Texas, Alabama, Georgia, Louisiana, Mississippi, South Carolina, California, American Samoa, Guam, the Northern Mariana Islands (Saipan) and the U.S. Virgin Islands.

Honda is also recalling certain 2011-2013 Acura TSX, TSX Wagon and ZDX, Honda Crosstour, Insight, Fit and Pilot vehicles, 2011-2012 Honda Accord and 2011 Honda Civic NGV, Civic, Civic Hybrid and CR-V vehicles in Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia and West Virginia.

Lastly, Honda is recalling certain 2010-2013 Acura TSX and ZDX, Honda Crosstour, Fit, Insight and Pilot, 2011-2013 TSX Wagon, 2010-2012 Honda Accord and 2010-2011 Honda Civic NGV, Civic, Civic Hybrid and CR-V vehicles in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment (such as after a vehicle crash necessitating replacement of the original air bags), may explode due to propellant degradation occurring after long-term exposure to higher absolute humidity, temperature and temperature cycling.

An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death.

Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are M2J and S2K.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

18V-661

Honda (American Honda Motor Co.) is recalling certain 2014 Honda Ridgeline vehicles nationwide. Honda is also recalling certain 2011-2012 Acura RL, 2011 Honda Element and 2011-2013 Ridgeline vehicles in Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia.

Lastly, if not included above, Honda is recalling certain 2010-2011 Honda Element, 2010-2012 Acura RL and 2010-2013 Ridgeline vehicles in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment (such as after a vehicle crash necessitating replacement of the original air bags), may explode due to propellant degradation occurring after long-term exposure to higher absolute humidity, temperature and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Honda will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin November 13, 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are H2H and S2I.

18V-662

Honda (American Honda Motor Co.) is recalling certain 2017-2018 Honda Civic and CR-V vehicles. The magnet that controls the torque sensor output signal for the electronic power steering system may not be properly secured, allowing the magnet to become dislodged. During a full lock turn, the dislodged magnet may cause steering assist to be applied in the opposite direction. The unintended steering input reduces vehicle maneuverability and increases the risk of a crash. Honda will notify owners, and dealers will replace the steering gearbox assembly, free of charge. The recall is expected to begin November 5, 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are C2N, P2O.

18V-663

Honda (American Honda Motor Co.) is recalling certain 2019 Honda Insight, Odyssey, and Ridgeline vehicles. The Supplemental Restraint System (SRS) control unit may have a manufacturing error, possibly resulting in the air bags or seatbelt pretensioners not deploying in the event of a crash. In the event of a crash, if the air bags or seatbelt pretensioners do not function as intended, there would be an increased risk of injury. Honda will notify owners, and dealers will replace the SRS unit, free of charge. The recall is expected to begin November 5, 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are B2R, C2P, and Z2Q.

18V-664

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

Gillig LLC (Gillig) is recalling certain 2017-2018 Gillig Low Floor transit buses equipped with certain Allison transmission hybrid drive units. The pressure switches on these Drive Units may fail, possibly resulting in a loss of drive. A loss of drive can disable the vehicle unexpectedly, increasing the risk of a crash. Gillig will notify owners, and Allison Transmission service centers will replace the C1 and C2 pressure switches, free of charge. The recall is expected to began October 4, 2018. Owners may contact Allison Transmission at 1-800-252-5283 or Gillig customer service at 1-800-735-1500.

18V-665

Kia Motors America (Kia) is recalling certain 2017-2018 Kia Niro hybrid electric vehicles. The Main Relay within the Power Relay Assembly (PRA) may have inadequate connections between its contacts, causing increased electrical resistance. The increased electrical resistance can overheat the rear seat which is above the PRA, increasing the risk of a fire. Kia will notify owners, and dealers will inspect the Power Relay Assembly (PRA) for damage. If no damage is found, the main relay will be replaced. If damage is found, the PRA will be replaced. These repairs will be performed free of charge. The recall is expected to begin November 23, 2018. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC168.

18V-666

Suzuki Motor of America, Inc. (Suzuki) is recalling certain 2006 Suzuki Grand Vitara vehicles. The power steering pump belt tension adjuster pulley has an outer portion that is made of plastic. Repeated heat stress can cause the plastic material to deteriorate, causing pieces of the pulley to break off. Broken pieces of the pulley can get caught between the pulley and the drive belt, causing the drive belt to come off, resulting in a sudden loss of power steering assist, increasing the risk of a crash. Suzuki will notify owners, and dealers will replace the power steering pump drive belt tension adjuster pulley, free of charge. The recall is expected to begin October 2018. Owners may contact Suzuki customer service at 1-800-934-0934. Suzuki's number for this recall is 4009. Note: The vehicles included in this recall were not previously recalled under 10V-250.

18V-667

Volvo Trucks North America (Volvo) is recalling certain 2016-2019 Volvo VNL trucks equipped with Cummins ISX15 diesel engines. In certain driving conditions, such as on a long down-hill grade, the fuel line may burst if the fuel pump cooling circuit screen becomes restricted. If the fuel line bursts, fuel may leak onto the road resulting in a roadway hazard for other motorists. The engine may also stall without warning, resulting in the vehicle's inability to restart, increasing the risk of a crash. Cummins will notify owners, and dealers will replace the single screen filter banjo bolt will be replaced with a dual screen filter banjo bolt, free of charge. The recall is expected to begin October 2018. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1802.

18V-668

Maintainer Corporation of Iowa, Inc. (Maintainer) is recalling certain 2017-2018 Maintainer Service Mechanic Bodies mounted on Ford F-Series Super Duty trucks. These vehicles have a FORCE America Hydraulic pump that can interfere with the front axle driveshaft when the front suspension is fully articulated, causing wear and the possible premature failure of the driveshaft. Interference with the front axle driveshaft could cause the drive shaft to separate, resulting in damage to other nearby components, increasing the risk of a crash. Maintainer will notify

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

owners, and dealers will replace the existing pump with a different brand hydraulic pump, and inspect the front axle driveshaft for damage, replacing it as needed, free of charge. The recall began October 9, 2018. Owners may contact Maintainer customer service at 1-800-831-8588.

18V-669

Nova Bus (Nova) is recalling certain 2017 Nova Bus LFS Hybrid and LFS Arctic Hybrid transit buses equipped with certain Allison transmission hybrid drive units. The pressure switches on these drive units may fail, possibly resulting in a loss of drive. A loss of drive can disable the vehicle unexpectedly, increasing the risk of a crash. Nova will notify owners, and Allison Transmission service centers will replace the C1 and C2 pressure switches, free of charge. The recall began October 5, 2018. Owners may contact Nova customer service at 1-800-350-6682. Nova's number for this recall is CR4435.

18V-670

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2019 Volkswagen Jetta vehicles equipped with LED headlights. The passenger side headlight may be incorrectly positioned, reducing the driver's visibility when it is dark. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." A reduction in the driver's visibility can increase the risk of a crash. Volkswagen will notify owners, and dealers will replace the passenger side headlight, free of charge. The recall is expected to begin November 25, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 94L1.

18V-671

Spartans Motors USA (Spartan) is recalling certain 2019 Spartan K2 Specialty vehicles. The upper mounting fasteners for the air spring may protrude, possibly resulting in the air spring bag being punctured. A punctured air spring may deflate, possibly resulting in an overloading of the tag axle tires, thereby increasing the risk of a crash. Spartan will notify owners, and dealers will replace air springs, free of charge. The recall is expected to begin in October 2018. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 18028.

18V-672

General Motors LLC (GM) is recalling certain 2018-2019 Cadillac CT6, Escalade ESV, Chevrolet Suburban, Volt, and GMC Yukon XL vehicles. Certain second-row or third-row rear seatbelts retractor assemblies may not automatically lock when the seatbelt is fully pulled out of the retractor, possibly preventing a child seat from being properly secured. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." If the child seat is not properly secured in the event of a crash, it can increase the risk of injury. GM will notify owners, and dealers will inspect the rear seatbelt retractors and replace them if necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Cadillac customer service at 1-800-458-8006, Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 18315.

18V-673

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

BMW of North America, LLC (BMW) is recalling certain 2013-2015 BMW 760Li vehicles. The Engine Control Unit (ECU) may have been programmed with incompatible software during a service visit, possibly causing the engine to stall. An engine stall can increase the risk of a crash. All affected vehicles have been repaired by programming the ECU with the correct software. Therefore, owner letters will not be sent. Owners may contact BMW customer service at 1-800-525-7417.

18V-674

Chrysler (FCA US LLC) is recalling certain 2018-2019 Jeep Wrangler vehicles. The front track bar brackets may be improperly welded, which can cause the bracket to separate from the frame, reducing steering capability. An unexpected reduction in steering ability, can increase the risk of a crash. Chrysler will notify owners, and dealers will inspect and repair the track bar bracket welds, as necessary, free of charge. The recall is expected to begin November 17, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is UA5.

18V-675

Midwest Fire Equipment & Repair Company (Midwest) is recalling certain 2014-2019 Midwest Fire All-Poly Series emergency vehicles equipped with Class 1 Ultraview Touchscreens manufactured by Hale Products. These touchscreens may experience false switch activations that can happen without the operator's knowledge causing accessories to turn on or off, affecting vehicle performance. The unintended turning on or off of accessories such as emergency beacons or automatic snow chains can increase the risk of a crash. Midwest will notify owners, and dealers will upgrade the software or retrofit fuses, free of charge. The recall began October 23, 2018. Owners may contact Midwest customer service at 1-800-344-2059.

18V-676

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2019 FCCC MC motorhome chassis. The primary air line was incorrectly connected to the secondary air pressure gauge and the secondary air line was connected to the primary air pressure gauge. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." In the event of a failure of one of the two air systems, an incorrect air pressure reading may occur, confusing the driver, therefore increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the air gauge lines for proper connection, correcting them as necessary, free of charge. The recall is expected to begin November 24, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-793.

18V-677

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River Flagstaff and Rockwood recreational trailers. The brake mounting flanges on the torsion axles may be incorrectly oriented, which can result in premature brake failure. Premature brake failure can increase the risk of a crash. Forest River has notified owners, and dealers will replace the axles or hubs, free of charge. The recall began on October 12, 2018. Owners may contact Forest River customer service at 1-574-642-2640 or Dexter customer service at 1-574-295-7888.

18V-678

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2018**

Published October 25, 2018

Integrated Tower Systems, Inc. (ITS) is recalling certain 2007-2018 Integrated Tower Systems Mobile Tower trailers that can only be powered by 220V A/C power. The control panel, part number CCP1828E, may not have a power disconnect on one of the two incoming hot legs. The missing power disconnect can result in an electrical shock, increasing the risk of injury. ITS will notify owners, and dealers will modify the control panel, free of charge. The recall is expected to begin in October 2018. Owners may contact ITS customer service at 1-800-850-8535.

18V-679

BMW of North America, LLC (BMW) is recalling certain 2019 BMW X6 sDrive35i, X6 xDrive35i, X6 xDrive50i and X6M vehicles. The rear upper control arm pivot bolts may have been improperly hardened, possibly causing the rear upper control arms to break. If a rear upper control arm breaks, it can affect vehicle handling and control, increasing the risk of a crash. BMW will notify owners, and dealers will replace both rear upper control arms, free of charge. The recall is expected to begin November 12, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-680

KZRV, L.P. (KZRV) is recalling certain 2017-2019 KZRV Sonic 190VRB travel trailers. The liquid propane (LP) manifold may be located close to the axle tube, which can result in damage to the manifold, causing a leak. A damaged and leaking LP manifold can increase the risk of a fire. KZRV will notify owners, and dealers will relocate the LP manifold, free of charge. The recall is expected to begin November 19, 2018. Owners may contact KZRV customer service at 1-800-768-4016, extension 154 or 153. KZRV's number for this recall is KZ-2018-09.

18V-681