

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

CHILD SEATS:

Dorel Juvenile Group (Dorel) is recalling certain Maxi-Cosi Pria 70 Convertible child seats. When the seat is installed in the forward facing position and secured to the car using the lap belt without also using the top tether, the seat may not adequately protect the child from head injury in the event of a crash. As such, these child seats fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." If the seat is installed with only the lap belt, the child has an increased risk of injury in the event of a crash. Dorel will provide remedy kits containing replacement labels and instruction booklets and provide, at no charge, Maxi-Cosi Rodi Sport Booster seats rated for children 40-100 pounds and 43 to 57 inches in height. Owner notification letters were issued beginning October 12, 2021. Owners may contact Dorel customer service at 1-877-657-9546 or by email at Pria85recall@djgusa.com.

21C-004

EQUIPMENT:

Cummins, Inc. (Cummins) is recalling certain Electric Drivetrain Systems, model number BES CM2450 EV101B, and part number D1U0001BX03. When a system shutdown occurs, the high voltage shutdown override switch may not function, with no warning to the driver. An unexpected vehicle shutdown without the ability to override it, can increase the risk of a crash. Dealers will inspect and update as necessary, the parameter settings for the protection override switch, free of charge. Owner notification letters were mailed October 8, 2021. Owners may contact Cummins customer service at 1-800-286-6467. Cummins number for this recall is C2491.

21E-083

Guangzhou Hengshang Network Technology (GHNT) is recalling certain Nineo F2-H11 replacement LED bulbs. The lights may be too bright, exceeding the maximum light output allowed which may adversely affect the vision of drivers. As such, these bulbs fail to comply with the requirements of Federal Motor Vehicles Standard number 108, "Lamps, Reflective Devices, and Associated Equipment." Excessive glare or brightness to oncoming drivers increases the risk of a crash. Nineo will provide a replacement halogen bulb, free of charge. Owners may contact GHNT customer service at 1-345-027-4753 or Nineo customer service at 1-852-2709-9962.

21E-084

Certain PS ED power steering pumps manufactured by ZF North America are being recalled. Pressure may build in the power steering pump, causing the shaft seal to leak and resulting in a loss of power steering assist. A loss of power steering assist can increase the risk of a crash. Dealers of the affected manufacturers Autocar and Spartan Fire, will replace the power steering pumps on affected vehicles, free of charge. Autocar owners may contact Autocar's customer service at 1-888-218-3611 or 1-877-973-3486. Spartan Fire owners may contact Spartan Fire customer service at 1-517-543-6400.

21E-085

UFP Distribution LLC (UFPI) is recalling certain WIC RV REG, Model 6020 Change Over Regulators, with part numbers 2004188 and 2004202. These regulators may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. UFPI will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

provide a pre-paid shipping label to return the regulator, and issue a full refund. Owner notification letters were mailed September 28, 2021. Owners may contact UFPI customer service at 1-574-266-3603.

21E-086

TIRES:

None during September 2021.

VEHICLES:

Porsche Cars North America, Inc. (Porsche) is recalling certain 2013-2015 Boxster, 2013-2014 Boxster S, 2014-2015 Cayman, Cayman S, 2015 Boxster GTS, and Cayman GTS vehicles. The rear-axle carrier side sections may fracture. A carrier fracture may cause a loss of control, increasing the risk of a crash. Dealers will replace the rear-axle carrier side sections, free of charge. Owner letters were mailed January 6, 2022. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AMB7.

21V-679

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain 2018-2022 Allegro Breeze, Allegro Red, Allegro, Allegro Bus, Phaeton, and 2018-2021 Zephyr recreational vehicles. The sofa seat belts may not have been installed correctly, which could result in unsecured passengers. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 210, "Seat Belt Assembly Anchorages." Unsecured passengers have an increased risk of injury in the event of a crash. Dealers will inspect and repair the seat belts as necessary, free of charge. Owner notification letters were mailed October 29, 2021. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIF-118.

21V-680

Indian Motorcycle Company (Indian) is recalling certain 2020 Scout Bobber Sixty motorcycles. An engine control unit (ECU) update may have caused the brake lights to become inoperable. Inoperable brake lights can increase the risk of a crash. Owners will be asked to inspect their brake lights, and advised to not ride their motorcycle if the brake lights are inoperable. If the brake lights are not functioning, dealers will re-flash the ECU, free of charge. Owner notification letters were mailed September 27, 2021. Owners may contact Indian customer service at 1-877-204-3697. Indian's number for this recall is I-21-03.

21V-681

Volvo Car USA, LLC (Volvo Car) is recalling certain 2021 XC40, XC 40 Recharge, V60CC, V90, V90CC, XC90, and 2021-2022 V60, XC60, S60 vehicles. The seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." An

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect and replace the seat belt assemblies, as necessary, free of charge. Owner notification letters were mailed October 13, 2021. Owners may contact Volvo Car customer service at 1-800-458-1552. Volvo Car's number for this recall is R10111.

21V-682

Polestar Automotive USA, Inc. (Polestar) is recalling certain 2021 Polestar PS1 vehicles. The seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect and replace the seat belt assemblies, as necessary, free of charge. Owner notification letters were mailed October 22, 2021. Owners may contact Polestar customer service at 1-800-806-2504. Polestar's number for this recall is R10112.

21V-683

Mack Trucks, Inc. (Mack) is recalling certain 2020-2022 Mack MD vehicles. The cotter pin that retains the brake pedal clevis pin may not have been properly installed, which could result in an unsecured brake pedal. An unsecured brake pedal can cause a loss of braking ability and increase the risk of a crash. Dealers will inspect the cotter pin installation and repair it as necessary, free of charge. Owner notification letters were mailed on September 13, 2021. Owners are advised to not drive their vehicles until the remedy has been performed. Owners may contact Mack's customer service at 1-800-866-1177. Mack's number for this recall is SC0429.

21V-684

Jayco, Inc. (Jayco) is recalling certain 2018-2021 Jayco Eagle, Talon, 2020 Eagle HT, 2021 Jay Feather, Jay Flight Bungalow, Jay Flight Octane, North Point, Octane Super Lite, Pinnacle, White Hawk, 2021-2022 Jay Flights SLX, Jay Flight, and 2017-2021 Seismic recreational vehicles, equipped with Winntec model 6020 two-stage propane regulators. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator, and test the propane system for leaks, free of charge. Owner notification letters were mailed November 1, 2021. Owners may contact Jayco customer service at 1-800-283-8267.

21V-685

Highland Ridge RV (Highland Ridge) is recalling certain 2021 Mesa Ridge Limited, Mesa Ridge Lite, Open Range Light, Open Range Ultra Lite, Silverstar Limited, Silverstar Lite, 2021-2022 Olympia, and Open Range recreational vehicles, equipped with Winntec model 6020 two-stage propane regulators. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator and test the propane system for leaks, free of charge. Owner notification letters were mailed November 1, 2021. Owners may contact Highland Ridge customer service at 1-260-768-7771.

21V-686

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

Starcraft RV (Starcraft) is recalling certain 2021-2022 Starcraft Autumn Ridge Outfitter, 2021 Super Lite, and Telluride recreational vehicles, equipped with Winntec model 6020 two-stage propane regulators. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator and test the propane system for leaks, free of charge. Owner notification letters were mailed November 1, 2021. Owners may contact Starcraft customer service at 1-800-823-8267.

21V-687

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2018-2021 Tundra vehicles. The headlight electrical circuits may power the high and low beams simultaneously, which could overheat the electrical connector. An overheated electrical connector can increase the risk of a fire. Dealers will modify the engine wire harness assembly and replace any damaged bulb, bulb connector, and/or headlight assembly as necessary, free of charge. Interim owner notification letters informing owners of the safety risk were mailed October 20, 2021. Owners will receive a second notice when the remedy becomes available. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's numbers for this recall are 21TB06 and 21TA06.

21V-688

Daimler Trucks North America, LLC (DTNA) is recalling certain 2019 Freightliner Classic Cascadia and 2019-2021 Freightliner Cascadia trucks. The drag link taper joint may not have been tightened sufficiently and could come loose, resulting in a complete separation of the drag link from the steering arm. Drag link separation can cause a complete loss of steering control, increasing the risk of a crash. DTNA will inspect the drag link taper joint and repair it as necessary, free of charge. Owner notification letters were mailed on October 29, 2021. Owners may contact DTNA's customer service at 1-800-547-0712. DTNA's number for this recall is FL-900.

21V-689

Honda (American Honda Motor Co.) is recalling certain 2019-2020 CB500X and CBR500R ABS motorcycles. Excessive grease in the ABS modulator may collect debris, which can get stuck in the check valve and cause a brake fluid leak. A brake fluid leak can reduce braking performance and increase the risk of a crash. Dealers will inspect the lot number on the ABS modulator, and replace the modulator as necessary, free of charge. Owner notification letters were mailed November 12, 2021. Owners may contact Honda Powersports customer service at 1-866-784-1870. Honda's number for this recall is KM6.

21V-690

Forest River, Inc. (Forest River) is recalling certain 2021 Berkshire recreational vehicles. These vehicles may have been manufactured with unsealed 5-AMP and 20-AMP mini-breakers, which could cause a spark in the battery compartment. A spark inside the battery compartment can increase the risk of a fire. Dealers will install sealed mini-breakers, free of charge. Owner notification letters were mailed September 16, 2021. Owners may contact Forest River customer service at 1-574-522-1368. Forest River's number for this recall is 40-1414.

21V-691

Forest River, Inc. (Forest River) is recalling certain 2021-2022 Coachmen Nova motorhomes. The Absorbed Glass Mat (AGM) battery was incorrectly installed inside the vehicle, which can allow hydrogen gas to enter the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

vehicle. Hydrogen gas inside the vehicle can increase the risk of injury. Dealers will install a lithium battery, free of charge. Owner notification letters were mailed November 1, 2021. Owners may contact Forest River customer service at 1-574-825-6319 or 1-574-825-6625. Forest River's number for this recall is 225-1416.

21V-692

LDJ Manufacturing, Inc. (LDJ) is recalling certain 2021 Thunder Creek Fuel & Service Trailers (FST), Multi-Tank Trailers (MTT), Multi-Tank Oil Trailers (MTO), Service & Lube Trailers (SLT), Double Wall Trailers (DW), Split-Tank Trailers (STT), and DEF Tank Trailers (DEF). The wiring for the fender clearance lights may have been improperly routed, which could cause the lamps to fail. Inoperable fender clearance lights can reduce visibility and increase the risk of a crash. Dealers will inspect and reroute the harness as necessary, and repair any damaged wires, free of charge. Owner notification letters were mailed on September 14, 2021. Owners may contact LDJ's customer service at 1-641-620-4034.

21V-693

Eldorado National-California, Inc. (Eldorado National-California) is recalling certain 2019-2021 Eldorado National EZRM vehicles equipped with L9 Diesel Engines with a remote Stage 2 fuel filter and pressurized hoses. A fuel leak may occur from the fuel hose between the fuel pump and the remote fuel filter head. A fuel leak in the presence of an ignition source increases the risk of a fire. Cummins will replace the fuel hoses, free of charge. Owner notification letters were mailed on September 20, 2021. Owners may contact Eldorado National-California's customer service at 1-951-684-6868.

21V-694

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021 Arteon vehicles. The pressure input rod connection on the brake booster may be loose and could detach. A detached pressure input rod will cause the brake pedal to fail, increasing the risk of a crash. Dealers will tighten the pressure input rod connection, free of charge. Owner notification letters were mailed September 28, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 47R3.

21V-695

Blue Bird Body Company (Blue Bird) is recalling certain 2022 Vision school buses equipped with cross-view mirrors and a Mobileye collision mitigation system. Due to the current placement of the Mobileye camera, the camera could partially or fully obstruct the driver's view of the passenger side cross-view mirror. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility." An obstructed view of the passenger side cross-view mirror increases the risk of injury for pedestrians. Dealers will change the location of the camera and update the software, free of charge. Owners were notified of the defect on November 2, 2021. A second notification letter will be mailed once the final remedy is available. Owners may contact Blue Bird's customer service at 1-478-822-2242. Blue Bird's number for this recall is R21BL-SB.

21V-696

Porsche Cars North America, Inc. (Porsche) is recalling certain 2020-2021 911 Carrera and Taycan vehicles. The pressure input rod connection on the brake booster may be loose and could detach. A detached pressure

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

input rod will cause the brake pedal to fail, increasing the risk of a crash. Dealers will repair or replace the brake booster as necessary, free of charge. Owner notification letters were mailed October 28, 2021. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AMB9.

21V-697

Chrysler (FCA US, LLC) is recalling certain 2021 Ram 1500 vehicles. The incorrect-size spare tire may have been installed, which does not match the tire size and inflation pressure information on the tire placard. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 110, "Tire Selection And Rims." A driver that relies on the incorrect spare tire inflation pressure on the tire placard label may inflate the spare tire incorrectly, increasing the risk of a crash. Dealers will replace the spare tire assembly, free of charge. The owner notification letter was mailed on September 9, 2021. Owners may contact FCA US LLC customer service at 1-800-853-1403. FCA US LLC's number for this recall is Y62.

21V-698

Chrysler (FCA US, LLC) is recalling certain 2021 Ram ProMaster City and Ram ProMaster vehicles. The seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect and replace the seat belt retractors as necessary, free of charge. Owner notification letters were mailed October 28, 2021. Owners may contact FCA US LLC customer service at 1-800-853-1403. FCA US LLC's number for this recall is Y61.

21V-699

Newmar Corporation (Newmar) is recalling certain 2019-2021 London Aire, Dutch Star, Essex, King Aire, Mountain Aire, 2020-2021 Ventana, and 2021 New Aire recreational vehicles. The instrument cluster may intermittently go blank while the vehicle is in motion. A blank instrument cluster display may be missing critical information such as the vehicle's speed and warning lights, which can increase the risk of a crash. Dealers will update the control module software, and reroute and secure the ductwork, free of charge. Owner notification letters were mailed on November 8, 2021. Owners may contact Newmar's customer service at 1-800-731-8300.

21V-700

Forest River, Inc. (Forest River) is recalling certain 2021-2022 Coachmen Sportscoach motorhomes. The outdoor cooktop can be stowed with the propane hose connected. A stowed cooktop with the propane still connected can increase the risk of a fire. Dealers will move the quick disconnect and install a new shorter LP supply hose, free of charge. Owner notification letters were mailed September 21, 2021. Owners may contact Forest River customer service at 1-574-825-8212. Forest River's number for this recall is 310-1418.

21V-701

General Motors, LLC. (GM) is recalling certain 2022 GMC Acadia vehicles. The sensing diagnostic module (SDM) may have been left in "manufacturing mode" and not activated at the assembly plant prior to shipment. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

208, "Occupant Crash Protection." The air bags will not deploy with an unactivated SDM, increasing the risk of injury in a crash. The vehicles will be returned to the assembly plant for SDM activation. Both affected vehicles are still in dealer inventory and therefore no owner notification letters will be mailed. Owners may contact GMC 1-800-462-8782. GM's number for this recall is N212344261.

21V-702

Maserati North America, Inc. (Maserati) is recalling certain 2021 Levante, Quattroporte, and Ghibli vehicles. The seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect and replace the seat belt assemblies, as necessary, free of charge. Owner letters were mailed October 15, 2021. Owners may contact Maserati customer service at 1-877-696-2737. Maserati's number for this recall is 434.

21V-703

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2021 S580 vehicles. The suction jet pump in the fuel tank may have a loose or missing nozzle, which can cause the pump to fail and result in an engine stall. An engine stall increases the risk of a crash. Dealers will inspect and replace as necessary, the fuel tank including the suction jet pump, free of charge. Owner letters were mailed October 26, 2021. Owners may contact MBUSA customer service at 1-800-367-6372.

21V-704

Gillig, LLC (Gillig) is recalling certain 2020-2021 Low Floor Battery Electric vehicles equipped with Cummins Electric Drivetrain Systems. When a system shutdown occurs, the high voltage shutdown override switch may not function, with no warning to the driver. An unexpected vehicle shutdown without the ability to override it can increase the risk of a crash. Dealers will inspect and update as necessary, the parameter settings for the protection override switch, free of charge. Owner letters were mailed November 12, 2021. Owners may contact Gillig's customer service at 1-800-735-1500 or 1-510-264-5073.

21V-705

Nissan North America, Inc. (Nissan) is recalling certain 2022 Pathfinder vehicles. Insufficient welds may allow the secondary hood latch retainer bracket to detach from the front bumper assembly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 113, "Hood Latch System." A detached secondary hood latch may allow the hood to open if the primary hood latch is not engaged, obstructing the driver's view and increasing the risk of a crash. Dealers will inspect and replace the secondary hood latch bracket as necessary, free of charge. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's number for this recall is PC840.

21V-706

Volkswagen Group of America, Inc. (Audi) is recalling certain 2021 Audi E-Tron Quattro and E-Tron Sportback Quattro vehicles. Corrosion in the brake booster may cause the Anti-Lock Brake System (ABS),

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

Electronic Stability Control (ESC), speedometer display, and brake assist to stop functioning. A loss of braking assist, ABS, and ESC will increase the effort and distance required to stop, increasing the risk of a crash. Dealers will replace the brake booster, free of charge. Owner notification letters were mailed September 30, 2021. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 47R7.

21V-707

Keystone RV Company (Keystone) is recalling certain 2019-2021 Dutchmen Aspen Trail, Coleman, Keystone Cougar, Bullet, Passport, Hideout, Springdale, Sprinter, 2019 Keystone Impact, Fuzion, Residence, Retreat, Summerland, and Dutchmen Kodiak recreational vehicles, equipped with Winntec model 6020 two-stage propane regulators. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator and test the propane system for leaks, free of charge. Owners were notified of the defect on November 8, 2021. A second notice will be sent once the final remedy becomes available. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 21-414.

21V-708

Altec Industries, Inc. (Altec) is recalling certain 2021 AM50, 55, and 60E aerial devices. The cylinder rod threads may not have been machined properly, which could result in uncontrollable boom movement. Uncontrollable boom movement increases the risk of injury. Altec will replace the cylinder, free of charge. Owner notification letters were mailed on September 30, 2021. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is MAB 834.

21V-709

Kaufman Trailers of NC, Inc. (Kaufman Trailers) is recalling certain 2021 Equipment trailers. These trailers have an incorrect internal locking mechanism, and when coupled with a 2-5/16" ball hitch may result in excessive play and trailer detachment. A trailer that detaches from a vehicle increases the risk of a crash. The customer will inspect their Kaufman Trailer and a replacement will be mailed, as necessary, free of charge. Owner notification letters were mailed October 23, 2021. Owners may contact Kaufman Trailer's customer service at 1-336-790-6800.

21V-710

Ford Motor Company (Ford) is recalling certain 2021 Mustang Mach-E vehicles. The windshield may not have been properly bonded to the vehicle, which could allow it to detach. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 212, "Windshield Mounting." A windshield that separates from a vehicle during a crash can increase the risk of injury. Dealers will remove and reinstall the windshield, free of charge. Owner notification letters were mailed on October 29, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21C22.

21V-711

Ford Motor Company (Ford) is recalling certain 2021 Mustang Mach-E vehicles. The vehicle's panoramic roof glass panel may not have been properly bonded to the vehicle, which could allow it to detach. A roof panel that separates from a vehicle can become a road hazard, increasing the risk of a crash or injury. Dealers will apply

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

additional urethane adhesive, free of charge. Owner notification letters were mailed October 29, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21S42.

21V-712

Trail King Industries, Inc. (Trail King) is recalling certain 2019 TK80ACS and TK80AACS trailers. The rear sliding axle suspension beams may contact a frame reinforcement, causing cracking in the suspension beam. A cracked suspension beam may come loose or detach from the frame bracket, increasing the risk of a crash. Dealers will replace any suspension beams that show indications of cracking, and will also replace all of the frame reinforcements, free of charge. Owner notification letters were mailed on October 6, 2021. Owners may contact Trail King's customer service at 1-800-843-3324. Trail King's number for this recall is TK202104.

21V-713

Daimler Trucks North America, LLC (DTNA) is recalling certain 2022 Thomas Built Buses Saf-T-Liner HDX school buses. The fan drive pulley assembly bolts may be incorrect or improperly installed. Incorrect or improperly installed bolts may lead to a loose fan belt, resulting in a disabled bus. A disabled school bus may require an evacuation procedure in an uncontrolled traffic situation, increasing the risk of injury. DTNA will inspect and repair the fan drive pulley assembly mounting bolts as necessary, free of charge. Owner notification letters were mailed on November 12, 2021. Owners may contact DTNA's customer service at 1-800-547-0712. DTNA's number for this recall is FL-902.

21V-714

Daimler Trucks North America, LLC (DTNA) is recalling certain 2022 Freightliner Cascadia vehicles. The exhaust pipe outlet may have been improperly installed with the tip facing towards the battery box mounted directly above the frame rail. The exhaust heat may melt the battery box, increasing the risk of a fire. Dealers will inspect and rotate exhaust pipe tip as required. Owner notification letters were mailed on November 14, 2021. Owners may contact DTNA's customer service at 1-800-547-0712. DTNA's number for this recall is FL-901.

21V-715

Volvo Car USA, LLC (Volvo Car) is recalling certain 2021 S90L, 2020-2021 XC60, and XC90 vehicles. An improperly welded rotor and shaft may separate within the integrated brake system. Separation of the rotor and shaft may cause a reduction in braking assistance and a loss of the Antilock Brake System (ABS) and Electronic Stability Control (ESC), increasing the risk of a crash. Dealers will replace the hydraulic unit, free of charge. Owner notification letters were mailed October 22, 2021. Owners may contact Volvo Car customer service at 1-800-458-1552. Volvo Car's number for this recall is R10120.

21V-716

Volvo Bus Corporation (Volvo Bus) is recalling certain 2008-2021 9700 vehicles. The headlights may not have the correct amount of light output, and either be too bright, or too dim. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment." Excessively bright or dim headlights may reduce visibility, increasing the risk of a crash. No remedy has been established at this time. Owner notification letters were mailed on November 11, 2021.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

Owners may contact Volvo Bus' customer service at 1-866-870-2046.

21V-717

Fox Factory, Inc. (Fox Factory) is recalling certain 2019-2021 GMC Sierra 1500 and Chevrolet Silverado 1500 vehicles that are equipped with Tuscany Kits, model number 501T-02-00064. Excessive wear to the front-upper control arm ball joints could result in ball joint failure and wheel separation. Separation of a front wheel while the vehicle is in motion increases the risk of a crash. Dealers will replace the original equipment front-upper control arms with new upgraded front-upper control arms, free of charge. Owner notification letters were mailed November 8, 2021. Owners may contact Fox Factory at 1-831-274-6500.

21V-718

PACCAR Incorporated (PACCAR) is recalling certain 2022 Peterbilt 567 and 579 vehicles. The Electronic Stability Control (ESC) malfunction indicator lamp may not illuminate. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 136, "Electronic Stability Control Systems on Heavy Vehicles." Unknowingly operating a vehicle without the ESC system functioning, can increase the risk of a crash. Dealers will reprogram the ESC, free of charge. Owner notification letters were mailed on November 15, 2021. Owners may contact PACCAR's customer service at 1-940-591-4220 (Peterbilt). PACCAR's number for this recall is 21PBL.

21V-719

PACCAR Incorporated (PACCAR) is recalling certain 2020-2021 Peterbilt 520 vehicles. The quick release valve on the rear brake signal hose may be missing. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 121, "Air Brake Systems." A missing quick release valve cannot ensure correct rear brake release timing, increasing the risk of a crash or injury. Dealers will inspect the vehicles for a missing quick release valve, and install one if necessary, free of charge. Owner notification letters were mailed on October 7, 2021. Owners may contact PACCAR's customer service at 1-940-591-4220 (Peterbilt). PACCAR's number for this recall is 21PBK.

21V-720

Vermeer Manufacturing Company (Vermeer) is recalling certain 2005-2021 McLaughlin and 2021 Vermeer vacuum excavators. Please see the 573 report for all affected models. The rear clearance lamps and reflex reflectors, and the rear-side clearance lamps and reflex reflectors are not sufficient. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment." Without the proper reflective equipment, the vacuum excavators may not be visible to other drivers, increasing the risk of a crash. Dealers will install a field remedy kit, free of charge. Owner notification letters were mailed on November 11, 2021. Owners may contact Vermeer's customer service at 1-800-829-0051 ext. 7060. Vermeer's number for this recall is VMV0013.

21V-721

Altec Industries, Inc. (Altec) is recalling certain 2016-2021 LS87 aerial devices. The outer-race rotation bearing bolt washers may interfere with an adjacent pedestal weld, which could cause the rotation bearing bolts to break. Broken bolts can cause the pedestal to separate from the turntable, increasing the risk of injury. Altec will inspect

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

the outer rotation bolt washers and repair the pedestal as necessary, free of charge. Owner notification letters were mailed on November 15, 2021. Owners may contact Altec's customer service at 1-877-462-5832. Altec's number for this recall is CSN 833.

21V-722

Forest River, Inc. (Forest River) is recalling certain 2022 Forest River Aurora travel trailers. These trailers were manufactured with the incorrect tires, size ST225/75R15 LRD, instead of tire size ST225/75R15 LRE, as identified on the Federal Placard. The incorrectly-sized tires can become overloaded, increasing the risk of a crash. Dealers will replace the tire and wheel assemblies, free of charge. Owner notification letters were mailed September 24, 2021. Owners may contact Forest River customer service 1-574-825-6327. Forest River's number for this recall is 205-1420.

21V-723

Forest River, Inc. (Forest River) is recalling certain 2022 East to West Alta Travel Trailers. The LP gas quick disconnect fitting may not have been properly tightened, which could allow gas to leak. A gas leak in the presence of an ignition source can increase the risk of a fire. Dealers will inspect and tighten the fitting as necessary, and run a propane system check, free of charge. Owner notification letters were mailed October 8, 2021. Owners may contact Forest River customer service at 1-574-264-6664. Forest River's number for this recall is 501-1419.

21V-724

Kia Motors America (Kia) is recalling certain 2015-2017 Sedona vehicles. The Smart Junction Box (SJB) software logic may not properly interpret the signals received from the multifunction switch, which could cause the turn signal to activate in the opposite direction of what the driver intended. A turn signal activating in the opposite direction of what was intended by the driver increases the risk of a crash. Dealers will update the SJB software, free of charge. Owner notification letters were mailed November 12, 2021. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC217.

21V-725

DRV Suites (DRV) is recalling certain 2021 Mobile Suites fifth wheel trailers. The brake rotor bolts were improperly tightened, which can cause the bolts to become loose or fall off. Loose or detached bolts can cause wheel separation, a tire blowout, or brake failure, increasing the risk of a crash. Dealers will inspect and tighten the bolts, if necessary, free of charge. Owner notification letters were mailed October 28, 2021. Owners may contact DRV customer service at 1-260-562-3500.

21V-726

Hyundai Motor America (Hyundai) is recalling certain 2017 Tucson and Sonata Hybrid vehicles. The connecting rod bearings inside the engine may wear prematurely, which can result in engine damage. A damaged engine can increase the risk of a fire or it can cause an engine stall, increasing the risk of a crash. Dealers will inspect the engine. If bearing damage is found, the engine will be replaced. Dealers will also install a software update containing a new Knock Sensor Detection System (KSDS). Repairs will be performed free of charge. Owner were notified of the defect on November 16, 2021. A second letter will be sent once the the remedy is available. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 209.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

21V-727

Chrysler (FCA US, LLC) is recalling certain 2019-2021 Ram ProMaster City vehicles. If one or both turn signal lights fail, the flashing rate may not change to warn the driver of the failure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment." The driver may be unaware that the turn signals are not signaling their intentions to other drivers, which can increase the risk of a crash. Dealers will update the Body Controller Module (BCM) software, free of charge. Owner notification letters were mailed October 28, 2021. Owners may contact FCA US LLC customer service at 1-800-853-1403. FCA US LLC's number for this recall is Y71.

21V-728

Chrysler (FCA US, LLC) is recalling certain 2021 Jeep Grand Cherokee L vehicles. A radio software error may prevent the rearview image from displaying. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility." A rearview camera that does not display an image reduces the driver's rear view, increasing the risk of a crash. FCA US LLC will update the radio software, free of charge. Owner notification letters were mailed on October 4, 2021. Owners may contact FCA US LLC customer service at 1-800-853-1403. FCA US LLC's number for this recall is Y67.

21V-729

Workhorse Group Inc. (Workhorse) is recalling certain 2020-2021 C1000M, C1000S and 2020 C650 vehicles. These vehicles fail to comply with multiple Federal Motor Vehicle Safety Standards, including numbers 101, "Control and Displays," 104, "Windshield Wiping and Washing Systems," 108, "Lamps, Reflective Devices, and Associated Equipment," and 120, "Wheels and Rims - Other Than Passenger Cars." Vehicles that do not meet all safety standards have an increased risk of injury, crash, or fire. No remedy has been established at this time. Owners may contact Workhorse's customer service at 1-513-360-4704.

21V-731

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Tiguan vehicles. During the repair of roof damage, an incorrect roof reinforcement assembly may have been installed. The incorrect roof reinforcement may decrease the roof's structural integrity or impact deployment of the side curtain air bags, increasing the risk of injury in the event of a crash. Dealers will be replace the roof reinforcement, free of charge. Owner notification letters were mailed November 19, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 51H5.

21V-732

DRV Suites (DRV) is recalling certain 2018-2021 Elite Suites and Mobile Suites fifth wheel trailers. The brake caliper retaining clips may bend or warp while braking, causing the caliper to become unseated. An unseated brake caliper can cause a loss of braking ability, increasing the risk of a crash. Dealers will replace the caliper retaining clips, free of charge. Owner notification letters were mailed November 11, 2021. Owners may contact

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

DRV customer service at 1-260-562-3500.

21V-733

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2022 Prius and Prius Prime vehicles. The Engine Control Unit (ECU) software may falsely detect an error and shut down the hybrid system, causing a loss of drive power. A loss of drive power increases the risk of a crash. Dealers will update the ECU software, free of charge. Owner notification letters were mailed November 18, 2021. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is 21TB07/21TA07.

21V-734

Ford Motor Company (Ford) is recalling certain 2020-2021 Explorer, Lincoln Corsair, and Lincoln Aviator vehicles equipped with 360-degree cameras. The video output may fail, preventing the rearview camera image from displaying. A rearview camera that does not display an image reduces the driver's rear view, increasing the risk of a crash. Dealers will update the Image Processing Module (IPMB) software, free of charge. Owner notification letters were mailed November 16, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21S44.

21V-735

Altec Industries, Inc. (Altec) is recalling certain 2011-2016 AT200A aerial devices. Cracks may develop in the legs of the mounting frame, which can cause the mounting frame side plate to break. A broken side plate may result in pedestal and truck frame separation, increasing the risk of injury. Altec will repair the side plates as necessary, or provide a repair kit, free of charge. Owner notification letters were mailed on October 13, 2021. Owners may contact Altec's customer service at 1-877-462-5832. Altec's number for this recall is CSN 836.

21V-736

Motor Coach Industries (MCI) is recalling certain 2005-2009 E4500 and 2005-2012 J4500 motorcoaches equipped with Ricon Baylift Wheelchair Lifts. When the lift's outer barrier is fully deployed, it may not withstand a sufficient amount of force, which could cause it to fail. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems," and number 404, "Platform lift installations." In the event that a mobility device pushes into the outer barrier, the barrier may fail, increasing the risk of injury for the lift occupant. Ricon will reinforce the outer barrier with additional supports, free of charge. Owner notification letters were mailed on October 18, 2021. Owners may contact the Ricon's Customer Service at (800) 322-2884, or email Ricon's Recall Coordinator, at admin21e068@Wabtec.com or by locating the nearest Ricon servicing dealer using the locator on the Ricon website, www.riconcorp.com. Owners may also contact MCI's customer service at 1-800-241-2947. MCI's number for this recall is R21-024.

21V-737

Ducati North America (Ducati) is recalling certain 2019 Hypermotard 950 SP motorcycles. The side stand may be improperly welded, potentially causing the stand to break. A broken side stand could result in the motorcycle falling down, increasing the risk of injury. Dealers will install a new side stand, free of charge. Owner notification

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

letters were mailed October 22, 2021. Owners may contact Ducati customer service at 1-888-391-5446. Ducati's number for this recall is SRV-RCL-21-011.

21V-738

General Motors, LLC (GM) is recalling certain 2021 Cadillac Escalade, Escalade ESV, Chevrolet Suburban, Tahoe, GMC Yukon, and Yukon XL vehicles. The fuel pump power control module may cause the fuel pump to fail or operate intermittently, which can interrupt fuel flow to the engine, and cause an unexpected engine stall. An engine stall increases the risk of a crash. Dealers will replace the fuel pump power control module, free of charge. Owner notification letters were mailed October 14, 2021. Owners may contact Chevrolet customer service at 1-800-222-1020; Cadillac customer service at 1-800-458-8006; or GMC customer service at 1-800-462-8782. GM's number for this recall is N212332040.

21V-739

Braun Ambulances is recalling certain 2020 Demers Ambulances MXP153 Ford F-Series Gas, MXP153 Dodge Ram, and 2020-2021 MXP153 Ford F-Series Diesel emergency vehicles. The medical oxygen tube and electrical wires may become damaged due to insufficient clearance from the ceiling spacers. Damage to the wires and medical oxygen tube increases the risk of a fire. Dealers will remove the ceiling panels and spacers, replace wires and oxygen network tubing, and create a routing channel inside the insulation board for all wires, free of charge. Owner letters were mailed on October 6, 2021. Owners may contact Braun Ambulances' customer service at 1-877-344-9990.

21V-740

Daimler Trucks North America, LLC. (DTNA) is recalling certain 2015-2018 Thomas Built Minotour school buses. The under-body shut-off solenoid connector that connects to the CNG fuel tank may corrode, which could result in an electrical short. A short at the connector may cause a flame or overheating, increasing the risk of a fire. Dealers will replace the CNG fuel shut-off solenoid, free of charge. Owners were notified of the defect on November 9, 2021. A second letter will be sent once the remedy is finalized. Owners may contact DTNA's customer service at 1-800-547-0712. DTNA's number for this recall is FL-903.

21V-741

Nissan North America, Inc. (Nissan) is recalling certain 2022 Pathfinder vehicles. The third-row headrests may have an improper weld or misaligned internal components, which can allow the headrest to move or detach. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 202, "Head Restraints." Headrests that move or detach may not adequately restrain occupants in a crash, increasing the risk of injury. Dealers will replace all three third-row seat headrests, free of charge. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's number for this recall is PC844.

21V-742

Nissan North America, Inc. (Nissan) is recalling certain 2022 Pathfinder vehicles. The second-row seat back frames may have insufficient welds that could separate. Seat backs with separated welds may fail to adequately restrain occupants during a crash, increasing the risk of injury. Dealers will inspect and replaced the seat

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

assemblies as necessary, free of charge. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's numbers for this recall are PC845, PC846, and PC847.

21V-743

Mazda North American Operations (Mazda) is recalling certain 2009-2011 RX-8 and 2006-2007 MazdaSpeed6 vehicles. Fuel may leak from the fuel pump mounting rings. A fuel leak in the presence of an ignition source increases the risk of a fire. Dealers will install new fuel pump mounting rings. Dealers will also add a thermal insulation pad to the fuel tank on RX-8 vehicles. Repairs will be performed free of charge. Owner notification letters were mailed November 17, 2021. Owners may contact Mazda customer service at 1-800-222-5500, Option 4. Mazda's number for this recall is 5121I.

21V-744

Forest River, Inc. (Forest River) is recalling certain 2021-2022 Salem and Wildwood fifth wheel trailers. The Federal Placard lists a Gross Vehicle Weight Rating (GVWR) that exceeds the load carrying capacity of the pin box, which could result in an overloaded pin box. An overloaded pin box can fail, increasing the risk of a crash. Forest River will mail owners a new Federal Placard, free of charge. Owner notification letters were mailed October 8, 2021. Owners may contact Forest River Customer Service at 1-574-534-3167. Forest River's number for this recall is 69-1423.

21V-745

Ford Motor Company (Ford) is recalling certain 2011-2013 Explorer vehicles originally sold, or currently registered in Connecticut, Delaware, the District of Columbia, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, and Wisconsin. These vehicles may be equipped with a cross-axis ball joint (CABJ) replacement part that could seize, and result in a fracture of the outboard section of the rear suspension toe link. A rear toe link fracture can result in a loss of steering control, increasing the risk of a crash. Dealer will inspect for the presence of a CABJ. If a CABJ of any design is found, the dealer will inspect the tightness of the CABJ, and replace the CABJ, knuckle, and/or toe link as necessary, free of charge. Interim notification letters were mailed November 10, 2021. A second notice will be sent once the remedy is finalized. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21S43.

21V-746

Carson Trailer, Inc. (Carson) is recalling certain 2021 Carson Carrier trailers. The spindle nuts on the axles may have been improperly tightened during assembly. Improperly tightened spindle nuts may cause excessive axle vibration and overheat the bearings, affecting vehicle control, and increasing the risk of a crash. Dealers will properly tighten the spindle nuts, free of charge. Owner notification letters were mailed November 12, 2021. Owners may contact Carson's customer service at 310-516-6046. Carson's number for this recall is Recall3.

21V-747

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

Motor Coach Industries (MCI) is recalling certain 2018 D4000, 2018-2020 D4005, D4000ISTV, 2017-2020 D4500, D4505, 2018-2021 J3500, 2017-2021 J4500, 2020 D4520, and 2018-2021 D45CRTLE motorcoaches. The Main Distribution Panel (MDP) located within the battery compartment contains a circuit board that may fail. MDP circuit board failure can result in a fire or an unexpected vehicle shutdown, increasing the risk of a crash. MCI Service Centers will remove the MDP and install a new main disconnect and circuit breaker panel, free of charge. Owner notification letters were mailed November 12, 2021. Owners may contact MCI's customer service at 1-800-241-2947. MCI's number for this recall is R21-010.

21V-748

Hyundai Motor America (Hyundai) is recalling certain 2015-2017 Sonata, 2016-2017 Sonata Hybrid, and Sonata Plug-In Hybrid vehicles. The Smart Junction Box (SJB) software logic may not properly interpret the signals received from the multifunction switch, which could cause the turn signal to activate in the opposite direction of what the driver intended. A turn signal that activates in the opposite direction of what was intended by the driver increases the risk of a crash. Dealers will update the SJB software, free of charge. Owner notification letters were mailed November 19, 2021. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 210.

21V-749

Mazda North American Operations (Mazda) is recalling certain 2020-2021 CX-9 vehicles equipped with 60/40 split bench second-row seats. The left-side second-row seat may unexpectedly slide forward during a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 210, "Seat Belt Assembly Anchorages." A seat that slides forward during a crash can transfer excessive force onto a belted occupant, increasing their risk of injury. Dealers will replace the internal parts of the affected second-row seats, free of charge. Owner notification letters were mailed November 4, 2021. Owners may contact Mazda customer service at 1-800-222-5500, Option 4. Mazda's number for this recall is 5221I.

21V-750

Shyft Group is recalling certain 2020-2022 Spartan RV Chassis K3 and K4 recreational vehicles. A machining defect may cause pressure to build in the power steering pump and break the shaft seal, resulting in a loss of power steering assist. A loss of power steering assist increases the risk of a crash. Shyft Group will inspect the pump serial number, and replace the power steering pump if necessary, free of charge. Owners may contact Shyft Group's customer service at 1-800-582-3454. Shyft Group's number for this recall is 21-21.

21V-752

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain 2018-2022 Wayfarer vehicles. The rear-center holding tank water pan bolts may pull through the lip of the pan, allowing the tank to drop down onto the exhaust pipe. The tank falling onto the exhaust can affect vehicle stability, and increase the risk of a crash. Dealers will inspect and as necessary, replace any damaged holding pans. In addition, metal straps and a washer plate will be installed. Repairs will be performed free of charge. Owner notification letters were mailed November 29, 2021. Owners may contact Tiffin customer services at 1-256-356-8661. Tiffin's number for this recall is WAY-102.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

21V-753

Thor Motor Coach (TMC) is recalling 2021-2022 Magnitude and Omni motorhomes. The LP gas line may have been incorrectly routed through the rear suspension leaf springs, which could damage the line and cause a gas leak. A gas leak increases the risk of a fire. Dealers will re-route the LP line as necessary, free of charge. Owner notification letters were mailed November 23, 2021. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000242.

21V-754

Thor Motor Coach (TMC) is recalling certain 2022 Scope and Rize motorhomes. The LP gas line may be too short and improperly installed, creating an excessive bend in the line which could rupture and leak. A gas leak increases the risk of a fire. Dealers will replace the LP gas line and reroute it as necessary, free of charge. Owner notification letters were mailed November 23, 2021. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000243.

21V-755

Thor Motor Coach (TMC) is recalling certain 2021-2022 Venetian motorhomes. The patio awning may have been improperly installed, allowing it to separate. An awning that separates while the vehicle is in motion can increase the risk of a crash. Dealers will secure the awning, free of charge. Owner notification letters were mailed November 24, 2021. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000244.

21V-756

Rosenbauer America (Rosenbauer) is recalling certain 2022 Commercial HV 507, 2020-2021 Commander, and 2021 Panther ARFF vehicles equipped with Cummins generator sets. The lifting cables may be improperly crimped. An improperly crimped cable may come out of place during a lifting operation, possibly causing the generator set to fall, increasing the risk of injury. Cummins will inspect the lifting cable, and either replace the cable or install a warning label, free of charge. Owners may contact Rosenbauer's customer service at 1-651-462-1000 or Cummins' customer service at 1-800-286-6467.

21V-757

General Motors, LLC (GM) is recalling certain 2021-2022 Chevrolet Silverado 2500, Silverado 3500, GMC Sierra 2500, and Sierra 3500 vehicles with electronic brake control modules (EBCM) replaced during vehicle assembly. The bolts that attach the brake pressure modulator valve (BPMV) assembly may not be properly tightened, which could fail to seal the two sub-assemblies and allow water intrusion. Water in the BPMV may cause an electrical short circuit and increase the risk of fire. Owners are advised to park outside and away from other structures until the recall repair is completed. Dealers will replace the BPMV assembly, free of charge. Owner notification letters were mailed on October 20, 2021. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is N212349181.

21V-758

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

General Motors, LLC (GM) is recalling certain 2016-2017 Cadillac CT6 vehicles. The Park/Position lights may be excessively bright. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment." The excessive brightness may affect the vision of other drivers, increasing the risk of a crash. Dealers will install right and left side in-line headlight jumper harnesses, free of charge. Owner notification letters were mailed November 3, 2021. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is N162016079.

21V-759

Jayco, Inc. (Jayco) is recalling certain 2021-2022 Flight SLX recreational trailers. The cooktop is installed in a cabinet that may not be entirely sealed from the furnace. As a result, during furnace operation, the interior range cooktop burner flame may invert. An inverted flame can increase the risk of a fire. Dealers will install sealant and plywood panels, as necessary, free of charge. Owner notification letters were mailed November 29, 2021. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901571.

21V-762

StarCraft RV (StarCraft) is recalling certain 2021 Autumn Ridge Outfitter recreational trailers. The cooktop is installed in a cabinet that may not be entirely sealed from the furnace. As a result, during furnace operation, the interior range cooktop burner flame may invert. An inverted flame can increase the risk of a fire. Dealers will install sealant and plywood panels, as necessary, free of charge. Owner notification letters were mailed November 29, 2021. Owners may contact StarCraft customer service at 1-800-283-8267. StarCraft's number for this recall is 9902571.

21V-763

Highland Ridge RV (Highland Ridge) is recalling certain 2021 Highland Ridge Open Range recreational trailers. The cooktop is installed in a cabinet that may not be entirely sealed from the furnace. As a result, during furnace operation, the interior range cooktop burner flame may invert. An inverted flame can increase the risk of a fire. Dealers will install sealant and plywood panels, as necessary, free of charge. Owner notification letters were mailed November 29, 2021. Owners may contact Highland Ridge customer service at 1-260-768-7771.

21V-764

Ford Motor Company (Ford) is recalling certain 2020-2021 Ranger Super Cab vehicles equipped with rear seats containing fixed head restraints. The fixed head restraints may interfere with proper installation of certain types of child seats. Additionally, the child seat may not attach properly to the lower-rear anchors. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 225, "Child Restraint Anchorage System." An improperly attached child seat can increase the risk of injury in a crash. Dealers will inspect the rear-lower child restraint anchorages for correct alignment and adjust as necessary. Separately, dealers will replace the non-removable head restraints with removable head restraints, free of charge. Interim owner notification letters were mailed on November 5, 2021. A second notice will be sent once remedy is finalized. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21C24.

21V-765

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2021**

Published January 6, 2022

Volvo Car USA, LLC (Volvo Car) is recalling certain 2001-2006 S80 and 2001-2009 S60 vehicles. The driver's air bag inflator may explode during deployment, due to propellant degradation occurring after long-term exposure to high absolute humidity, high temperatures, and high temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants, resulting in serious injury or death. Dealers will replace the driver's air bag, free of charge. Owner notification letters were mailed November 29, 2021. Owners may contact Volvo Car customer service at 1-800-458-1552. Volvo's number for this recall is R10125.

21V-766

Entegra Coach (Entegra) is recalling certain 2021-2022 Anthem, Aspire, and Reatta XL Class A vehicles equipped with Cummins L9 diesel engines that have remote Stage 2 fuel filters and pressurized hoses. A fuel leak may occur in the fuel hoses between the fuel pump and the remote fuel filter head. A fuel leak in the presence of an ignition source may increase the risk of a fire. Entegra will work with Cummins to replace the fuel hoses, free of charge. Owner notification letters were mailed on September 3, 2021. Owners may contact Entegra customer service at 1-800-283-8267.

21V-767

Honda (American Honda Motor Co.) is recalling certain 2022 Odyssey vehicles equipped with Bridgestone tires. The affected vehicles may have a tire that contains a pinhole, causing a slow air leak. As such, these tires fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 139, "New Pneumatic Radial Tires for Light Vehicles." A slow air leak can affect tire performance, and increase the risk of a crash. Dealers will inspect all four tires and replace the tire if a pinhole is found, free of charge. Owner notification letters were mailed November 24, 2021. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is HBL.

21V-768

Jayco, Inc. (Jayco) is recalling certain 2019-2021 Entegra Anthem, Aspire, Cornerstone, Reatta, Reatta XL, and Jayco Embark Class A motorhomes. The instrument cluster may intermittently go blank while the vehicle is in motion. A blank instrument cluster display may be missing critical information such as the vehicle's speed and warning lights, which can increase the risk of a crash. Dealers will update the control module software, and reroute and secure the duct work, free of charge. Owner notification letters were mailed October 22, 2021. Owners may contact Jayco customer service at 1-800-283-8267.

21V-769