

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

**CHILD SEATS:**

None during October 2017.

**EQUIPMENT:**

Indiana Mills and Manufacturing Inc. (IMMI) is recalling certain Generation IV School Bus seats, part number 911698. These seats, equipped with 3-point lap and shoulder belts, have a buckle mount rod that may fracture under load. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." In the event of a crash, the buckle mount rod may fracture preventing the occupant from being properly restrained, increasing the risk of injury. IMMI will notify the school bus manufacturers that purchased the seats, and dealers for those companies will replace the buckle mount rods, free of charge. Owners may contact IMMI customer service at 1-317-896-9531.

**17E-055**

Hale Products Inc. (Hale) is recalling certain retaining rings, part number 077-0750-21-0, that secure the pressure relief valve in the water pumps used for fire fighting. These rings may corrode over time after exposure to water, causing the ring to fail and the pressure relief valve to open, reducing the available water pressure. A reduction in water pressure may hinder fire fighting efforts, increasing the risk of injury. Hale will notify the affected purchasers, and dealers will install a remedy kit, free of charge. The recall began on November 20, 2017. Owners may contact Hale customer service at 1-800-533-3569. Hale's number for this recall is SB-149.

**17E-056**

International Specialty Services, Inc (ISS) is recalling certain NAPA and Evercraft 800lb. low profile transmission jacks. These jacks include a saddle with a tilt angle adjustment bolt that may come loose and destabilize the saddle that is holding the transmission. If the tilt angle adjustment bolt loosens, the transmission could tip over increasing the risk of injury to the mechanic. ISS will notify owners, and dealers will replace the transmission jacks with ones that have a bolt with a castle nut and cotter pin, free of charge. The recall began on December 4, 2017. Owners may contact ISS customer service at 1-864-660-8307.

**17E-057**

UD Trucks Corporation (UD) is recalling one Hino Motors engine, model J08EUJ, sold as a replacement engine for a 2008 UD1800 HD truck. This engine has wrist pin bushings in the connecting rods that may shift and cause excessive cylinder wear. Excessive wear of the cylinders can result in engine failure, increasing the risk of a crash. UD will notify the owner, and a dealer will inspect the stampings on the connecting rods, replacing them as necessary, free of charge. Owners may contact UD customer service at 1-336-291-5237.

**17E-058**

Nitrous Supply is recalling certain Prostar Solenoid valves. The affected valves have end-stops on the sleeves that may break when under pressure, either during installation or during use. If the end stop on the sleeves breaks, the end-stop may come off under pressure, increasing the risk of injury to those nearby or possibly damaging other nearby components. Nitrous Supply notified all owners, and the manufacturer of the nitrous kits

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

replaced the defective sleeves, free of charge. All recall repairs have been made. Owners may contact Nitrous Supply customer service at 1-714-373-1986.

**17E-060**

Accessible Technologies, Inc. (ATI) is recalling certain ProCharger Superchargers, model numbers AB037A-100, AB037A-100P, and A037A-100B, sold for installation on 2012-2017 Jeep Grand Cherokee SRT8 and SRT vehicles. The supercharger mounting bracket may contact and damage the ABS line, possibly resulting in a brake fluid leak. A brake fluid leak may lengthen the distance needed to stop the vehicle, increasing the risk of a crash. ATI will notify owners and will replace the supercharger brackets, free of charge. The recall is expected to begin December 2017. Owners may contact ATI customer service at 1-913-338-2886.

**17E-061**

Walter Kidde Portable Equipment Inc. (Kidde) is recalling 134 models of Plastic-Handle Fire Extinguishers and eight models of Push Button indicator Fire Extinguishers. These extinguishers may become clogged, preventing the extinguisher from discharging as expected or excessive force may be needed to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> If the fire extinguisher does not function properly, it can increase the risk of injury in the event of a fire. Kidde will notify the affected vehicle manufacturers that equipped new vehicles with the extinguishers, and those manufacturers will conduct recalls to notify owners of the issue. Kidde will notify the purchasers of any replacement or aftermarket fire extinguishers. Owners will be instructed to contact Kidde for a replacement fire extinguisher, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Kidde customer service toll-free at 1-855-271-0773, or online at [www.kidde.com](http://www.kidde.com) and click on "Product Safety Recall" for more information.

**17E-062**

Aperia Technologies (Aperia) is recalling certain Halo Tire Inflators, model number 20-00002032. The brackets used with the adapter plates may crack and fail allowing the adapter plate to separate from the wheel, resulting in rapid deflation of the tire. Rapid air loss in a tire can affect vehicle handling, increasing the risk of a crash. Aperia will notify owners, and dealers will replace the affected parts, free of charge. The recall is expected to begin in November 2017. Owners may contact Aperia customer service at 1-415-494-9624.

**17E-063**

Silverstone Associates LLC (Silverstone) is recalling certain Ride Eazy Trimless helmets in sizes S, M, L, XL, and XXL. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that fails to meet the safety requirements can increase the risk of injury in the event of a crash. Silverstone will notify owners and will provide a replacement half helmet, free of charge. The recall is expected to begin December 2017. Owners may contact Silverstone customer service at 1-410-696-7180.

**17E-064**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

**TIRES:**

Harbor Freight Tools (Harbor Freight) is recalling certain Innova Ultra Runner utility trailer tires, sizes 5.3x12 and 4.80/4.00x12, and Far East utility trailer tires, size 4.80/4.00x8, purchased mounted on replacement trailer rims. These tires may not be strong enough to support the expected loads. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 119, "New Pneumatic Tires-Other than Passenger Cars." If the tires cannot meet the strength requirements, the tires may fail, increasing the risk of a crash. Harbor Freight will notify owners, and stores will provide replacement tires mounted on rims, free of charge. The recall began on December 5, 2017. Owners may contact Harbor Freight customer service at 1-800-444-3353.

**17T-017**

Zhaoqing Junhong Co., Ltd. (Zhaoqing) is recalling certain Antares Comfort A5 tires, size LT 225/75R16 118/116S 10 PR. These tires may experience sidewall separation while driving. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 139, "New Pneumatic Radial Tires for Light Vehicles." A tire sidewall separation increases the risk of a crash. Zhaoqing will notify owners and dealers will replace the tires, free of charge. The recall began on December 5, 2017. Owners may contact Zhaoqing customer service at 1-855-444-5120 or by email at [service@antaresrecall.com](mailto:service@antaresrecall.com).

**17T-018**

**VEHICLES:**

Forest River, Inc. (Forest River) is recalling certain 2013-2014 Coachmen Freedom Express recreational trailers. The frames on these vehicles may not have had reinforcement stiffeners welded onto the exterior I-Beam in the axle area, allowing the axles to be misaligned. Misaligned axles can affect vehicle handling, increasing the risk of a crash. Forest River will notify owners, and the frame manufacturer will inspect the trailer for frame reinforcements, installing them as necessary and secure the axle mountings, free of charge. The recall began on October 24, 2017. Owners may contact Forest River customer service at 1-574-825-8205, or Lippert Components customer service at 1-574-537-8900. Forest River's number for this recall is 220-0529.

**17V-611**

Forest River, Inc. (Forest River) is recalling certain 2018 Forester motorhomes, model FRC3271SF. The Federal Placard may inaccurately state that the vehicle has single rear wheels and tires, when the vehicle is equipped with dual rear wheels and tires. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Wheels and Rims-Other than Passenger Cars" and fail to comply with the requirements of 49 CFR Part 567, "Certification." The Federal Placards may cause the operator to not properly maintain the tires and/or wheels. Failure to maintain the tires may lead to improper handling, potentially increasing the risk of a crash. Forest River will notify owners and will provide a corrected Placard, free of charge. The recall began on October 18, 2017. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 34-0528.

**17V-612**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

Forest River, Inc. (Forest River) is recalling one 2018 Haulin' Cargo trailer. The labels on this vehicle may list incorrect tire pressure information. As such, the trailer fails to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims," and the trailer fails to comply with the requirements of 49 CFR Part 567, "Certification." The wrong tire pressure information may cause the tire to be underinflated, affecting vehicle handling, and increasing the risk of a crash. Forest River will notify the owner, and a dealer will replace the affected labels, free of charge. The recall began on October 18, 2017. Owners may contact Forest River customer service at 1-574-848-1335. Forest River's number for this recall is 24-0530.

**17V-613**

Trail King Industries, Inc. (Trail King) is recalling certain 2018 Fifth Wheel Live Bottom trailers, model OLB844NG-HH, manufactured with MPA/MTA suspensions equipped with Meritor EX225 brakes. The brake caliper bolts on these axles may not be properly torqued which can allow the caliper to detach from the mounting flange. If the caliper bolts are improperly torqued and the caliper detaches from the mounting flange, a loss of braking ability would occur, increasing the risk of a crash. Trail King has notified owners and will inspect the caliper bolts, replacing any loose or missing ones, free of charge. The recall began on October 13, 2017. Owners may contact Trail King customer service at 1-800-843-3324.

**17V-614**

Great Dane Trailers (Great Dane) is recalling certain 2018 Everest trailers manufactured with MPA/MTA suspensions equipped with Meritor EX225 brakes. The brake caliper bolts on these axles may not be properly torqued which can allow the caliper to detach from the mounting flange. If the caliper bolts are improperly torqued and the caliper detaches from the mounting flange, a loss of braking ability would occur, increasing the risk of a crash. Great Dane will notify owners, and dealers will inspect the caliper mounting bolts, replacing any loose or missing ones, free of charge. The recall began on December 1, 2017. Owners may contact Great Dane customer service at 1-877-369-3493.

**17V-615**

Braun Corporation (Braun) is recalling certain model year 2016 BraunAbility MXV wheelchair accessible conversion vehicles built on Ford Explorer chassis. If the driver or front passenger seat is moved to its most rearward position, the seat position sensor may be dislodged, preventing the air bag control unit from accurately calculating the frontal air bag deployment force needed in the event of a crash. In the event of a crash, if the frontal air bag does not deploy with the proper force, the occupants have an increased risk of injury. Braun will notify owners, and dealers will modify the seat base pedestals to provide the necessary clearance for the seat position sensor, free of charge. The recall began on November 20, 2017. Owners may contact Braun customer service at 1-800-488-0359.

**17V-616**

Hyundai Motor America (Hyundai) is recalling certain 2011-2014 Sonata and 2011-2015 Sonata Hybrid vehicles previously repaired under recall campaign 17V-152. The seat belt linkages for both front seat belts may detach from the seat belt anchor pretensioners. If the seat belt linkage detaches from the seat belt anchorage, it can not properly restrain the occupant in the event of a crash, increasing the risk of injury. Hyundai will notify

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

owners, and dealers will again verify the connection between the seat belt linkage and the pretensioner and additionally install a warning label to prevent future seat belt linkage detachment, free of charge. The recall began November 6, 2017. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 169.

**17V-617**

Prevost Cars, Inc. (Prevost) is recalling certain 2008-2018 H3-41, H3-45, H3-45 VIP, X3-45, X3-45 VIP, X3-45 VIP Entertainer, and XL2 motor coaches. The fuel tank cradle supports may have gaps at the points where the cradle connects to the coach frame, which can allow the attachment bolts to loosen and fail causing the fuel tank to fall from the vehicle. If the fuel tank separates from the vehicle, it could be a road hazard and the vehicle would stall. Either scenario increases the risk of a crash. Prevost will notify owners, and dealers will correct the fuel tank cradle mounting, free of charge. The recall began on December 4, 2017. Owners may contact Prevost customer service at 1-866-870-2046. Prevost's number for this recall is SR17-28.

**17V-618**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2010 Lexus HS 250h Hybrid vehicles. A component within the hybrid transaxle assembly may short circuit and result in a reduction or a complete loss of available power for moving the vehicle. A complete loss of motive power can increase the risk of a crash. Lexus will notify owners, and dealers will replace the hybrid vehicle transaxle assembly, free of charge. The recall began on December 1, 2017. Owners may contact 1-800-255-3987. Toyota's number for this recall is HLE.

**17V-619**

Grand Design RV, LLC (Grand Design) is recalling certain 2017-2018 Imagine recreational trailers. The wires at the air conditioning unit may detach from the connector and the loose wires may short circuit. A short circuit increases the risk of a fire. Grand Design has notified owners, and dealers will change the existing wire connectors for the air conditioning unit to positive retention wire connectors, free of charge. The recall began on October 23, 2017. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 910010.

**17V-620**

General Motors LLC (GM) is recalling certain 2015-2016 GMC Canyon and Chevrolet Colorado, and 2016 Chevrolet Volt vehicles. The driver's frontal air bag may improperly inflate during second-stage deployment in the event of a high speed crash. An improperly inflated air bag increases the risk of injury in a crash. GM will notify owners, and dealers will replace the driver's frontal air bag module, free of charge. The recall began November 8, 2017. Owners may contact Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 17387.

**17V-621**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2013-2016 Audi A5 Coupe, A5 Cabriolet, A4 Sedan, A4 Allroad and Q5 vehicles. Contact corrosion within the electrical connector for the auxiliary heater may cause the heater wires to overheat or melt. The melted wires can increase the risk of a fire.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

Audi will notify owners, and dealers will replace the auxiliary heater and, as necessary, update the software, free of charge. The Recall began November 27, 2017. Owners may contact Audi customer service at 1-800-893-5298. Volkswagen's numbers for this recall are 80C5 and 80C6.

**17V-622**

Forest River, Inc. (Forest River) is recalling certain 2014-2017 Berkshire XL and XLT buses. The headlights may shut off while switching from low beam to high beam settings, reducing visibility for the operator and other vehicles. If the headlights shut off while driving, decreasing or causing a full loss of visibility, there would be an increased risk of a crash. Forest River will notify owners, and dealers will install a supplemental wiring harness that will stop the headlights from shutting off unexpectedly, free of charge. The recall began on October 31, 2017. Owners may contact Forest River customer service at 1-574-295-2117. Forest River's number for this recall is 40-0241.

**17V-623**

Transportation Collaborative, Inc. (Transtech) is recalling certain 2015-2016 Trans Tech SST, ST Aero, and SST FLR school buses built on Chevrolet chassis and equipped with certain CE White-brand QS11 Series convertible school bus seats. These seats were manufactured with integral D-Ring mounting studs that may have inadequate padding between the occupant and the D-ring mounting stud. In the event of a rear end collision, the seat occupant's head may contact the D-ring mounting stud, increasing the risk of injury. Transtech will notify owners, and dealers will add the proper padding, free of charge. Owners may contact Transtech customer service at 1-845-988-0419. Transtech's number for this recall is 17e045.

**17V-624**

Subaru of America, Inc. (Subaru) is recalling certain 2015 WRX and WRX/STI vehicles, equipped with an optional factory-installed subwoofer in the trunk. Items in the trunk may cause the subwoofer wiring to contact the subwoofer metal frame, possibly resulting in an electrical short. An electrical short may damage the subwoofer amplifier, and may result in the subwoofer overheating, increasing the risk of a fire. Subaru will notify owners, and dealers will inspect the subwoofer wire, install a wire retainer clip, and, as necessary, replace the subwoofer, free of charge. The recall began October 31, 2017. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WTQ-76.

**17V-625**

Keystone RV Company (Keystone) is recalling certain 2018 Crossroads Cruiser and Volante recreational trailers. These vehicles may have been manufactured with propane gas detectors instead of being manufactured with a combination propane gas/carbon monoxide detector. Without a carbon monoxide (CO) detector, occupants will not be alerted to high levels of carbon monoxide, increasing the risk injury or death. Keystone has notified owners, and dealers will install a CO detector, free of charge. The recall began on October 16, 2017. Owners may contact Keystone customer service at 1-855-226-7496. Keystone's number for this recall is 17-302.

**17V-626**

Mercedes-Benz USA, LLC. (MBUSA) is recalling these vehicles: 2014-2018 CLA250, CLA250 4Matic,

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

CLA45 AMG 4Matic, 2015-2018 GLA250, GLA250 4Matic, GLA45 AMG 4Matic, C300 4Matic, C63S AMG, 2012-2014 C250, C350, C300 4Matic, E550 4Matic, 2013-2014 C63 AMG, 2012-2015 C250 Coupe, C350 Coupe, C63 AMG Coupe, 2013-2015 C350 4Matic Coupe, GLK250 4Matic BlueTec, GLK350, GLK350 4Matic, 2016-2017 C350e, C43 AMG, 2015 C400 4Matic, 2016-2018 C63 AMG, GLC300, GLC300 4Matic, 2017-2018 C300 Coupe, C300 4Matic Coupe, C43 AMG, C63 AMG Coupe, C63S AMG Coupe, C300 Cabriolet, C300 4Matic Cabriolet, C43 AMG Cabriolet, C63 AMG Cabriolet, C63S AMG Cabriolet, GLC300 4Matic Coupe, GLC43 AMG, GLC43 AMG Coupe, 2014 E350 Coupe, E350 4Matic Coupe, E350 Cabriolet, E400 Hybrid, 2015-2017 E400 Coupe, E400 4Matic Coupe, E400 Cabriolet, 2014-2017 E550 Coupe, E550 Cabriolet, B250e, 2014-2016 E250 BlueTec, E63 AMG 4Matic Wagon, 2012-2013 E350 BlueTec, 2012-2016 E350, E350 4Matic, 2015-2016 E400, E400 4Matic, 2012 E63 AMG, 2014-2015 E250 4Matic BlueTec, 2013-2016 E350 Wagon, 2017 GLC300d 4Matic, and 2018 GLC350e 4Matic. The driver's air bag may unexpectedly deploy due to insufficient grounding of the steering components if an electrostatic discharge occurs and the air bag clockspring is broken. If the driver air bag inadvertently deploys, it can increase the risk of injury and a crash. MBUSA will notify owners, and dealers will add sufficient grounding to the steering components, free of charge. The recall is expected to begin in December 2017. Owners may contact MBUSA customer service at 1-877-496-3691.

**17V-627**

Daimler Trucks North America LLC (DTNA) is recalling certain 2016 Western Star 4900 and Freightliner Cascadia vehicles, equipped with certain Spicer D-Series and E-Series steer axles. The castellated nut on the steer axles may not be properly torqued, allowing the tie rod to loosen. If the tie rod loosens, it may disconnect from the steering knuckle, causing a complete loss of steering and increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the torque of the castellated nut and tie rod, tightening it as necessary. If the tie rod stud and knuckle on units cannot be sufficiently torqued, the dealer will replace the knuckle and tie rod end assembly, free of charge. DTNA issued an interim notification to owners on December 4, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-751.

**17V-628**

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2018 Freightliner Cascadia vehicles. The upper steering pinch bolt may not have been properly tightened, possibly causing a loss of mechanical connection between the steering wheel and front wheels. A loss of steering control increases the risk of a crash. DTNA will notify owners, and dealers will verify that the upper steering shaft pinch bolt is properly tightened, free of charge. The recall began on October 26, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-748. Note: Owners are advised not to drive their vehicles until they have been checked.

**17V-629**

Cheetah Chassis Corporation (Cheetah) is recalling certain 2017-2018 Bridgemaster, 2017 Extendable and 2017-2018 Maximizer, Tank, Gooseneck, and Heavy Duty trailer chassis. The air brake diaphragm on these vehicles may degrade and allow the brake system air to leak from the quick release valve causing the emergency brakes to engage. Partial or full application of the emergency brakes can cause the wheel-end to overheat or a drag slowing or stopping the vehicle, increasing the risk of a crash. Cheetah will notify owners, and service

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

centers will install heavy duty diaphragms in the quick release valves, free of charge. The recall began on November 20, 2017. Owners may contact Cheetah customer service at 1-704-436-2590.

**17V-630**

E-One Incorporated (E-One) is recalling certain 2016-2017 Quest, Cyclone II, and Typhoon emergency vehicles. The power steering assist cylinder may not have been properly tightened to the steering arm. If the steering assist cylinder detaches there would be a loss of power steering assist, increasing the risk of a crash. E-One will notify owners, and dealers will inspect and retighten the steering assist cylinder mounting bolts, free of charge. The recall November 27, 2017. Owners may contact E-One customer service at 1-352-861-3612.

**17V-631**

John Evans Manufacturing Co. (John Evans) is recalling certain 2017-2018 Flatbed trailers. The air brake diaphragm on these vehicles may degrade and allow the brake system air to leak from the quick release valve causing the emergency brakes to engage. Partial or full application of the emergency brakes can cause the wheel-end to overheat or a drag slowing or stopping the vehicle, increasing the risk of a crash. John Evans will notify owners, and service centers will install heavy duty diaphragms in the quick release valves, free of charge. The recall began on November 20, 2017. Owners may contact John Evans customer service at 1-704-436-2590.

**17V-632**

Wabash National Corporation (Wabash) is recalling certain 2018 Van trailers manufactured with MPA/MTA suspensions equipped with Meritor EX225 brakes. The brake caliper bolts on these axles may not be properly torqued which can allow the caliper to detach from the mounting flange. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the caliper bolts are improperly torqued and the caliper detaches from the mounting flange, a loss of braking ability would occur, increasing the risk of a crash. Wabash will notify owners, and dealers will inspect the bolts, replacing any loose or missing ones, free of charge. The recall began on November 14, 2017. Owners may contact Wabash customer service at 1-765-771-5300.

**17V-633**

Thor Motor Coach (TMC) is recalling certain 2017-2018 Challenger, Axis, Chateau, Four Winds, Hurricane, Miramar, Palazzo, Tuscany, Vegas, Venetian, and Windsport motorhomes. The cargo carrying capacity (CCC) label on these vehicles may indicate an incorrect water capacity for the water heater/fresh water tank. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Tires and Rims for Motor vehicles over 10,000lbs." If the water capacity information is incorrect and it causes the vehicle to be over loaded, there would be an increased risk of a crash. TMC will notify owners and send them corrected labels, free of charge. The recall began on November 15, 2017. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000147.

**17V-634**

Forest River, Inc. (Forest River) is recalling certain 2018 Puma recreational trailers. When installing and tightening the wheels on the trailers, the wheel center caps may have interfered, preventing the wheels from being



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

properly tightened. If the wheels were not properly tightened, they may loosen and detach while the trailer is moving, increasing the risk of a crash. Forest River will notify owners, and dealers will remove the plastic wheel center cap and install a different center cap, free of charge. The recall began on November 1, 2017. Owners may contact Forest River customer service at 1-574-642-0588. Forest River's number for this recall is 420-0537.

**17V-635**

Nissan North America, Inc. (Nissan) is recalling certain 2012 Versa Hatchback vehicles that were sold or ever registered in the District of Columbia, Connecticut, Delaware, Iowa, Illinois, Indiana, Kentucky, Massachusetts, Maine, Maryland, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia and Wisconsin. Road salt may corrode the front coil springs, possibly resulting in the coil springs fracturing. If a front coil spring fractures, it may contact the tire, possibly puncturing it, increasing the risk of a crash. Nissan will notify owners, and dealers will replace both front coil springs, free of charge. The recall began December 6, 2017. Owners may contact Nissan customer service at 1-800-647-7261. This campaign expands recall 15V573.

**17V-637**

Harbor Freight Tools (Harbor Freight) is recalling certain 2014-2017 Haul Master Heavy Duty Folding Trailers, Utility Trailers, Super Duty Trailers, Tag-Along Trailers, and Folding Utility Trailers. The tires on these trailers may not be strong enough to support the expected loads. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 119, "New Pneumatic Tires-Other than Passenger Cars." If the tires cannot meet the strength requirements, the tires may fail, increasing the risk of a crash. Harbor Freight will notify owners, and stores will provide replacement tires mounted on rims, free of charge. The recall began on December 5, 2017. Owners may contact Harbor Freight customer service at 1-800-444-3353.

**17V-638**

Tesla, Inc. (Tesla) is recalling certain 2016-2017 Model X vehicles. The left-side, second row, reclining seat backs may not fully latch due to having incorrectly adjusted recliner mechanism cables. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems," and 210, "Seat Belt Assembly Anchorages." If the seat back moves forward in the event of a crash, it can increase the risk of injury. Tesla will notify owners, and Tesla service technicians will correct the cable adjustment for the left-side, fold-flat, second row, seat recliner mechanism, free of charge. The recall began on November 10, 2017. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-17-13-004.

**17V-639**

Chrysler (FCA US LLC) is recalling certain 2012 Jeep Liberty and 2012-2013 Chrysler 200 and Dodge Avenger vehicles. A component within the occupant restraint controller (ORC) may fail and prevent the active headrests from deploying in the event of a rear-end crash. If the active headrests do not deploy in certain rear-end crashes, the front seat occupants have an increased risk of injury. Chrysler will notify owners, and dealers will replace the ORC as necessary, free of charge. The recall began on December 4, 2017. Owners may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

contact FCA customer service at 1-800-853-1403. FCA's number for this recall is T56.

**17V-640**

Caterpillar Inc. (Caterpillar) is recalling all 2016 Navistar CT660S trucks equipped with certain Spicer D or E series steer axles. The castellated nut on the steer axles may not be properly torqued, allowing the tie rod to loosen. If the tie rod loosens, it may disconnect from the steering knuckle, causing a complete loss of steering and increasing the risk of a crash. Caterpillar will notify owners, and dealers will tighten the castellated nut and tie rod, replacing them as necessary, free of charge. The recall began on December 08, 2017. Owners may contact Caterpillar customer service at 1-800-447-4986.

**17V-641**

HME, Inc. (HME) is recalling certain 2015 Silverfox SFO fire emergency trucks equipped with certain Spicer D or E series steer axles. The castellated nut on the steer axles may not be properly torqued, allowing the tie rod to loosen. If the tie rod loosens, it may disconnect from the steering knuckle, causing a complete loss of steering and increasing the risk of a crash. HME will notify owners, and dealers will tighten the castellated nut and tie rod, replacing them as necessary, free of charge. The recall began on October 24, 2017. Owners may contact HME customer service at 1-616-534-1463.

**17V-642**

Keystone RV Company (Keystone) is recalling certain 2018 Carbon, Fuzion, and Raptor triple axle toy haulers. These vehicles may have an incorrectly welded suspension equalizer that can result in the suspension's failure while traveling. If the suspension fails, the trailer's handling would be affected, increasing the risk of a crash. Keystone has notified owners, and dealers will replace the equalizer with a different one, free of charge. The recall began on October 20, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-305.

**17V-643**

Triple E Recreational Vehicles (Triple E) is recalling 2016-2018 Wonder motorhomes, model W24MB. The fridge power supply is not correctly fused. Without fused protection, in the event of an electrical overload, the power supply wire may overheat, increasing the risk of a fire. Triple E will notify owners, and dealers will correctly connect the fridge wire to the 20 amp fuse block, free of charge. The recall began on November 1, 2017. Owners may contact Triple E RV customer service at 1-877-992-9906. Triple E RV's number for this recall is CA #8764-1.

**17V-644**

KZRV, L.P. (KZRV) is recalling certain 2017-2018 KZRV Sportsmen Sportster trailers. There is insufficient clearance between the slide out support arm and the vehicle tires. While the trailer is being towed, the axle travel can allow the tire to contact the support arm. Tire contact with the slide support arm adjustment bolt may damage the tire, increasing the risk of a crash. KZRV will notify owners and dealers will modify the slide room support arm to provide the proper clearance, free of charge. The recall began on November 17, 2017. Owners may contact KZRV customer service at 1-800-768-4016 extensions 154 or 153. KZRV's number for this recall is KZ-2017-07.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

**17V-645**

West-Mark is recalling one 2011 2TANCX3A tanker trailer manufactured with an MPA/MTA suspension equipped with Meritor EX225 brakes. The brake caliper bolts on this axle may not be properly torqued which can allow the calipers to detach from the mounting flange. As such, this vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake System." If the caliper bolts are improperly torqued and the caliper detaches from the mounting flange, a loss of braking ability would occur, increasing the risk of a crash. West-Mark will notify the owner, and a dealer will inspect the bolts, replacing any loose or missing ones, free of charge. The recall began on October 26, 2017. Owners may contact West-Mark customer service at 1-800-692-5844. West-Mark's number for this recall is C17AB.

**17V-646**

Polaris Industries, Inc. (Polaris) is recalling certain 2010-2017 Victory Cross Country, Cross Country Tour, Cross Roads, Magnum, and Hard Ball motorcycles. If the engine misfires, continued riding may result in heat from the catalytic converter melting the rear brake line and nearby wiring. A melted rear brake line can reduce braking performance, increasing the risk of a crash. Polaris will notify owners, and dealers will re-route the brake line away from the exhaust catalyst, free of charge. The recall began on November 8, 2017. Owners may contact Polaris customer service at 1-877-737-7172. Polaris' number for this recall is V-17-02.

**17V-647**

LBC Manufacturing (LCB) is recalling certain 2017-2018 Pitbull roll-off trailers, model numbers PB47 and PB40, manufactured with MPA/MTA suspensions equipped with Meritor EX225 brakes. The brake caliper bolts on these axles may not be properly torqued which can allow the caliper to detach from the mounting flange. If the caliper bolts are improperly torqued and the caliper detaches from the mounting flange, a loss of braking ability would occur, increasing the risk of a crash. LCB has notified owners, and dealers will inspect the bolts, replacing any loose or missing ones, free of charge. The recall began October 17, 2017. Owners may contact LCB customer service at 1-734-442-6202. LCB's number for this recall is 001PB.

**17V-648**

Eldorado Mobility Inc. (Eldorado Mobility) is recalling certain 2010-2017 Amerivan vehicles. The crimp fasteners that secure the fuel line connectors may not be fully crimped, allowing fuel to leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. Eldorado Mobility will notify owners, and dealers will replace the fuel lines, free of charge. Owners may contact Eldorado Mobility customer service at 1-800-955-9086. Note: This recall supersedes recall 16V222. The recall began on December 5, 2017. Any vehicle previously repaired under that campaign, needs to be remedied again under this campaign.

**17V-649**

Daimler Vans USA, LLC (DVUSA) is recalling certain 2016 Mercedes-Benz Sprinter 2500 and 3500 vehicles. The label on the B-pillar may state a higher maximum vehicle load capacity than the vehicle is designed for. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the load capacity information is incorrect on the label, the vehicle may be overloaded, increasing the risk of a crash. DVUSA will notify owners, and dealers will check the label and replace it if necessary, free of charge. The manufacturer has

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267.

**17V-650**

Daimler Vans USA, LLC (DVUSA) is recalling certain 2017 Mercedes-Benz Metris Vans. The front axle wheel bearings may not have been correctly seated possibly resulting in a front wheel detaching. The loss of a front wheel would increase the risk of a crash. DVUSA will notify owners, and dealers will inspect the front axle wheel bearing retaining rings, correcting their position as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267.

**17V-651**

Ford Motor Company (Ford) is recalling certain 2015-2017 Ford F-150, and 2017 F-250, F-350, F-450, and F-550 Super Duty trucks. The doors on these vehicles may have a bent or kinked actuation cable or the door latches may freeze after water gets into the latch. Either condition can result in the doors opening while driving although they appear to be closed. A door that opens while driving can increase the risk of injury. Ford will notify owners, and dealers will inspect the door latch actuation cables and repair if necessary, and install water shields over the door latches, free of charge. Ford issued an interim notification to owners on November 9, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S33.

**17V-652**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 GLA250 4Matic vehicles. The low beam headlight settings on these vehicles may deviate from the required specification, reducing the range of light. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Reduced headlight range can affect visibility and increase the risk of a crash. MBUSA owns the affected vehicles. Dealers will inspect the headlight adjustment, correcting it as necessary, free of charge. The recall began on October 27, 2017. Owners may contact MBUSA customer service at 1-877-496-3691.

**17V-653**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2015-2016 C63 AMG, 2015-2017 C63S and 2017 C63S AMG Coupe and C63 AMG Cabrio vehicles. The rear axle differential mounting flange may fracture from repeated aggressive launches. A fractured rear axle mounting flange can cause the rear differential to become misaligned, possibly resulting in failure of the driveshaft and a loss of propulsion, increasing the risk of a crash. MBUSA will notify owners, and dealers will update the vehicle's stability system software and chassis control unit software, free of charge. The recall began on November 20, 2017. MBUSA's number for this recall is 2017110002. Owners may contact MBUSA customer service at 1-877-496-3691.

**17V-654**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2016 GLE300d 4Matic, GLE400 4Matic, GLE350 4Matic, GLE63 AMG, GLE63 AMG Coupe, GLE63S AMG and GLE63S AMG Coupe, and 2017 GLS450 4Matic, GLE550 4Matic, and GLE63 AMG 4Matic vehicles. These vehicles may have excess bulkhead insulation extending into the lower windshield area, possibly affecting the windshield bonding and the full protective function of the passenger's frontal air bag in the event of a crash. If the passenger's frontal air bag does

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

not function as designed in the event of a crash, the front seat passenger has an increased risk of injury. MBUSA will notify owners, and dealers will remove any excess bulkhead insulation and rework the windshield bonding, as necessary, free of charge. Interim owner letters will be mailed in December 2017. Owners will receive a second notice when the remedy is available in late January 2018. MBUSA's number for this recall is 2017100011. Owners may contact MBUSA customer service at 1-877-496-3691.

**17V-655**

Smeal Holding, Inc. (Smeal) is recalling certain 2010-2017 Aerial Fire Apparatus vehicles. The torque frame may crack at the notched area. A cracked frame may cause the aerial device to be unstable, increasing the risk of injury. Smeal will notify owners, and dealers will repair the cracks and add a reinforcement, free of charge. The recall began on December 8, 2017. Owners may contact Smeal customer service at 1-800-543-5008. Smeal's number for this recall is 17024.

**17V-656**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2005-2007 and 2009-2010 Toyota Sienna vehicles. In the affected vehicles, due to a problem within the shift lock assembly, the shift lever may be moved out of the 'Park' position without depressing the brake pedal. If the shift lever can be moved from the "Park" position without depressing the brake pedal and the parking brake is not applied, the vehicle may roll, increasing the risk of a crash. Toyota will notify owners, and dealers will replace the shift lock solenoid and reapply the grease, free of charge. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is H0V. Vehicles that were previously recalled under campaign 13V-429 are not affected by this recall.

**17V-657**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2016 Prius vehicles. A capacitor within the hybrid system may not have been properly bolted to the inverter housing. If the capacitor was not properly secured, vibrations from driving the vehicle may damage the capacitor, shutting down the hybrid system, causing a loss of motive power and increasing the risk of a crash. Toyota will notify owners, and dealers will replace the inverter, free of charge. The recall is expected to begin by early December 2017. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is H0U.

**17V-658**

Navistar, Inc. (Navistar) is recalling certain 2017 IC Bus CE and 2016-2017 IC Bus RE school buses, equipped with certain IMMI school bus seat assemblies equipped with 3-point lap and shoulder belts. Under load, the seat belt buckle mount rod can fracture. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." In the event of a crash, if the buckle mount rod fractures, the seat occupant may not be restrained, increasing their risk of injury. Navistar will notify owners, and dealers will replace the 3-point seat belt rods, free of charge. The recall is expected to begin December 15, 2017. Owners may contact Navistar customer service at 1-331-332-1590. Navistar's number for this recall is 17512.

**17V-659**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

Navistar, Inc. (Navistar) is recalling certain 2015-2018 IC Bus RE school buses. The drop hose fittings for the air brakes may not be oriented correctly, and, as a result, the brake hoses may contact the tire when the wheels are turned to the limit. Contact with the tires may damage the service brake air hose, causing the brakes to become inoperative or lengthening the distance needed to stop the bus, increasing the risk of a crash. Navistar will notify owners, and dealers will reposition the drop hose fittings and replace any damaged drop hose or wheel speed sensor harness, free of charge. The recall began on November 21, 2017. Owners may contact Navistar customer service at 1-331-332-4331. Navistar's number for this recall is 17510.

**17V-660**

Navistar, Inc. (Navistar) is recalling certain 2015-2018 IC Bus RE commercial buses. The drop hose fittings for the air brakes may not be oriented correctly, and, as a result, the brake hoses may contact the tire when the wheels are turned to the limit. Contact with the tires may damage the service brake air hose, causing the brakes to become inoperative or lengthening the distance needed to stop the bus, increasing the risk of a crash. Navistar will notify owners, and dealers will reposition the drop hose fittings and replace any damaged drop hose or wheel speed sensor harness, free of charge. The recall began on November 21, 2017. Owners may contact Navistar customer service at 1-331-332-4331. Navistar's number for this recall is 17511.

**17V-661**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Volkswagen Tiguan long wheel base (LWB) vehicles. The back-up lights in the taillight assemblies may not be bright enough. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the back-up lights are not bright enough, other drivers may not see the vehicle reversing, or the driver may back into an obstacle, increasing the risk of a crash. Volkswagen will notify owners, and dealers will replace the affected inner taillight assemblies, free of charge. The recall is expected to begin in December 2017. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 94J9.

**17V-662**

Nissan North America, Inc. (Nissan) is recalling certain 2016-2017 Nissan Rogue vehicles. The recliner joints on the lower seat frame for the rear seats may have improper welds. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standards (FMVSS) number 207, "Seating Systems," and 210, "Seat Belt Assembly Anchorages." The insufficient welds can increase the risk of injury to the occupants in the event of a crash. Nissan will notify owners, and dealers will inspect the seat frames and replace any defective lower seat frames, free of charge. The recall began December 6, 2017. Owners may contact Nissan customer service at 1-800-647-7261.

**17V-663**

General Motors LLC (GM) is recalling certain 2011-2015 Chevrolet Silverado 3500 and GMC Sierra 3500 trucks equipped with dual fuel tanks. The low fuel level sensor for the front tank may stick causing the rear tank to overfill the front tank. If the front tank overfills, the excess pressure may cause the front tank to expand and contact the driveshaft, possibly resulting in a hole in the tank. The hole will leak fuel, which in the presence of an ignition source, can increase the risk of a fire. GM will notify owners, and dealers will replace the rear tank fuel

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

pump or update the fuel-level sensor software, as well as inspect the front tank, replacing it as necessary, free of charge. Interim notices are expected to be mailed December 18, 2017. Owners will receive a second notice in February 2018 when the remedy is expected to be available. Owners may contact GM customer service for Chevrolet 1-800-222-1020 or for GMC customer service at 1-800-462-8782. GM's number for this recall is 17399.

**17V-664**

Daimler Trucks North America LLC (DTNA) is recalling certain 2012-2018 Thomas Built Bus Saf-T-Liner C2 school buses. The affected vehicles are propane-powered and have propane fuel lines that may contact the transmission yoke, possibly causing a propane leak. A propane leak in the presence of an ignition source can increase the risk of a fire. DTNA will notify owners, and dealers will inspect the propane line routing, correcting it as necessary, free of charge. The recall is expected to begin December 16, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-752.

**17V-665**

Van-Con, Inc. (Van-Con) is recalling certain 2011-2017 Dual Rear-Wheel school buses, model 33803, built on Chevrolet 3500 chassis. The seat belt buckle latch plate assembly, when buckled, may rest across the seated passenger's lap instead of being located to the side of the passenger. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." The incorrectly positioned seat belt assembly may increase the risk of occupant injury in the event of a crash. Van-Con will notify owners and will replace the buckle end of the seat belt with a shorter length buckle end, free of charge. The recall is expected to begin December 19, 2017. Owners may contact Van-Con customer service at 1-732-356-8484.

**17V-666**

Keystone RV Company (Keystone) is recalling certain 2018 Crossroads Cruiser and 2017-2018 Crossroads Sunset, Volante, and Zinger recreational vehicles, equipped with Flame King cook tops designed for outdoor use. The cook tops have a corrugated fiber board that can burn due to a breeze or an inverted flame. If the flame of the cook top becomes inverted or is redirected due to a breeze, the corrugated fiber board may burn, increasing the risk of a fire. Keystone will notify owners, and dealers will inspect the corrugated fiber board protector and burner for damage. If no damage exists, the fiber board regulator will be replaced. If damage is found on the fiber board, the cook top will be replaced, free of charge. The recall began on November 13, 2017. Owners may contact Keystone customer service at 1-855-226-7496. Keystone's number for this recall is 17-303.

**17V-667**

Ford Motor Company (Ford) is recalling certain 2015-2017 Ford Transit vehicles, equipped with a trailer tow module. Water can enter the tow modules and corrode the wiring causing issues such as rapidly flashing turn signals, loss of instrument panel display, an electrical short and possibly the deployment of seatbelt pretensioner. An electrical short can increase the risk of a fire. Turn signal, instrument cluster or seatbelt pretensioner problems can increase the risk of a crash. Ford will notify owners, and dealers will add a drainage hole in the driver's door stepwell and incorporate a fuse into the vehicle's wiring harness, free of charge. Ford issued owners

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

an interim notification on November 14, 2017. Owners will receive a second notice when the remedy becomes available. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S34.

**17V-668**

Ford Motor Company (Ford) is recalling certain 2018 F-150 vehicles equipped with a 3.3L engine, a 6-speed transmission and a column mounted shift lever. Quickly moving the shift lever from Park to Drive may cause a loss of gear indication on the instrument cluster display and a momentary selection of an unintended gear, such as Reverse or Neutral before the vehicle achieves Drive function. Unidentified or unintended gear selection may cause the vehicle to move in a way that was not intended by the driver, increasing the risk of crash or injury. Ford will notify owners, and dealers will reprogram the powertrain control module, free of charge. Owners may contact Ford Customer Service at 1-866-436-7332. Ford's number for this recall is 17S35.

**17V-669**

Chrysler (FCA US LLC) is recalling certain 2018 Jeep Cherokee and Compass vehicles equipped with 2.4L engines. The engines may have a cracked oil pump housing that can result in oil pump failure. If the oil pump fails, the engine will stall, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect the oil pump, replacing it as necessary, free of charge. The recall began December 5, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T65.

**17V-670**

Ford Motor Company (Ford) is recalling certain 2017 F-150 vehicles equipped with ten-speed transmissions. The pin that attaches the transmission shift linkage to the transmission may come out, preventing the transmission from responding to movement of the shift lever. The disconnected linkage may cause the vehicle to not move forward or backward as selected by the driver with the shift lever. Additionally, despite selecting 'Park', if the parking brake is not applied, the vehicle may roll. Either scenario increases the risk of a crash. Ford will notify owners, and dealers will replace the roll pin with an updated part, free of charge. The recall is expected to begin December 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S36.

**17V-671**

Ford Motor Company (Ford) is recalling certain 2018 F-150 vehicles equipped with 3.5L engines. The cylinder heads may have been machined without lubrication supply holes for the camshaft bearing journals. Without a proper supply of lubrication, the engine will fail, causing a stall and increasing the risk of a crash. Ford is not aware of any affected vehicles outside of dealer control. Should owner contact subsequently be required, arrangements will be made to transport their vehicle to a Ford or Lincoln dealer to have the engine replaced. The recall began October 24, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S37.

**17V-672**

Keystone RV Company (Keystone) is recalling certain 2017-2018 Keystone Cougar western edition recreational trailers. The stabilizer jacks may not have been properly welded to the chassis frame, possibly



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

resulting in the jacks detaching from the trailer during transit. If the stabilizer jacks separate during transit, they could be a road hazard, increasing the risk of a crash. Keystone will notify owners, and dealers will inspect the mounting of the four stabilizer jacks and install appropriate fasteners, free of charge. The recall began on December 5, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-306.

**17V-673**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017-2018 Audi A4 Sedan and A4 allroad, and 2018 A5 Sportback vehicles. The aluminum trim on the front and rear doors can come loose from around the door speakers, leaving sharp edges exposed. The sharp edges of the speaker trim increase the risk of injury to vehicle occupants. Audi will notify owners, and dealers will replace the speaker cover aluminum trim, free of charge. Interim notices informing owners of the safety risk are expected to be mailed in November 2017. Owners will receive a second notice when the remedy is expected to be available in February 2018. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 70G6.

**17V-675**

BMW of North America, LLC (BMW) is recalling certain 2006-2011 323i, 325i, 325xi, 328i, 328xi, 330i, 330xi, 335i, 335xi and M3, 2007-2011 328i xDrive, 335i xDrive and 335is and 2009-2011 335d vehicles. The wiring and electrical connectors for the system that controls air flow for the heating and air conditioning system may overheat. Wiring that overheats could cause the electrical connectors to melt, and increase the risk of a fire, even when the vehicle is unattended. BMW will notify owners, and dealers will replace the wiring and electrical connectors, free of charge. The recall is expected to begin December 18, 2017. Owners may contact BMW customer service at 1-800-525-7417.

**17V-676**

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Rockwood and Flagstaff travel trailers. The slide room arm may contact and damage the passenger side rear tire. The damaged tire may leak air, resulting in a loss of vehicle control and increasing the risk of a crash. Forest River will notify owners, and dealers will install a lift kit to elevate the chassis and replace any tire that has evidence of damage, free of charge. The recall is expected to begin December 22, 2017. Owners may contact Forest River customer service at 1-574-642-5164. Forest River's number 10-0588.

**17V-677**

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2017-2018 Jaguar XF and F-Pace, 2016-2017 Jaguar XJ and 2018 Jaguar XE vehicles. The instrument cluster (IC) may intermittently go blank. A blank instrument cluster will not show important information like vehicle speed, increasing the risk of a crash. Jaguar will notify owners, and dealers will update the vehicle software, free of charge. The recall is expected to begin December 19, 2017. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H056.

**17V-678**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2017 Land Rover Range Rover and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

Range Rover Sport vehicles. The instrument cluster (IC) may intermittently go blank. A blank instrument cluster will not show important information like vehicle speed, increasing the risk of a crash. Land Rover will notify owners, and dealers will update the vehicle software, free of charge. The recall is expected to begin December 19, 2017. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N124.

**17V-679**

Tremcar is recalling certain 2008-2017 Hutchinson and Tremcar 406 B-train Pups, 2012-2017 Hutchinson and Tremcar 406 2 Axle Semi-Trailers, 2015-2017 Tremcar 406 3 Axle Semi-Trailers, and 2013 Tremcar 406 Quad Wagon vehicles. The rear impact guards on these vehicles were manufactured with aluminum alloy of insufficient strength. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 223, "Rear Impact Guards." These rear impact guards may not adequately reduce the possibility of a car traveling under the trailer in the event of a crash, increasing the risk of injury to the car driver. Tremcar has notified owners, and dealers will replace the rear impact guards, free of charge. The recall began on October 31, 2017. Owners may contact Tremcar customer service at 1-800-363-2158.

**17V-680**

Honda (American Honda Motor Co.) is recalling certain 2017 Honda CBR1000RR and CBR1000RR SP motorcycles. There may be a gap between the fuel tank cap seal and the fuel filler neck which can allow water to enter the fuel tank. If water enters the gas tank, the engine may stall, increasing the risk of a crash. Honda will notify owners, and dealers will replace the fuel tank cap. If water has gotten into the fuel tank, the affected components will be replaced. These repairs will be performed free of charge. Owners may contact 1-866-784-1870. Honda's number for this recall is KH7.

**17V-681**

Indian Motorcycles Company (Indian) is recalling certain 2017-2018 Chief, Chief Classic, Chief Dark Horse, Chief Vintage, Chieftain, Chieftain Classic, Chieftain Dark Horse, Chieftain Elite, Chieftain Limited, Springfield, and Springfield Dark Horse motorcycles. These motorcycles may be equipped with a European-market, not US-market, halogen headlight assembly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The light output from the incorrect headlight can affect the motorcycle's visibility, increasing the risk of a crash. Indian will notify owners, and dealers will inspect the motorcycle and replace any incorrect headlight assembly, free of charge. The recall began on December 6, 2017. Owners may contact Indian customer service at 1-877-204-3697. Indian's number for this recall is I-17-03.

**17V-682**

BMW of North America, LLC (BMW) is recalling certain 2008-2011 128i and 2007-2011 328i, 328xi, 328i xDrive, 525i, 525xi, 528i, 528xi, 530i, 530xi, X3 3.0si, X3 xDrive30i, X5 xDrive30i, Z4 3.0i, Z4 3.0si and Z4 sDrive30i vehicles. The heater for the positive crankcase ventilation (PCV) valve may short circuit. An electrical short can cause the parts within the PCV valve to melt, increasing the risk of a fire, even when the vehicle is not in use. BMW will notify owners, and dealers will replace the PCV valve heater, free of charge. The recall is expected to begin December 18, 2017. Owners may contact BMW customer service at 1-800-525-7417.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

**17V-683**

East Manufacturing Corp. (East) is recalling certain 2013-2018 Frameless Dump Hybrid trailers. These trailers have draft arm tubing that may crack and fail. If the draft arm tubing fails, a loss of vehicle control could occur, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact East customer service at 1-330-325-9921.

**17V-684**

Eldorado National-California, Inc. (Eldorado National) is recalling certain 2017 Axess, E-Z Rider, XHF, and Arrivo buses, equipped with certain Recaro Commercial Bus Driver Seats, models Ergo R, Ergo D, AM71, AM72 and AM80. In the affected seats, the seat belt buckle may be stuck in the locked position, preventing the seat belt tongue from being able to be inserted and locked. If the seat belt becomes stuck in the locked position, the bus may be operated without the seat belt being used, increasing the risk of injury in the event of a crash. Eldorado National will notify owners, and dealers will replace the buckle housings, free of charge. The recall began on December 1, 2017. Owners may contact Eldorado National customer service at 1-909-591-9557.

**17V-685**

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2014-2018 Mirage vehicles. The internal acceleration sensor in the Supplemental Restraint System (SRS) Electronic Control Unit (ECU) can misinterpret vibrations such as those from poor road conditions or a flat tire to be a sensor error thereby disabling the air bags from deploying in a crash. Air bags that do not deploy as designed in a crash increase the risk of injury. MMNA will notify owners, and dealers will reprogram the SRS-ECU software, free of charge. The recall began on November 10, 2017. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-17-006.

**17V-686**

Motor Coach Industries (MCI) is recalling certain 2018 MCI J4500 buses. The primary air line was incorrectly hooked to the secondary air pressure gauge and the secondary air line was hooked to the primary air pressure gauge. As such, these buses fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." The incorrect air pressure readings may increase the risk of a crash by delaying the driver's reaction to addressing the low air condition. MCI will notify owners, and dealers will inspect the air lines for proper connection, repairing them as necessary, free of charge. The recall began on December 12, 2017. Owners may contact MCI customer service at 1-800-241-29471. MCI's number for this recall is SB 455.

**17V-687**

KZRV, L.P. (KZRV) is recalling certain 2017-2018 Connect recreational trailers equipped with an outside kitchen. The outlet for outside kitchen area does not have Ground Fault Circuit Interrupter (GFCI) protection. Without the circuit protection, an individual may be shocked. KZRV will notify owners, and dealers will replace the 110 volt outlet with a GFCI outlet, free of charge. The recall began on November 30, 2017. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2017-08.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2017**

*Published December 15, 2017*

**17V-688**