

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

CHILD SEATS:

None during November 2016.

EQUIPMENT:

Omix Ada, Inc. (Omix Ada) is recalling certain Replacement Steering Sector Shafts for early Willys & Jeep 1941-1966 CJ2a, CJ3a, Willys MB and 1950-1952 M38 (military models), originally equipped with Ross steering boxes. The affected steering sector shafts, manufactured July 25, 2011, to October 14, 2016, may have an incomplete heat treatment, causing accelerated wear and possibly resulting in premature failure. Premature failure of the steering sector shaft can cause loss of control and increase the risk of a crash. Omix Ada will notify owners and will pay so that the affected steering sector shafts are replaced, free of charge. The recall began on November 30, 2016. Owners may contact Omix Ada customer service at 1-770-614-6101. Omix Ada's number for this recall is RR1-16.

16E-082

Meritor, Inc. (Meritor) is recalling certain MX810 Series front drive steer axles, part numbers MX23810DANC7-538 and MX23810DANC8-538, manufactured May 27, 2016, to August 16, 2016 and equipped with MX25K lower king-pins. These lower king-pins may not meet design specifications and, as a result, may fracture, possibly causing a wheel end separation. A wheel end separation can cause loss of vehicle control, increasing the risk of a crash. Meritor will notify owners, and dealers will replace all of the lower king-pins, free of charge. The recall began on November 22, 2016. Owners may contact Meritor customer service at 1-248-435-1725.

16E-083

TI Group Automotive Systems, LLC (TI Automotive) is recalling certain Precision-brand aftermarket and replacement equipment Fuel Pump Modules, model numbers TU200 and TU201, manufactured September 14, 2016, to October 25, 2016. The affected fuel pumps have a pressure relief valve retainer cap that may move after the module is installed, causing a loss of fuel flow. The reduced fuel flow may result in an engine stall, increasing the risk of a crash. TI Automotive will notify owners, and dealers will provide a refund or replace the fuel pump module, free of charge. The recall began on December 22, 2016. Owners may contact TI Automotive customer service at 1-866-867-3759.

16E-084

Dorman Products, Inc. (Dorman) is recalling certain Dorman P/N 525-016, Solutions P/N 665-3499 and OE Solutions P/N 525-016 aftermarket clock spring assemblies manufactured January 18, 2016, to October 11, 2016. The coil harness may not have been centered when it was wound, and, as a result, after the air bag is installed, turning the steering wheel may cause the cable to tear. If the cable tears, the driver's air bag may not deploy in the event of a crash, increasing the risk of injury. Dorman will notify and provide owners with instructions for a diagnostic inspection of the clock spring assemblies. If found defective, Dorman dealers will replace the defective clock spring assembly with a new clock spring, free of charge. The recall began on December 7, 2016. Owners may contact Dorman customer service at 1-800-523-2492 and press 5.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

16E-085

TIRES:

Pirelli Tire LLC (Pirelli) is recalling certain P Zero All Season tires, size 275/40R19 101W, manufactured January 11, 2016, to October 29, 2016, as an original equipment fitment exclusively for certain Maserati cars. Due to an incorrect carcass component, the affected tires may develop cracks in their lower sidewall, possibly resulting in a loss of air. A loss of air may result in tire failure or a loss of vehicle control, increasing the risk of a crash. Pirelli will notify Maserati owners and the dealers that purchased the tires as replacements. Pirelli will work with Maserati to replace the tires, free of charge. The recall began on December 30, 2016. Owners may contact Pirelli customer service at 1-706-368-5800.

16T-018

VEHICLES:

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2017 Winnebago View and Itasca Navion motorhomes manufactured March 21, 2016, to September 15, 2016. The affected vehicles may have loose driver and front passenger seat mounting bolts, possibly allowing the seats to detach from the mounting pedestals. If the seat detaches from the mounting pedestal, it can increase the risk of injury and crash. Winnebago will notify owners, and dealers will tighten the seat mounting bolts to the proper specification, free of charge. The recall began on November 16, 2016. Owners may contact Winnebago customer service at 1-641-585-3535.

16V-794

Spartan Motors USA (Spartan) is recalling certain model year 2011-2017 Transit Bus Chassis Cabs manufactured February 17, 2011, to October 19, 2016. The affected vehicles have an exhaust tube that may disconnect at a joint near the underside of the floor, potentially exposing the floor to high temperatures for prolonged time periods. If the floor is exposed to the heat of exhaust gases for long periods, it can increase the risk of a fire. Spartan will notify owners, and dealers will remove the current securing clamp and install a sleeve with different clamps, free of charge. The recall began on November 29, 2016. Owners may contact Spartan customer service at 1-800-543-4277. Spartan's number for this recall is 16026.

16V-795

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2013-2015 Jaguar XF vehicles manufactured May 22, 2013, to June 15, 2015 and equipped with 2.0L GTDi engines. The affected vehicles may have insufficient clearance between the underfloor fuel delivery lines and the under shield and body allowing the fuel lines to chafe, possibly resulting in a fuel leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. Jaguar will notify owners, and dealers will inspect the fuel line for abrasions, replacing it as necessary and install additional clips, free of charge. Parts are not yet available and second notice will be sent when parts are available. The recall is expected to begin January 2017. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J077.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

16V-796

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain model year 2014-2016 Isuzu NPR and NPR HD vehicles manufactured August 26, 2013, to November 11, 2016, and 2016 Chevrolet Low Cab Forward 3500 and 4500 vehicles manufactured July 27, 2016, to November 11, 2016. The affected vehicles have a throttle pedal that may get stuck under the steel stopper bolt, causing the pedal to remain in the full throttle position.

Note: In gasoline models only.

A stuck open accelerator pedal may result in very high vehicle speeds and make it difficult to stop the vehicle, which could cause a crash, serious injury or death. Isuzu will notify owners, and dealers will remove and replace the stopper bolt with a flanged plate, to prevent lateral movement of the throttle, free of charge. The recall began November 14, 2016. Owners may contact Isuzu customer service at 1-866-441-9638.

16V-797

Volvo Car USA LLC (Volvo) is recalling certain model year 2016-2017 XC90, S90, XC60, V60 Cross Country, V60, S60 Cross Country, S60, and S60 Inscription vehicles manufactured February 16, 2015, to August 22, 2016. On the affected vehicles, the front passenger seat belt buckle attaching stud may loosen, allowing the buckle to separate from the seat belt bracket. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages" and number 209, "Seat Belt Assemblies." If the seat belt buckle separates from the bracket, the front seat passenger may not be adequately restrained in the event of a crash, increasing their risk of injury in the event of a crash. Volvo will notify owners, and dealers will inspect the front passenger seat belt buckle stud, replacing the seat belt buckle as needed, free of charge. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R89708.

16V-798

Chrysler (FCA US LLC) is recalling certain model year 2017 Jeep Cherokee vehicles manufactured October 13, 2016, to October 17, 2016. Improper welds on the driver's knee air bag inflator may prevent the air bag from properly inflating. If the driver's knee air bag does not properly inflate, there is an increased risk of injury in the event of a crash. Chrysler will notify owners, and dealers will replace the driver's knee air bag module, free of charge. The recall began November 9, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S84.

16V-799

Yamaha Motor Corporation, USA (Yamaha) is recalling certain model year 2014-2016 WR250R motorcycles manufactured August 1, 2013, to June 1, 2016. Due to an incorrect assembly process, the clutch push lever oil seal may crack, allowing engine oil to leak out. If oil leaks from the engine, the oil may get on the rear tire, causing a loss of control and increasing the risk of a crash. Yamaha will notify owners, and dealers will replace the clutch push lever oil seal, free of charge. The recall began November 11, 2016. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990108.

16V-800

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

E-One Incorporated (E-One) is recalling certain model year 2014-2016 Typhoon, Quest, and Cyclone fire trucks manufactured January 1, 2014, to October 11, 2016, and equipped with aerial ladders. Due to a design change, the filter for the aerial ladder may leak hydraulic fluid. A hydraulic fluid leak can cause a loss of aerial device function, increasing the risk of injury. E-One will notify owners, and dealers will inspect and replace the filter and head assembly, as necessary, free of charge. The recall began on November 29, 2016. Owners may contact E-One customer service at 1-800-627-5050.

16V-801

General Motors LLC (GM) is recalling certain model year 2017 Cadillac XT5 vehicles manufactured April 16, 2016, to May 9, 2016, and 2017 GMC Acadia vehicles manufactured April 19, 2016, to April 22, 2016. The front brake calipers may have a torn or misaligned caliper piston seal which may allow brake fluid to leak. If there is a brake fluid leak, braking performance may be reduced, increasing the risk of a crash. GM will notify owners, and dealers will inspect the front brake calipers, replacing the brake caliper assemblies, as necessary, free of charge. The recall began on December 12, 2016. Owners may contact GM customer service at 1-800-458-8006 (Cadillac), or 1-800-462-8782 (GMC). GM's number for this recall is 16096.

16V-802

PACCAR Incorporated (PACCAR) is recalling certain model year 2017 Kenworth K370, T270, T370, T440, T660, T800 trucks manufactured February 2, 2016, to October 13, 2016, and Peterbilt 330, 337, 348, 367, 389, 567, and 579 trucks manufactured March 7, 2016, to October 5, 2016. The affected vehicles are equipped with certain Goodyear LHS Load Range G tires, size 295/75R22.5 G399A, that due to incomplete adhesion, have a tire tread that may partially separate. A partial tread separation may increase the risk of a crash. Goodyear will notify the owners of the affected Peterbilt and Kenworth vehicles and Goodyear dealers will replace the affected tires, free of charge. The recall began on December 14, 2016. To find a Goodyear dealer, owners should contact Goodyear Consumer Relations at 1-800-592-3267. Consumers may also contact Kenworth customer service at 1-425-828-5000 and Peterbilt customer service at 1-940-591-4000. PACCAR's number for this recall is 1016G (PB) (Peterbilt), and 16KWC (Kenworth).

16V-803

Pavement Technologies Int'l. Corp. (PTIC) is recalling certain model year 2014-2016 Stratos DMT-400, DTM-600, DMT-1000, DMD-400, DMD-600, DMD-1000, SG-400I, SG-600I, and SG-1000I Asphalt Distributor trailers manufactured October 1, 2014, to October 20, 2016. The weight of the affected trailers, when the tank is fully loaded, may exceed the axle manufacturer's maximum load bearing capacity. If the axles are overloaded, the bearings may overheat and/or the hubs may detach from the axles, increasing the risk of a crash. PTIC will notify owners, and dealers will replace the axles with upgraded ones, free of charge. The recall began on December 23, 2016. Owners may contact PTIC customer service at 1-518-218-7676.

16V-804

Terex South Dakota (TSD) is recalling certain model year 2009-2014 Terex TC, and TCX hybrid electric trucks manufactured June 8, 2009, to July 30, 2014 and equipped with aerial devices. The affected vehicles may be improperly wired, and as a result, the aerial boom may move unintentionally when the hydraulic tools are being used. Inadvertent boom movement can cause the platform to strike objects in the work area, increasing the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

risk of injury to the operator. TSD will notify owners, and dealers will install a diode and alter the wiring to correct the issue, free of charge. The recall began on November 20, 2016. Owners may contact TSD customer service at 1-800-982-8975. TSD's number for this recall is SN631.

16V-805

Terex Advance Mixer, Inc. (Terex) is recalling certain model year 2016-2017 Front Discharge Mixers manufactured July 1, 2016, to September 30, 2016, equipped with certain Meritor front drive steer axles. These front axles have a king-pin that may fracture and possibly result in wheel end separation. If the wheel end separates, a loss of vehicle control may result, increasing the risk of a crash. Terex will notify owners, and dealers will replace all of the affected lower king-pins, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-800-678-5961.

16V-806

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2013, 2015, and 2017 GW250 motorcycles. Water may enter the main wiring harness at the rear brake light switch connectors, possibly corroding the brake light switch. The corrosion may cause an electrical short and the loss of the head light, tail light and brake lights, increasing the risk of a crash. Suzuki will notify owners, and dealers will install an improved brake light switch assembly, and install a water protection cover, as necessary, free of charge. The recall began on November 28, 2016. Owners may contact Suzuki customer service at 1-714-572-1490. Suzuki's number for this recall is 2A66.

16V-808

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2016-2017 FCCC XBR, XCL, XCM, and XCR recreational vehicle chassis manufactured January 1, 2016, to October 12, 2016, equipped with Cummins ISL engines. The power steering hose on the affected vehicles may be routed incorrectly, and, as a result, the hose may rub against the power stud on the starter motor, possibly causing electrical arcing and a power steering fluid leak. Electrical arcing in the presence of leaking power steering fluid can increase the risk of a fire. DTNA will notify owners, and dealers will reroute the power steering hose to provide proper clearance, free of charge. The recall is expected to begin December 30, 2016. Owners may contact DTNA customer service at 1-800-547-0712 . DTNA's number for this recall is FL-727.

16V-809

Newmar Corporation (Newmar) is recalling certain model year 2017 Dutch Star, Mountain Aire, London Aire, Essex, and King Aire motorhomes manufactured May 12, 2016, to September 22, 2016 and built on a Spartan Motors chassis. The throttle circuit wires on the affected vehicles may not have been twisted to cancel out electromagnetic interference, and as a result, interference may cause the throttle signal to be higher or lower than intended. Unintended deceleration or acceleration can increase the risk of a crash. Newmar will notify owners, and Spartan dealers will install an overlay harness with twisted wires, free of charge. The recall began on December 1, 2016. Owners may contact Newmar customer service at 1-800-731-8300 or Spartan at 1-800-543-4277. Newmar's number for this recall is 16V-776.

16V-810

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 Riverstone Legacy fifth wheel recreational trailers manufactured October 7, 2016, to October 18, 2016. The spare tire and rim combination on the affected vehicles may be incompatible with the disk-brake hubs, preventing the rim from mounting flat and flush to the hub face. If an owner installs the spare wheel that was provided with the trailer, the lug nuts may fail, allowing the wheel to detach, increasing the risk of a crash. Forest River will notify owners, and dealers will replace the spare rim and tire assembly, free of charge. Owners may contact Forest River customer service at 1-574-367-3269. Forest River's number for this recall is 70-10312016-0263.

16V-811

Hyundai Translead is recalling certain model year 2012-2013 HT Hycube, HT Composite-XT, HT Original, and HT Composite 28' trailers manufactured September 20, 2012, to May 7, 2013. The affected vehicles have I-beams that may crack. If the cracks extend, the bogie may detach. These trailers have been identified and have been listed in the file attached. If the bogie detaches, there would be an increased risk of a crash. Hyundai Translead will notify owners, and dealers will install a repair kit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Hyundai Translead customer service at 1-819-574-1500. Hyundai Translead's number for this recall is 801060.

16V-812

Chrysler (FCA US LLC) is recalling certain model year 2016 Dodge Dart vehicles manufactured April 13, 2015, to June 7, 2016. Due to voltage spikes caused by a problem within the windshield washer pump, the windshield wiper circuit may fail. Without functioning windshield wipers, the driver's visibility may be reduced, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the windshield washer pumps, free of charge. The recall began on December 28, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S83.

16V-813

Chrysler (FCA US LLC) is recalling certain model year 2016 Dodge Durango and Jeep Grand Cherokee vehicles manufactured February 10, 2016, to April 28, 2016 and equipped with a 3.6L engine built at the Saltillo engine plant. During the assembly of the engine, the fuel rail crossover tube may have been damaged, which, over time, may result in a fuel leak. A fuel leak in the presence of an ignition source, can increase the risk of a fire. Chrysler will notify owners, and dealers will inspect the engine assembly for damage to the fuel rail crossover tube, replacing it as necessary, free of charge. The recall began on December 23, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S85.

16V-814

Kia Motors America (Kia) is recalling certain model year 2008-2009 Kia Sportage vehicles manufactured August 9, 2007, to May 13, 2009. The wire harness cover on the Hydraulic Electronic Control Unit (HECU) may be improperly sealed allowing water to get onto the HECU circuit board. If the water is contaminated with salt, such as could occur from melted snow, the wire harness connector pins may corrode and the circuit board may short circuit. If the HECU short circuits, there is an increased risk of an engine compartment fire. Kia will notify owners, and dealers will inspect the connector pins for corrosion, if no corrosion is found, the connector cover will be replaced. If corrosion is present, the dealer will replace the HECU assembly and the connector

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

cover, free of charge. The recall began on November 28, 2016. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC138.

16V-815

Bentley Motors, Inc. (Bentley) is recalling certain model year 2017 Bentayga vehicles manufactured March 1, 2016, to September 30, 2016. During the assembly process, the affected vehicles may not have had the seat mechanism and instrument panel joints properly tightened. If the seat mechanism and instrument panel joints were not tightened, they can loosen, increasing the risk of injury in the event of a crash. Bentley will notify owners, and dealers will inspect and tighten the seat mechanism and instrument panel joints, as necessary, free of charge. The recall is expected to begin in January 2017. Owners may contact Bentley customer service at 1-800-777-6923. Bentley's number for this recall is RE16/32.

16V-816

Highland Ridge RV (Highland) is recalling certain model year 2016 Highlander travel trailers, model 31RGR, manufactured May 26, 2015, to September 24, 2015, equipped with certain aluminum black ladders manufactured by Christianson Industries. The affected ladders have retractable hinges, each with a welded 'top hat' that can separate from the hinge. If the hinges separate from the ladder while in use, the ladder may fall from the vehicle, increasing the risk of injury. Highland will notify owners, and dealers will install 6 repair brackets, free of charge. The recall began on November 29, 2016. Owners may contact Highland customer service at 1-260-768-7771. Highland's number for this recall is 9904333.

16V-818

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain model year 2015-2016 Cyclone travel trailers manufactured July 6, 2014, to September 29, 2015 and 2015-2016 Road Warrior and 2016 Torque trailers manufactured July 18, 2014, to September 30, 2015. The affected trailers are equipped with aluminum black ladders manufactured by Christianson Industries that have retractable hinges, each with a welded 'top hat' that can separate from the hinge. If the hinges separate from the ladder while in use, the ladder may fall from the vehicle, increasing the risk of injury. Heartland will notify owners, and dealers will install hinge braces over the back of the existing hinges, free of charge. The recall began on December 2, 2016. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99-01-28.

16V-819

DRV Suites (DRV) is recalling certain model year 2015-2016 Full House trailers, models JX450, LX450, LX455 and TX500, manufactured October 31, 2014, to August 20, 2015, equipped with aluminum black ladders manufactured by Christianson Industries. The affected ladders have retractable hinges, each with a welded 'top hat' that can separate from the hinge. If the hinges separate from the ladder while in use, the ladder may fall from the vehicle, increasing the risk of injury. DRV will notify owners, and dealers will install a hinge brace over the back of existing hinges, free of charge. The recall began on December 2, 2016. Owners may contact DRV customer service at 1-260-562-3500. DRV's number for this recall is 99-02-06.

16V-820

Cruiser RV (Cruiser) is recalling certain model year 2015-2016 Stryker toy hauler trailers manufactured June 12,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

2014, to August 27, 2015, equipped with aluminum black ladders manufactured by Christianson Industries. The affected ladders have retractable hinges, each with a welded 'top hat' that can separate from the hinge. If the hinges separate from the ladder while in use, the ladder may fall from the vehicle, increasing the risk of injury. Cruiser will notify owners, and dealers will install a hinge brace over the back of the existing hinges, free of charge. The recall began on December 2, 2016. Owners may contact Cruiser customer service at 1-260-562-3500. Cruiser's number for this recall is 99-03-11.

16V-821

Keystone RV Company (Keystone) is recalling certain model year 2017 Cougar fifth wheel trailers, models 246RLSWE, 268RLSWE, 279RKSWE, 281RDIWE, 283RETWE and 284RDBWE, manufactured August 2, 2016, to October 28, 2016. During installation, the propane gas cross tube manifold that connects the propane cylinders may have contacted the fasteners for the floor decking. The contact may result in a propane leak, which in the presence of an ignition source, can increase the risk of a fire. Keystone has notified owners, and dealers will replace the manifold, free of charge. The recall began on November 15, 2016. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 16-269.

16V-822

KZRV, L.P. (KZRV) is recalling certain model year 2015 Venom, Inferno, Sportsmen, Sportster, MXT and SportTrek trailers manufactured July 1, 2014, to August 31, 2015, equipped with certain aluminum black ladders manufactured by Christianson Industries. The affected ladders have retractable hinges, each with a welded 'top hat' that can separate from the hinge. If the hinges separate from the ladder while in use, the ladder may fall from the vehicle, increasing the risk of injury. KZRV will notify owners, and dealers will install a hinge brace over the back of the existing hinges, free of charge. The recall began on December 16, 2016. Owners may contact KZRV customer service at 1-800-768-4016, extension 154 or 153.

16V-823

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2017 Freightliner Cascadia, Business Class M2, and 122SD trucks manufactured January 24, 2016, to October 10, 2016 and equipped with Goodyear G399A LHS 295/75R22.5 Load Range G tires. The tires on the affected vehicles may have cured improperly, possibly resulting in a partial tread separation. Partial tread separation can increase the risk of a crash. Goodyear will notify the owners of the affected Freightliner vehicles and Goodyear dealers will replace the affected tires, free of charge. The recall began on December 14, 2016. To find a Goodyear dealer, owners should contact Goodyear Consumer Relations at 1-800-592-3267. Consumers may also contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-728.

16V-824

Keystone RV Company (Keystone) is recalling certain model year 2015-2016 Keystone Carbon, Fuzion, Impact, Raptor, and Dutchmen Voltage toy hauler fifth wheels equipped with aluminum black ladders manufactured by Christianson Industries. The affected ladders have retractable hinges, each with a welded 'top hat' that can separate from the hinge. If the hinges separate from the ladder while in use, the ladder may fall from the vehicle, increasing the risk of injury. Keystone will notify owners, and dealers will install a hinge brace over the back of the existing hinges, free of charge. The recall began on November 29, 2016. Owners may contact

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 16-267.

16V-825

Newmar Corporation (Newmar) is recalling certain model year 2016-2017 Dutch Star and Ventana motorhomes manufactured January 22, 2016, to November 7, 2016, equipped with Cummins ISL engines. These vehicles, built on a Freightliner chassis, have a power steering hose that may be routed incorrectly, and, as a result, the hose may rub against the power stud on the starter motor, possibly causing electrical arcing and a power steering fluid leak. Electrical arcing in the presence of leaking power steering fluid can increase the risk of a fire. Newmar will notify owners, and Freightliner dealers will reroute the power steering hose for proper clearance, free of charge. The recall began on December 16, 2017. Owners may contact Freightliner customer service at 1-800-547-0712 or Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 16V 809.

16V-826

Entegra Coach (Entegra) is recalling certain model year 2017 Aspire, Anthem, Cornerstone, and Insignia motorhomes manufactured April 15, 2016, to October 25, 2016 and built on Spartan Motors chassis. The throttle circuit wires on the affected vehicles may not have been twisted to cancel out electromagnetic interference, and as a result, interference may cause the throttle signal to be higher or lower than intended. Unintended deceleration or acceleration can increase the risk of a crash. Entegra has notified owners, and Spartan service centers will install an overlay harness with twisted wires, free of charge. The recall began on November 29, 2016. Owners may contact Spartan customer service at 1-800-543-4277 or Entegra customer service at 1-800-945-4787.

16V-827

Forest River, Inc. (Forest River) is recalling certain model year 2015-2017 FR3 motorhomes manufactured September 24, 2014, to May 12, 2016; 2015-2017 Prime Time Spartan toyhaulers manufactured June 10, 2014, to May 31, 2016; 2013-2016 Palomino Columbus toyhaulers manufactured October 4, 2012, to December 4, 2015; and 2015-2016 XLR Thunderbolt and Nitro toyhaulers manufactured May 23, 2014, to November 23, 2016. These vehicles were equipped with certain aluminum, black, ladders manufactured by Christianson Industries. The affected ladders have retractable hinges, each with a welded 'top hat' that can separate from the hinge. If the hinges separate from the ladder while in use, the ladder may fall from the vehicle, increasing the risk of injury. Forest River will notify owners, and dealers will install a remedy kit to correct the issue, free of charge. The recall is expected to begin January 6, 2017. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 51-11102016-0271.

16V-828

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016-2017 S63 AMG Coupe, S65 AMG Coupe, S550 Coupe 4Matic, S63 AMG 4Matic Convertible, and S550 Convertible vehicles manufactured June 29, 2015, to March 15, 2016. The seat belt extenders on the affected vehicles may not retract as intended and may potentially break the event of a crash. In the event of a crash, if the seat belt extender does not retract and/or the extender breaks, the seat occupant may not be properly restrained, increasing their risk of injury. MBUSA will notify owners, and dealers will update the control unit software, free

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

of charge. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-829

Aluminum Trailer Company (ATC) is recalling certain model year 2016-2017 Bumper Pull seven or eight foot wide Toy Hauler trailers manufactured October 1, 2015, to October 31, 2016. The fuel tank may have been attached to the sub frame without rivnuts, and as a result, the mounting bolts may loosen and the fuel tank may detach. If the fuel tank becomes loose and detaches from the vehicle, a fuel leak may result, increasing the risk of a fire. ATC will notify owners and dealers will replace the mounting bolts, free of charge. The recall is expected to begin January 13, 2017. Owners may contact ATC customer service at 1-574-773-2440. ATC's number for this recall is ARVFTANK.

16V-830

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2017 E400 4Matic Coupe, E400 Convertible, E550 Coupe and E550 Convertible vehicles manufactured June 7, 2016, to September 8, 2016. On the affected vehicles, there may be insufficient clearance between the left catalytic converter and the composite underbody panel. The insufficient clearance may cause the panel to melt, increasing the risk of a fire. MBUSA will notify owners, and dealers will inspect and replace the underbody panel, as necessary, free of charge. Owners may contact Mercedes customer service at 1-800-367-6372.

16V-831

BMW of North America, LLC (BMW) is recalling certain model year 2011 BMW 528i, 528xi, 535i, 535xi, 550i and 550xi vehicles manufactured March 1, 2010, through August 31, 2011. The affected vehicles may have received a replacement Sensor Cluster Unit (SCU) during a service visit. These SCUs have an acceleration sensor that may have been incorrectly programmed and, as a result, the SCU may not accurately determine if activation and deployment of the air bags, safety belt pre-tensioners and head restraints is necessary in the event of a crash. Depending on the severity of the crash, inadequate activation of the driver and/or passenger air bags, safety belt pre-tensioners and active head restraints may increase the risk of injury. BMW will notify owners, and dealers will replace the SCU, free of charge. The recall began on December 16, 2016. Owners may contact BMW customer service at 1-800-525-7417.

16V-832

Daimler Vans USA, LLC (DVUSA) is recalling certain model year 2003-2006 Dodge and Freightliner Sprinter 2500 and 3500 vans manufactured June 30, 2003, to August 31, 2006. The instrument cluster on the affected vehicles fails to illuminate the BRAKE warning lamp in the instrument cluster during the vehicle start up bulb-function check. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 105, "Hydraulic and Electric Brake Systems." Without the BRAKE lamp illuminating during the vehicle start up bulb-function check, the driver has no confirmation that the lamp is working and therefore may not know whether or not the lamp will illuminate if the brake fluid level is low. If the operator is unaware that the vehicle has low brake fluid, there would be an increased risk of a crash. DVUSA will notify owners, and DVUSA and Dodge dealers will correct the instrument cluster software, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-770-705-2070.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

16V-833

Thor Motor Coach (TMC) is recalling certain model year 2014-2016 Tuscany motorhomes, models 40DX, 40KQ, 40RX, 42GX, 42WX, 44MT, 45AT and 45LT, manufactured April 11, 2013, to October 12, 2015. In the affected vehicles, water may leak into the keyless entry module and cause an electrical short. An electrical short can increase the risk of a fire. TMC will notify owners, and dealers will seal the area around the keyless entry module, free of charge. The recall will begin in January 2017. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000123.

16V-834

Altec Industries Inc. (Altec) is recalling certain model year 1995-1999 Aerial Device trucks manufactured May 1, 1995, to August 15, 1999 and equipped with Rosenboom Machine and Tool lower boom lift cylinders. The cylinder end gland could fail which could cause uncontrolled boom movement. Uncontrolled boom movement may increase the risk of injury to the operator or bystanders. Altec will notify owners, and dealers will inspect the boom, and repair or replace the cylinder, free of charge. The recall is expected to begin January 9, 2017. Owners may contact Altec customer service at 1-205-991-7733.

16V-835

Volvo Bus Corporation (Volvo Bus) is recalling certain model year 2008-2017 9700 buses manufactured January 7, 2008, to August 25, 2016. The affected vehicles are equipped with a power feed relay for the engine and transmission which may be undersized for the application, causing the relay to fail and the engine to stall. An unexpected engine shutdown increases the risk of a crash. Volvo Bus will notify owners, and dealers will replace the existing relay with a larger, more robust, relay, free of charge. The recall began on December 20, 2016. Owners may contact Volvo Bus customer service at 1-877-773-8678. Volvo Bus' number for this recall is SR16-86.

16V-836

Navistar, Inc. (Navistar) is recalling certain model year 2011-2016 IC Bus CE school buses manufactured November 3, 2009, to February 26, 2015, and 2012-2015 IC Bus BE school buses manufactured August 2, 2010, to September 15, 2014. The affected vehicles have a water shutoff valve, inside, forward of driver heater (feature code 48PPJ or 48PPP) that has a formed heater hose that over time, may fatigue and split resulting in hot engine coolant fluid leaking into the driver's foot area. If hot, pressurized coolant suddenly spills into the operator's foot area, there is an increased risk of a burn injury or a crash. Navistar will notify owners, and dealers will replace the formed heater hose with a more robust one, free of charge. The recall is expected to begin January 6, 2017. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 16510.

16V-837

Navistar, Inc. (Navistar) is recalling certain model year 2011-2016 IC Bus CE transit buses manufactured July 1, 2010, to February 4, 2015, and one IC Bus BE transit bus manufactured on November 2, 2010. The affected vehicles have a water shutoff valve, inside, forward of driver heater (feature code 48PPJ or 48PPP) that has a formed heater hose that over time, may fatigue and split resulting in hot engine coolant fluid leaking into the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

driver's foot area. If hot, pressurized coolant suddenly spills into the operator's foot area, there is an increased risk of a burn injury or a crash. Navistar will notify owners, and dealers will replace the formed heater hose with a more robust one, free of charge. The recall is expected to begin January 6, 2017. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 16511.

16V-838

Maserati North America, Inc. (Maserati) is recalling certain model year 2017 Quattroporte, Ghibile, and Levante vehicles manufactured July 1, 2016, to November 14, 2016. In temperatures below freezing, the entertainment telematics module (ETM) may place itself in a protection mode, disabling the back-up camera. If the back-up camera is inoperable, it may be more difficult for the operator to see people or objects behind the vehicle, increasing the risk of injury or crash. Maserati will notify owners, and dealers will update the ETM software, free of charge. Owners may contact Maserati customer service at 1-201-510-2369. Maserati's number for this recall is 327.

16V-839

Maserati North America, Inc. (Maserati) is recalling certain model year 2017 Ghibli and Quattroporte vehicles and one model year 2016 Ghibli vehicle manufactured February 29, 2016, to October 29, 2016. These vehicles are equipped with certain Pirelli P Zero All Season tires, size 275/40R19 101W, that may develop cracks in their lower sidewall, possibly resulting in a loss of air. A loss of air may result in tire failure or a loss of vehicle control, increasing the risk of a crash. Maserati will notify owners, and dealers will replace the affected tires, free of charge. The recall is expected to begin January 7, 2017. Owners may contact Maserati customer service at 1-201-510-2369. Maserati's number for this recall is 324.

16V-840

Grand Design RV (Grand Design) is recalling certain model year 2015-2016 Momentum toy haulers and Solitude recreational trailers manufactured July 8, 2014, to August 31, 2015, equipped with certain aluminum black ladders manufactured by Christianson Industries. These ladders have retractable hinges, each with a welded 'top hat' that can separate from the hinge. If the hinges separate from the ladder while in use, the ladder may fall from the vehicle, increasing the risk of injury. Grand Design will notify owners, and dealers will install a bracket over the back of existing hinges, free of charge. The recall began on December 16, 2016. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 910008.

16V-841

Hyundai Motor America (Hyundai) is recalling certain model year 2016-2017 Tucson vehicles manufactured May 19, 2015, to November 14, 2016, and 2017 Santa Fe vehicles manufactured November 28, 2015, to November 14, 2016. The affected vehicles may be equipped with an accessory trailer hitch wiring harness that, due to a malfunction of the tow hitch module, may result, in the trailer brake lights being constantly illuminated. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the trailer brake lights stay illuminated while being used, other drivers may be confused, increasing the risk of a crash. Hyundai will notify owners, and dealers will replace the affected accessory trailer hitch wiring harnesses, free of charge. The recall is

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

expected to begin January 13, 2017. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 153.

16V-842

Hyundai Motor America (Hyundai) is recalling certain model year 2007-2008 Entourage vehicles manufactured February 16, 2006, to June 30, 2008. In the affected vehicles, the secondary hood latch may corrode and bind and remain in the unlatched position when the hood is closed. If the primary latch is inadvertently released and the secondary latch is not engaged, the hood could unexpectedly open while driving, increasing the risk of a vehicle crash. Hyundai will notify all of the owners. For vehicles originally sold, or ever registered, in Alaska, Connecticut, Delaware, Illinois, Indiana, Iowa, Kansas, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, Nebraska, New Hampshire, New Jersey, New York, North Dakota, Ohio, Pennsylvania, Rhode Island, South Dakota, Utah, Vermont, West Virginia, Wisconsin, and the District of Columbia, dealers will replace the secondary latch. For vehicles in any other state, dealers will inspect and either lubricate or replace the secondary latch, as necessary, free of charge. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 154.

16V-843

General Motors LLC (GM) is recalling certain model year 2016 Buick Cascada vehicles manufactured December 1, 2015, to February 24, 2016. The affected vehicles may have had the original convertible roof control module (CRCM) replaced with an incorrect CRCM, that allows the windows to close automatically when the roof is closed and can allow the windows to be closed remotely from distances beyond 11 meters using the key fob. As such, these vehicles no longer meet the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 118, "Power-Operated Window Systems." If the windows close automatically or can be closed remotely in ways that do not meet all the requirements of FMVSS 118, the unexpected closure can increase the risk of injury to the passengers. GM will notify owners, and dealers will replace the CRCM with correct module, free of charge. The recall began on December 1, 2016. Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 16126.

16V-844

E-One Incorporated (E-One) is recalling certain model year 2010-2016 tandem axle Cyclone vehicles manufactured July 15, 2010, to June 12, 2016. The affected vehicles are equipped with FIREMAAX suspension and aerial jack legs. While the vehicle is parked with the jack legs extended, the FIREMAAX suspension air bags may lose pressure. When the jack legs are retracted, the air bags may be wrinkled, resulting in damage and the possible failure of the pressurized suspension air bags. Sudden suspension air bag failure can result in a reduction of vehicle stability and handling, increasing the risk of a crash. E-One will notify owners, and dealers will install a pressure protection valve on the exhaust port of the height control valve, free of charge. The recall began December 19, 2017. Owners may contact E-One customer service at 1-352-861-3612.

16V-845

Forest River, Inc. (Forest River) is recalling certain model year 2017 XLR recreational trailers, models XLF413AMP, XLF422AMP, WZXLF422AMP and XLF380AMP, manufactured September 29, 2016, to November 8, 2016. The affected vehicles may be equipped with an incorrect Federal Placard that does not

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

indicate that the vehicle has a third axle. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the Federal Placard is missing the correct axle information, the operator may overload the trailer, causing a loss of a vehicle control and increasing the risk of a crash. Forest River will notify owners, and dealers will install a corrected Federal Placard, free of charge. The recall began on December 1, 2016. Owners may contact Forest River customer service at 1-574-642-0432. Forest River's number for this recall is 45-11122016-0272.

16V-846

Nissan North America, Inc. (Nissan) is recalling certain model year 2016 Titan Diesel XD vehicles manufactured August 7, 2015, to September 1, 2016. The affected vehicles may not have had the temporary fuel tank breather tube cap removed during the vehicle's assembly and the fuel tank breather tube may not have been connected to the bed rail. As a result, the fuel tank may not have the proper ventilation, possibly causing the fuel gauge and the distance to empty meter to both display inaccurately. If the fuel gauge reads incorrectly, the vehicle can run out of fuel without the driver being aware, increasing the risk of a crash. Nissan will notify owners, and dealers will inspect the fuel tank breather tube, replacing the fuel tank, fuel sending unit, and/or fuel tank breather tube, as necessary, free of charge. The recall began on December 12, 2016. Owners may contact Nissan customer service at 1-800-647-7261.

16V-847

Newmar Corporation (Newmar) is recalling certain model year 2017 King Aire motorhomes manufactured January 22, 2016, to October 19, 2016. Water may leak into the turn signal module. If the module is wet while the headlights are on, the glass dash display may switch to the turn signal camera mode causing the dash to show the turn signal side camera view over the speedometer and RPM displays. If the driver cannot see the speedometer and RPM displays, there would be an increased risk of a crash. Newmar will notify owners, and dealers will replace the defective module with a new module that is waterproof, free of charge. The recall began on December 16, 2017. Owners may contact Newmar customer service at 1-800-731-8300.

16V-848

Chrysler (FCA US LLC) is recalling certain model year 2017 Jeep Wrangler vehicles manufactured November 1, 2016, to November 3, 2016. The affected vehicles may have a fuel tank that has a cracked or broken control valve, possibly resulting in a fuel leak in a rollover event, debris in the fuel tank and/or the potential of over fueling the vehicle. A fuel leak in the presence of an ignition source can increase the risk of a fire. Chrysler will notify owners, and Jeep dealers will inspect the fuel tank and replace fuel tank and sending unit, as necessary, free of charge. The recall is expected to begin January 2, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S90.

16V-849

Kalmar Solutions, LLC (Kalmar) is recalling certain model year 2014-2016 Ottawa T2 vehicles manufactured July 15, 2014, to November 3, 2016. In the affected vehicles, the ground circuit of the cab power distribution circuit board can be overloaded. An overloaded ground circuit may increase the risk of a fire in the dashboard. Kalmar will notify owners, and dealers will modify the wiring harness on the electrical option circuit to bypass the undersized ground circuit, free of charge. The recall is expected to begin in January 2017. Owners may contact

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

Kalmar customer service at 1-785-229-6327.

16V-850

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain model year 2016-2017 Conquest and B Touring Cruiser Class C motorhomes manufactured September 24, 2015 through October 24, 2016. In the affected vehicles, the in-dash radio unit assembly was improperly wired allowing the DVD to operate while the vehicle is in motion. If the DVD monitor is operating and viewable while the vehicle is in motion, it may be a distraction to the driver, increasing the risk of a crash. Gulf Stream will notify owners, and dealers will disable the viewing of the DVD monitor while the vehicle is being driven, free of charge. The recall began on December 16, 2016. Owners may contact the Gulf Stream customer service at 1-800-289-8787. Gulf Stream's number for this recall is GM112316.

16V-851

Autocar, LLC (Autocar) is recalling certain model year 2012-2016 Xpeditor vehicles manufactured September 6, 2011, to October 1, 2015. The affected vehicles have hybrid power drive unit cradle mounting bolts that may not have been properly tightened. Improperly torqued mounting bolts may loosen and the power drive unit and drive shaft could detach, becoming a road hazard and increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin January 13, 2017. Owners may contact Autocar customer service at 1-765-489-5499. Autocar's number is ACX-1605.

16V-852

Midwest Automotive Designs, LLC (Midwest) is recalling certain model year 2016 Mercedes Benz Sprinter 2500 and 3500 vehicles manufactured July 1, 2016, to September 30, 2016, equipped with certain left side seat adjusters, model number 486077 manufactured by Atwood. The affected seat adjusters may allow the seats to move in the event of a crash. As such, these adjusters fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages", and 207 "Seating Systems." If the seat moves in the event of a crash, the seat occupant would be at an increased risk of injury. Midwest will notify owners, and dealers will replace the left slide track, free of charge. The recall is expected to begin in December 2016. Owners may contact Midwest customer service at 1-574-522-4878.

16V-853

KTM North America, Inc. (KTM) is recalling certain model year 2015-2016 1290 Super Adventure motorcycles manufactured December 1, 2014, to March 10, 2016, and 2013-2016 1190 Adventure and Adventure R motorcycles manufactured November 20, 2012, to April 25, 2016. In the affected vehicles, the wiring harness can fray and contact the ABS modulator. If the brake line is electrically conductive, the brake line may overheat and melt. If the brake line melts, brake failure may result, increasing the risk of a crash. KTM will notify owners, and dealers will re-position the wiring harness for the electronic control unit, free of charge. Owners may contact KTM customer service at 1-888-985-6090.

16V-854

Autocar, LLC (Autocar) is recalling certain model year 2013-2017 Xpeditor vehicles manufactured December 10, 2012, to November 1, 2016. In the affected vehicles, fuse box vibration may cause the ignition relay to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

open resulting in an engine stall. An engine stall increases the risk of a crash. Autocar will notify owners, and dealers will install an additional bracket to lower the vibration of the fuse box, free of charge. The recall is expected to begin January 20, 2017. Owners may contact Autocar customer service at 1-765-489-5499. Autocar's number for this recall is ACX-1606.

16V-855

Maserati North America, Inc. (Maserati) is recalling certain model year 2017 Quattroporte and Ghibli vehicles manufactured July 1, 2016, to October 12, 2016. The rear differential unit pinion nut may not have been properly tightened, allowing the pinion nut to loosen. A loose pinion gear may bind, possibly resulting in the rear wheels locking up and increasing the risk of a crash. Maserati will notify owners, and dealers will inspect the rear differential unit pinion nut torque, and, as necessary, replace the rear differential unit, free of charge. The recall is expected to begin in December 2016. Owners may contact Maserati customer service at 1-201-510-2369. Maserati's number for this recall is 328.

16V-856

Van Hool N.V. (Van Hool) is recalling certain model year 2010-2014 C2045 and T2145; 2010 C3045; 2016 CX35; 2014-2016 CX45 and TX45; 2009-2016 TD925; 2015-2016 TDX25 and TX40 and 2010-2013 T2140 motorcoaches. In the affected vehicles, the front steering knuckle carriers may crack. Cracking of a steering knuckle carrier may result in its total failure, allowing a wheel to separate from the vehicle, increasing the risk of a crash. Van Hool will notify owners, and dealers will replace the steering knuckle carriers that were produced from August 2009 through March 2011. Carriers that were produced from April 2011 to December 2014 will be inspected by ultrasonic measurement and replaced as necessary. These repairs will be performed free of charge. The recall is expected to begin January 21, 2017. Owners may contact ABC Bus, Inc. at 1-877-427-7278. Van Hool's number for this recall is P855. Note: This recall expands recalls 14V-569 and 15V-331.

16V-857

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2011-2016 Toyota Sienna minivans manufactured January 4, 2010, to August 12, 2016. If the power sliding door is unable to be opened when commanded, such as if the door is frozen shut, the door may subsequently open unexpectedly, possibly while the vehicle is moving. If door opens while the vehicle is moving, there would be an increased risk of injury to the vehicle occupants. The remedy for this recall is still under development. Interim notices are expected to be mailed to owners by January 21, 2017. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is G04.

16V-858

Ride the Ducks International LLC (RTDI) is recalling certain model year 1996-2005 "Stretch" Amphibious Passenger Vehicles. Due to excessive fatigue, the axle housing on the affected vehicles may fracture at the connection point between the knuckle ball and the housing, possibly resulting in a loss of vehicle control. A loss of vehicle control can increase the risk of a crash. RTDI will notify the company-owned operators and licensors and will strengthen the connection at the knuckle housing ball and the axle housing, free of charge. The recall began on December 14, 2016. RTDI customer service can be contacted at 1-417-266-7600.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

16V-859

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 StarTrans PS2 transit buses manufactured April 26, 2016, to October 11, 2016, built on a Daimler Trucks North America (DTNA) chassis and equipped with ICU3s instrument clusters and hydraulic brakes. In the event of a brake malfunction, these clusters may illuminate the Brake System Malfunction telltale/indicator lamp with the word "PARK" instead of the word "BRAKE". As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays," and number 105, "Hydraulic and Electric Brake Systems." If "PARK" illuminates instead of the word "BRAKE," the driver will be unaware of a braking issue or malfunction, increasing the risk of a crash. Forest River will notify owners, and DTNA will replace the ICU3s instrument clusters with new clusters, free of charge, when new clusters are available. Owners are to be notified of this issue beginning on January 18, 2017. Owners may contact Forest River customer service at 1-574-642-3112 and DTNA customer service at 1-800-385-4357. Forest River's number for this recall is 5-11212016-0274.

16V-860

Cummins Inc. (Cummins) is recalling certain model year 2015-2016 Cummins Power Generation Generator sets, models C60D6R, C150D2RE, C100D6R, C200D6R, C200D2RE, C275D2RE, and C300D6R, manufactured December 18, 2015, to October 3, 2016. The affected generator sets have been mounted on trailers, and due to the possibility that the door hinges may fail, the generator set doors may detach while the trailer is being moved. If the door detaches, it can become a road hazard, increasing the risk of a crash. Cummins will notify owners, and dealers will replace the hinges, free of charge. The recall began on December 16, 2016. Owners may contact Cummins customer service at 1-800-343-7357.

16V-861

Kia Motors America (Kia) is recalling certain model year 2016-2017 Sorento vehicles manufactured October 27, 2014, to August 25, 2016, and 2017 Sportage vehicles manufactured December 10, 2015, to August 26, 2016. The affected vehicles are equipped with an accessory trailer hitch wiring harness that, due to a malfunction of the tow hitch module, may result in the trailer brake lights being constantly illuminated. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the trailer brake lights stay illuminated while being used, other drivers may be confused, increasing the risk of a crash. Kia will notify owners, and dealers will replace the trailer tow hitch harness, free of charge. The recall is expected to begin January 18, 2017. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC142.

16V-862

LGS Industries Inc (LGS) is recalling certain model year 2017 Look, Pace, and Cargo Express cargo trailers manufactured October 24, 2016, to November 8, 2016. Due to insufficient welds, the bracket that attaches the torsion spring cable to the ramp door could detach from the ramp door. If the bracket detaches, the door can fall open, creating a crushing hazard or, if the door is completely open, the cable and bracket could act as a projectile, possibly causing personal injury. LGS will notify owners, and dealers will inspect the cable brackets, repairing them as necessary, free of charge. The recall is expected to begin during January 2017. Owners may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2016**

Published January 4, 2017

contact LGS customer service at 1-877-475-5665.

16V-863

CSC Motorcycles, LLC (CSC) is recalling certain model year 2015-2016 Cyclone motorcycles manufactured April 4, 2015, to November 10, 2016. The affected vehicles may not be equipped with a supplemental label that reminds the user to clean the brake reservoir before adding brake fluid and to use DOT 4 brake fluid from a sealed container. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 122, "Motorcycle Brake Systems." If the supplemental brake fluid label is missing, the operator may use an incorrect brake fluid which could damage the brake system and increase the risk of a crash. CSC will notify owners and will provide the customer with the missing label, free of charge. The recall is expected to begin in December 2016. Owners may contact CSC customer service at 1-800-884-4173. CSC's number for this recall is 16-0023810-18747-10.

16V-864