

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

CHILD SEATS:

Merritt Manufacturing Inc. (Merritt) is recalling certain Angel Guard Angel Ride car beds. The restraint harness may not have been properly sewed where the buckle is attached. In the event of a crash, the harness may not restrain the bed occupant, increasing their risk of injury. Merritt will notify owners, and will provide replacement harnesses, free of charge. Owners may contact Merritt customer service at 1-317-409-0146.

19C-003

EQUIPMENT:

Matrix Headgear LTD (Matrix) is recalling certain Alpha motorcycle helmets, in all sizes. The helmet retention system may fail, allowing the helmet to separate from the wearer's head in the event of a crash. Additionally, the helmet may not adequately protect the wearer in the event of a head impact during a crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that does not stay secured to the head or adequately protect the wearer from an impact increases the risk of injury in the event of a crash. Matrix will notify owners and will provide a replacement helmet, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Matrix customer service at info@matrixhelmets.com.

19E-076

Chrysler (FCA US LLC) is recalling certain Mopar Steering Rack and Pinion Electric Gear Assemblies for Ram 1500 trucks (part number 68419897AB) sold as service replacement parts. The electric power steering (EPS) gears may contain a contaminated circuit card assembly that can short circuit. A short circuit can cause an intermittent loss of power steering assist, requiring an inconsistent steering effort to control the vehicle, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the EPS gear assembly, free of charge. The recall is expected to begin January 3, 2020. Owners may contact FCA US customer service at 1-800-853-1403. FCA's number for this recall is VB9.

19E-077

Ioxus Corporation is recalling certain 12V uSTART MD battery support modules, part number uST12D1100G31-ISA. The uSTART module electronics can short circuit internally, causing the vehicle's battery to fully discharge into the uSTART module, possibly resulting in a fire. A short circuit in the uStart module can increase the risk of a fire. Ioxus Corporation will notify owners advising them to remove the uSTART module from the vehicle. Owners may contact Ioxus Corporation customer service at 1-877-751-4222.

19E-078

Triumph Motorcycles America, LTD (Triumph) is recalling certain accessory Quickshifter Kits, part number A9934069, sold for aftermarket installation on Speed Triple S motorcycles. The Quickshifter assembly body may contact the gear change linkage clamp assembly and interfere with gear changes, possibly resulting in a missed gear/false neutral. A missed gear or false neutral can lead to sudden loss of acceleration, increasing the risk of a crash. Triumph will notify owners, and dealers will replace the linkage clamp assembly, free of charge. Owners may contact Triumph customer service at 1-888-284-6288. Triumph's number for this recall is SRAN568 (Acc).

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

19E-079

Takata (TK Global LLC) is recalling certain Non-Azide Driver air bag Inflators (NADI). These inflators were used in some brands of 1995-2000 vehicles and do not contain phase stabilized ammonium nitrate (PSAN) propellant. Due to a manufacturing issue, the NADI inflators may absorb moisture, causing the inflators to rupture or the air bag cushion to underinflate. In the event of a crash necessitating air bag deployment, an inflator rupture may result in metal fragments striking the driver or other occupants. An underinflated air bag may not properly protect the occupant. These scenarios increase the risk of serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. The recall is expected to begin on January 24, 2020.

19E-080

TIRES:

Cooper Tire & Rubber Company Europe Ltd. (Cooper Europe) is recalling certain Avon Cobra Chrome motorcycle tires, size 240/50R16, manufactured April 8, 2018 through June 1, 2019 (DOT date codes 1418-2119). The innerliner gauge may be too thin, possibly resulting in a rapid deflation of the tire. Rapid tire deflation can reduce vehicle control and increase the risk of a crash. Cooper Europe will notify owners, and dealers will replace the tires, free of charge. The recall began November 18, 2019. Owners may contact Cooper Tire customer service at 1-800-854-6288 or email tyrerecall@coopertire.com. Cooper Tire's number for this recall is 174.

19T-009

VEHICLES:

Forest River, Inc. (Forest River) is recalling certain 2020 Cherokee Alpha Wolf Travel Trailers. The wire supplying the 12V power for the refrigerator may have been connected incorrectly to the circuit breaker. The incorrectly connected wire may not have overcurrent protection, allowing the wire to melt, increasing the risk of fire. Forest River has notified owners, and dealers will correct the wiring, free of charge. The recall began November 19, 2019. Owners may contact Forest River customer service at 1-260-499-2100. Forest River's number for this recall is 76-1109.

19V-785

Thor Motor Coach (TMC) is recalling certain 2019-2020 Magnitude and Omni motorhomes. The seat recliner mechanisms may be missing the third pawl required for seat back strength, resulting in a loose seat back. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) numbers 202, "Head Restraints" and 207, "Seating Systems." Improperly assembled recliner mechanism may have reduced strength and may not adequately restrain an occupant in a crash, increasing the risk of injury. Ford has notified TMC owners, and Ford dealers will inspect the seat structures and replace them, as necessary, free of charge. The recall began October 21, 2019. Owners may contact Ford customer service at 1-866-436-7332 or TMC

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

customer service at 1-877-855-2867. TMC's number for this recall is RC000178.

19V-786

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2013-2017 vehicles due to a software fault that may cause the date and time for the emergency call system (eCall) to differ from the actual date and time, potentially relaying an inaccurate vehicle location. For a full list of the affected models visit:

<https://static.nhtsa.gov/odi/rc1/2019/RMISC-19V787-4620.pdf> An inaccurate vehicle location may delay emergency responders, increasing the risk of injury. MBUSA has initiated an Over the Air (OTA) remote update. MBUSA will also notify owners, and dealers will check software for a successful OTA or update the communication module software as needed, free of charge. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-787

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2018 E400 Wagon 4MATIC, E400 4MATIC, E43 AMG 4MATIC, 2018-2019 E63S AMG 4MATIC Wagon, E63 AMG 4MATIC Wagon, E300, E300 4MATIC, GLC63S Coupe AMG 4MATIC, 2019 CLS450, CLS450 4MATIC, CLS53 AMG 4MATIC, E450 Wagon, E53 AMG 4MATIC, GLC300, GLC63 AMG Coupe 4MATIC, G550 4MATIC, G63 AMG, GLC300 Coupe 4MATIC, GLC300 4MATIC, GLC350e 4MATIC, GLC43 AMG Coupe 4MATIC, GLC43 AMG 4MATIC, GLC63 AMG 4MATIC, GT63 AMG four-door 4MATIC, and GT63S AMG four-door 4MATIC vehicles. Although correctly fastened, the front seat belts may be inaccurately detected as being unfastened, which may cause the electric PRE-SAFE®-function and the pretensioner to be deactivated. The electric PRE-SAFE®-function and the seat belt pretensioners may not deploy during a crash, increasing the risk of injury. MBUSA will notify owners, and dealers will inspect the front seat belt buckles, replacing them as necessary, free of charge. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-788

Thor Motor Coach (TMC) is recalling certain 2020 Sequence 20L motorhomes. The screws securing the solar panel to the luggage rack may fail causing the solar panel to detach. If the solar panel detaches from the luggage rack, it can become a road hazard, increasing the risk of a crash. TMC will notify owners, and dealers will replace the screws with plates, carriage bolts, washers, and locking nuts, free of charge. The recall is expected to begin January 3, 2020. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000179.

19V-789

Arcimoto Inc. (Arcimoto) is recalling certain 2019 FUV vehicles. The braided shielding of the high-voltage harness may short against an energized component causing a main fuse to blow, resulting in a loss of drive power. A loss of power can increase the risk of a crash. Arcimoto will notify owners, and dealers will inspect the harness and replace it, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Arcimoto customer service at 1-541-683-6293.

19V-791

Daimler Trucks North America LLC (DTNA) is recalling certain 2016-2020 Western Star 4900 and 5700

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

vehicles equipped with sleeper cab vent windows. Due to improper adhesive, the vent window may detach from the vehicle. If the vent window detaches while the vehicle is in motion, it can become a road hazard, increasing the risk of a crash. DTNA will notify owners, and dealers will replace the vent windows, free of charge. The recall is expected to begin January 2, 2020. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-836.

19V-792

Conel, LLC dba McElrath Trailers (McElrath Trailers) is recalling certain 2014-2019 VX trailers. The side marker LED lights may be missing reflex reflectors. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The lack of reflex reflectors can reduce the trailer's visibility to others, increasing the risk of a crash. McElrath Trailers will notify owners, and dealers will install separate reflex reflectors on the sides and rear of the trailer, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact McElrath Trailers customer service at 1-864-814-2220.

19V-793

KZRV, L.P. (KZRV) is recalling certain 2019-2020 Connect and Sportsmen trailers equipped with an optional Rock Run flip up rear storage rack. The racks may detach from the trailer when loaded. The rack and all items secured to it may detach from the trailer, becoming a road hazard and increasing the risk of a crash. KZRV will notify owners, and dealers will inspect and replace the mounting brackets. If the existing rack is damaged, it will be replaced with a redesigned version, free of charge. The recall began December 16, 2019. Owners may contact KZRV customer service at 1-800-768-4016, extension 154 or 153. KZRV's number for this recall is KZ-2019-02.

19V-794

Blue Bird Body Company (Blue Bird) is recalling certain 2013-2020 Vision school buses equipped with Ford engines. The brake light switch mounting bracket may have caused the brake light switch to be incorrectly adjusted at installation and/or the brake light switch mounting bracket may deform when the driver allows the brake pedal to return forcibly. An incorrectly adjusted brake light switch or deformed brake light switch mounting bracket may cause the brake lights to illuminate continuously. Improperly functioning brake lights could confuse following motorists and fail to warn them that the bus may be stopping, increasing the risk of a crash. Blue Bird distributed owners an interim notification on December 10, 2019. Dealers will install a new, redesigned brake light switch mounting bracket along with a new brake light switch, free of charge. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is S19AI-SB.

19V-795

Blue Bird Body Company (Blue Bird) is recalling certain 2013-2020 Vision transit buses equipped with Ford engines. The brake light switch mounting bracket may have caused the brake light switch to be incorrectly adjusted at installation and/or the brake light switch mounting bracket may deform when the driver allows the brake pedal to return forcibly. An incorrectly adjusted brake light switch or deformed brake light switch mounting bracket may cause the brake lights to illuminate continuously. Improperly functioning brake lights could confuse following motorists and fail to warn them that the bus may be stopping, increasing the risk of a crash.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

Blue Bird issued owners an interim notification December 10, 2019. Dealers will install a new, redesigned brake light switch mounting bracket along with a new brake light switch, free of charge. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R19AI-NSB.

19V-796

Keystone RV Company (Keystone) is recalling certain 2014 Springdale 253FWRLLS trailers. The Federal Identification Tag may have the incorrect tire, rim, and axle size. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." An incorrect label may lead to the unintentional overloading of the trailer, increasing the risk of a crash. Keystone will notify owners, and dealers will replace the Federal Identification Tag, free of charge. The recall began December 2, 2019. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 19-364.

19V-797

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Mercedes-Benz and Freightliner Sprinter vehicles equipped with diesel fuel systems. The bayonet lock between the fuel pump and the fuel tank may not have been closed and locked during manufacturing. As a result, a leak between the fuel pump and the fuel tank could occur. In addition, a gas station fuel pump may not automatically stop once the tank fill level is reached, potentially causing the fuel to overflow. A diesel fuel leak can create slippery road conditions, increasing the risk of a crash. DVUSA will notify owners, and dealers will inspect the bayonet lock on the fuel pump, locking it as necessary, free of charge. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3KRAFMOD.

19V-798

Thor Motor Coach (TMC) is recalling certain 2014-2017 Tuscany XTE (models 34ST, 36MQ, 40AX, 40BX, 40EX and 40GQ), 2013-2018 Tuscany (models 38SQ, 40DX, 40KQ, 40RX, 42GX, 42HQ, 42WX, 44MT 45AT and 45LT) and 2016-2020 Venetian (models A40, B42, F42, G36, J40, L40, M37, R40, S40, and T42) motorhomes. The rear reflectors within the taillight lens may be too high, reducing the vehicle's visibility. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The incorrectly positioned reflectors may make the motorhome less visible to others on the road, increasing the risk of a crash. TMC will notify owners, and dealers will install adhesive reflectors, free of charge. The recall is expected to begin January 3, 2020. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000180.

19V-799

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Mercedes-Benz Sprinter and Freightliner vehicles. A seam on the height adjuster for the front seats may have been insufficiently welded. In the event of a crash, the weld seam may break and cause the seat cushion to shift forward, increasing the risk of injury. DVUSA will notify owners, and dealers will replace the tilt adjuster for the front seats, free of charge. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3SITZVER.

19V-800

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

General Motors LLC (GM) is recalling certain 2014-2016 Chevrolet SS vehicles that previously received an inspect-only remedy under recall 17V-382. Corrosion of the connector between the electric power steering module and the torque sensor connector may cause a loss of electric power steering assist. A greater steering effort would be needed to control the vehicle if power steering is lost, increasing the risk of a crash. GM will notify owners, and dealers will replace the steering gear assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020 or GM customer service at 1-586-596-1733. GM's number for this recall is N192265980.

19V-801

Hyundai Motor America (Hyundai) is recalling certain 2020 Palisade vehicles. The mounting bolts used to secure the side curtain air bags may damage the side curtain air bags during deployment. Damaged side curtain air bags may not inflate properly in the event of a crash, increasing the risk of injury. Hyundai will notify owners, and dealers will install a protective cover on the mounting bolts, free of charge. The recall is expected to begin January 3, 2020. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 186.

19V-802

Daimler Trucks North America LLC (DTNA) is recalling certain 2020 Freightliner Cascadia vehicles. Due to inadequate clearance between the brake chambers and the frame rail, the brake chambers can contact the frame rail and cause brake chamber to detach or be damaged. Damage to the brake chamber can cause reduced brake effectiveness, increasing the risk of a crash. DTNA reports that all affected vehicles have been remedied, therefore owner notifications will not be sent. The recall began on November 7, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-837.

19V-803

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2012-2017 i-MiEV vehicles. Water may penetrate the brake assist vacuum pump, causing corrosion and a failure of the brake vacuum pump. Without the brake vacuum pump, the driver will experience a sudden loss of braking assist, lengthening the distance needed to stop the vehicle and increasing the risk of a crash. MMNA will notify owners, and dealers will replace the brake vacuum pump, free of charge. The recall is expected to begin January 7, 2020. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-19-002.

19V-804

Ford Motor Company (Ford) is recalling certain 2019-2020 F-150 vehicles. The fastener securing the Power Distribution Box (PDB) 12V cable and Battery Monitoring System (BMS) eyelets to the positive battery terminal may loosen and affect the vehicle's systems such as instrument panel displays and braking or steering assist. The engine could also stall. Inoperative vehicle systems or an engine stall can increase the risk of a crash. Reduced braking and steering efforts increases the risk of a crash. This condition could also create a resistive short, increasing the risk of a fire. Ford will notify owners, and dealers will inspect the positive battery cable/BMS/PDB joint for excess sealant adhesive and remove any excessive adhesive, reassemble the joint, and retorquing the fastener, as necessary, free of charge. The recall began November 25, 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S40.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

19V-805

Aston Martin The Americas (Aston Martin) is recalling certain 2018-2019 DB11 Coupe and Volante and 2019 Vantage and DBS Superleggera Coupe vehicles. The locking nut fasteners on the passenger air bag may not be tightened properly. In the event of a crash necessitating passenger air bag deployment, the air bag may not deploy properly, increasing the risk of injury. Aston Martin will notify owners, and dealers will inspect the air bag fasteners, tightening them as necessary, free of charge. The recall began December 11, 2019. Owners may contact Aston Martin customer service at 1-866-278-6661. Aston Martin's number for this recall is RA-01-1327.

19V-806

Nissan North America, Inc. (Nissan) is recalling certain 2015-2018 Nissan Murano, 2016-2018 Nissan Maxima, and 2017-2019 Nissan Pathfinder and Infiniti QX60 vehicles. These vehicles were previously recalled and unrepaired, or inspected and determined to not need a repair, under recall number 18V-601. In addition, this recall expands the previous population. The Anti-lock Brake System (ABS) actuator pumps may allow brake fluid to leak onto an internal circuit board. A brake fluid leak on the circuit board may result in an electrical short, increasing the risk of a fire. Nissan will notify owners, and dealers will replace the ABS actuator, free of charge. Owners will receive a second notice when remedy parts become available, currently expected to be during summer 2020. Owners may contact Nissan customer service at 1-800-867-7669. Note: If the ABS warning light remains illuminated for more than 10 seconds after engine start up, owners are advised to park the vehicle outdoors away from other vehicles or structures and to not drive the vehicle.

19V-807

Ford Motor Company (Ford) is recalling certain 2018-2019 F-250, F-350 and F-450 Super Duty trucks. The Daytime Running Lights (DRL) may not dim when the headlight switch is moved into the "On" position. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." DRL that cannot dim may reduce the visibility of other drivers, increasing the risk of a crash. Ford has notified owners, and dealers will reprogram the Body Control Module (BCM) software, free of charge. The recall began November 25, 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19C10.

19V-808

Ford Motor Company (Ford) is recalling certain 2016-2017 Lincoln MKX vehicles equipped with 3.7L engines. The battery positive cable harness may contact the transmission shifter cable bracket resulting in a short circuit. An electrical short increases the risk of a fire. Ford will notify owners, and dealers will remove the battery harness clips and elbow guide, and install a wire channel shield and protective sleeve to the battery cable harness, free of charge. Interim notices informing owners of the safety risk were mailed on December 2, 2019. Owners will receive a second notice when the remedy becomes available, currently expected to be in the first quarter of 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S41.

19V-809

Daimler Trucks North America LLC (DTNA) is recalling certain 2019 Freightliner Business Class M2 vehicles

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING NOVEMBER 2019

Published December 17, 2019

equipped with a certain PowerDrive EV electric drivetrain. Due to a software error, the VCU may activate the anti-roll back feature during slow moving or stop and go conditions, which can cause unexpected vehicle movement. Unexpected vehicle movement can increase the risk of a crash. DTNA will notify owners, and Cummins dealers will update the VCU software, free of charge. The recall is expected to begin January 6, 2020. Owners may contact Cummins customer service at 1-800-286-6467 or DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-838.

19V-810

Winnebago Industries, Inc. (Winnebago) is recalling certain 2017-2020 Itasca Vista, Sunstar, and Adventurer 35F motorhomes. An electrical connector was mounted directly on the floor instead of to a standoff bracket as intended. If the floor gets wet where the electrical connection is mounted, there is an increased risk of an electrical short and fire. Winnebago will notify owners, and dealers will correctly mount the electrical connector onto a metal standoff bracket, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-641-585-6939 or 1-800-537-1885. Winnebago's number for this recall is 160.

19V-811

Chrysler (FCA US LLC) is recalling certain 2019 Ram 1500 trucks. These vehicles may have been built with a contaminated electric power steering (EPS) gear that may short circuit, potentially resulting in an intermittent loss of power steering assist. An intermittent loss of power steering assist may cause an inconsistent steering effort, especially during lower speed maneuvers, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the EPS gear assembly, free of charge. The recall began December 12, 2019. Owners may contact FCA US customer service at 1-800-853-1403. FCA's number for this recall is VB8.

19V-812

Chrysler (FCA US LLC) is recalling certain 2011-2013 Dodge Durango and Jeep Grand Cherokee vehicles equipped with a 3.6, 5.7, or 6.4 liter engine and previously recalled under NHTSA Recall 14V530 or 15V115. The fuel pump relay inside the Totally Integrated Power Module (TIPM-7) may fail, causing the vehicle to stall without warning. A vehicle stall increases the risk of a crash. The remedy for this recall is still under development. Interim notices informing owners of the safety risk will be mailed beginning January 3, 2020. Vehicles that experience a fuel pump failure will receive an interim repair. Owners will receive a second notice when the final remedy becomes available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is V62.

19V-813

General Motors LLC (GM) is recalling certain 2019-2020 Chevrolet Silverado 1500 and GMC Sierra 1500, and 2020 Silverado 2500, Silverado 3500, Sierra 2500, and Sierra 3500 vehicles equipped with carpet floor covering. When the front seat belt pretensioners deploy, hot gas may vent through an opening in the pretensioner bracket, possibly igniting the carpet. A vehicle fire could result if materials ignite inside the vehicle. GM will notify owners, and dealers will close off the opening in the pretensioner bracket, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

or GMC customer service at 1-888-988-7267. GM's number for this recall is N192270600.

19V-814

Triumph Motorcycles America, LTD (Triumph) is recalling certain 2019 Speed Triple RS motorcycles. The Quickshifter Assembly, TSA body may contact the gear change linkage clamp assembly and interfere with gear changes, possibly resulting in a missed gear or false neutral. A missed gear or false neutral can lead to sudden loss of acceleration, increasing the risk of a crash. Triumph will notify owners, and dealers will replace the linkage clamp assembly, free of charge. The recall began December 13, 2019. Owners may contact Triumph customer service at 1-888-284-6288. Triumph's number for this recall is SRAN567.

19V-815

Newmar Corporation (Newmar) is recalling certain 2020 Mountain Aire motorhomes built on a Daimler Trucks North America (DTNA) chassis. The low beam bulbs may not remain illuminated when the high beam bulbs are activated. If both beams are not illuminated together as intended, the driver may have reduced visibility, increasing the risk of a crash. Newmar will notify owners, and DTNA dealers will repair as necessary to ensure the low beam bulb will illuminate along with the high beam bulb, free of charge. The recall is expected to begin January 14, 2020. Owners may contact Newmar customer service at 1-800-731-8300 or DTNA customer service at 1-800-547-0712.

19V-816

Chrysler (FCA US LLC) is recalling certain 2012-2013 Fiat 500 vehicles equipped with 6-speed automatic transmissions. The shifter cable bushing may fail allowing the cable to detach from the transmission. If the shifter cable detaches from the transmission, the transmission may not shift into the gear selected by the driver. Additionally, despite selecting PARK with the shifter, the vehicle may roll away. These scenarios may increase the risk of a crash. Chrysler will notify owners, and dealers will replace the shifter cable adjuster, free of charge. The recall is expected to begin January 4, 2020. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is VB4.

19V-817

Chrysler (FCA US LLC) is recalling certain 2015-2018 Ram ProMaster vehicles equipped with 3.0L diesel or 3.6L gasoline engines and air conditioning (A/C). The engine cooling fan may seize which can cause the cooling fan motor to overheat. An overheated fan motor increases the risk of a fire. The remedy for this recall is still under development. FCA US LLC issued owners an interim notification December 10, 2019. Owners will receive a second notice when the remedy becomes available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is VB2.

19V-818

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2019 G550 4MATIC and G63 AMG vehicles. The front door wiring harnesses may have been improperly routed causing damage to the individual wires during opening and closing of the front doors. The damage to certain wires can impact safety features such as the side impact restraint system, the automatic unlocking of the door in the event of a crash, or the vehicle location in the event of an emergency call. These scenarios increases the risk of an injury in the event of a crash. MBUSA will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

notify owners, and dealers will inspect, modify, or replace the front door wiring harness in the event damage has occurred, free of charge. The recall is expected to begin January 14, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-820

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2018-2019 S560, S560 Cabriolet, and S560 4MATIC vehicles equipped with 8-cylinder gasoline engines. The threaded connection between the camshaft idler gear and the crankcase may be improperly tightened, possibly causing the idler gear to detach from the crankcase. A detached idler gear can damage the engine, resulting in a stall and increasing the risk of a crash. MBUSA will notify owners, and dealers will replace the engine, free of charge. The recall is expected to begin January 14, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-821

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2019 GLC300 and GLC300 4MATIC vehicles. The electrical connection between the power steering electric motor and the control unit may fail, resulting in the loss of electric power steering assist. A loss of power steering assist would require a greater steering effort to control the vehicle, increasing the risk of a crash. MBUSA will notify owners, and dealers will replace the electric power steering control unit, free of charge. The recall is expected to begin January 14, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-822

BMW of North America, LLC. (BMW) is recalling certain 2015-2019 X6 sDrive35i, X6 xDrive35i, X6 xDrive50i, and X6M vehicles equipped with rear seat lower anchor bars used in securing child restraint seats. The lower anchor bars may become damaged over time when used with an ISOFIX-type, rigid-style connector, child restraint system. Damaged lower anchor bars may increase the child's risk of injury in the event of a crash. BMW will notify owners, and dealers will weld a reinforcing bracket to the lower anchor bars and the vehicle body, free of charge. Owner notification is expected to begin January 17, 2020. Owners may contact BMW customer service at 1-800-525-7417.

19V-823

Forest River, Inc. (Forest River) is recalling certain 2018-2019 Glaval Bus Apollo, Commute, Concorde II, Entourage, Legacy, Primetime, Titan, Titan II Low Floor, and Universal shuttle buses equipped with Safe Fleet Prolo Roof Escape hatches. Due to a manufacturing issue, the roof hatch external handle may unexpectedly break under reasonable use. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If the roof hatch external handle breaks, in the event of an emergency, the hatch cannot be easily opened from outside the vehicle, increasing the risk of injury. Forest River will notify owners, and dealers will replace the hatch, free of charge. The recall began December 10, 2019. Owners may contact Forest River customer service at 1-800-748-3440. Forest River's number for this recall is 05-1115.

19V-824

Ducati North America (Ducati) is recalling certain 2018 Multistrada 1260, 1260S, and Pikes Peak motorcycles.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

The side stand may be improperly welded, potentially causing the stand to break. If the stand breaks the motorcycle may unexpectedly fall over, increasing the risk of injury. Ducati will notify owners, and dealers will replace the side stand, free of charge. The recall is expected to begin January 2, 2020. Owners may contact Ducati customer service at 1-888-391-5446. Ducati's number for this recall is SRV-RCL-19-004.

19V-825

Piaggio Group Americas, Inc. (Piaggio) is recalling certain 2019 Vespa GTV 300, GTS 300, and 2020 Vespa GTS 300 HPE scooters. The brake lines may have been improperly galvanized, allowing hydrogen to be released into the brake fluid. Hydrogen in the braking system can reduce the brake lever's ability to activate the brakes, increasing the risk of a crash. Piaggio will notify owners, and dealers will install front and rear master cylinder brake flush fittings, and perform a complete brake system flush, free of charge. The recall began November 27, 2019 and owner letters will be mailed through January 17, 2020. Owners may contact Piaggio customer service at 1-212-380-4433. Piaggio's number for this recall is PP2ZZQ1904_GTS.

19V-826

Forest River, Inc. (Forest River) is recalling certain 2020 Rockwood RLF8298KS and Flagstaff FLF8529RLS recreational trailers. Due to improper tire clearance, the tire may contact the steel chassis outrigger, possibly resulting in tire failure. Tire failure can cause a loss of vehicle control, increasing the risk of a crash. Forest River will notify owners, and dealers will install a new outrigger to achieve the proper tire clearance, and damaged tires will be replaced, free of charge. The recall began December 10, 2019. Owners may contact Forest River customer service at 1-574-642-8954. Forest River's number for this recall is 10C-1116.

19V-827

Marion Body Works Inc. (Marion Body Works) is recalling certain 2005-2020 Emergency Response Gladiator and Metrostar vehicles equipped with pneumatically-controlled automatic tire chain systems. The air pressure control lines may not be pressure-protected. Without the control line being pressure-protected, in the event the control line is severed, air may suddenly be lost from the service reservoir system, causing the brakes to apply unexpectedly, increasing the risk of a crash. Marion Body Works will notify owners, and dealers will inspect the routing of the control lines, rerouting them into the auxiliary air reservoir as necessary, free of charge. The recall began November 22, 2019. Owners may contact Marion Body Works customer service at 1-715-754-5261 or Spartan customer service at 1-800-543-5008.

19V-828

Daimler Trucks North America LLC (DTNA) is recalling certain 2020 Freightliner Econic SD vehicles. The vehicle certification label contains the incorrect gross axle weight rating (GAWR) information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Wheels and Rims- Other Than Passenger Cars." The incorrect weight rating information can result in overloading of the axles, increasing the risk of a crash. DTNA reports that all affected vehicles have been remedied with new labels and tires, therefore owner notifications will not be sent. The recall began November 19, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-840.

19V-829

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

Arcimoto Inc (Arcimoto) is recalling certain 2019 FUV motorcycles. A component of the display board may short circuit causing the communication and display circuit boards to shutdown. If the communication or display board shuts down, the battery may shutdown causing a sudden loss of power and increasing the risk of a crash. Arcimoto will notify owners, and dealers will trim the pins of the 5V regulator, and apply a layer of protective tape, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Arcimoto customer service at 1-541-683-6293.

19V-830

Daimler Trucks North America LLC (DTNA) is recalling certain 2018-2020 Thomas Built Saf-T-Liner HDX school buses equipped with Detroit DD8 Engines and Allison Transmissions. The Flex-Plate/Torque Converter fasteners may have been insufficiently tightened. The loose bolts can become lodged in the starter, disabling the bus, resulting in an evacuation in an uncontrolled traffic situation, increasing the risk of an injury. DTNA will notify owners, and dealers will inspect and tighten the fasteners, as necessary, free of charge. DTNA issued owners an interim notification on December 13, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-839.

19V-831

Arcimoto Inc (Arcimoto) is recalling certain 2019 FUV motorcycles. The ignition switch is missing the word "Ignition" and the "Off" position is not labeled with the word "Off." As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 123, "Motorcycle Controls and Displays." The missing word labels could lead to operator error, increasing the risk of injury or crash. Arcimoto will notify owners, and dealers will replace the key switch trim ring with a laser-etched key switch that contains an "Ignition" and "Off" label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Arcimoto customer service at 1-541-683-6923.

19V-832

Arcimoto Inc. (Arcimoto) is recalling certain 2019 FUV motorcycles. The inverter broadcast may exceed its current limit, resulting in an unexpected battery shutdown. If the battery unexpectedly shuts down, the motorcycle can immediately lose power, increasing the risk of a crash. Arcimoto will notify owners and dealers will reprogram the inverter software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Arcimoto customer service at 1-541-683-6293.

19V-833

Arcimoto Inc (Arcimoto) is recalling certain 2019 FUV motorcycles. Due to a software error, communication between inverters may time out, possibly resulting in an unexpected battery shutdown. If the battery unexpectedly shuts down, the motorcycle can immediately lose power, increasing the risk of a crash. Arcimoto will notify owners, and dealers will reprogram the inverter software/ firmware, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Arcimoto customer service at 1-541-683-6293.

19V-834

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain 2017-2020 NPR-HD, 2019-2020 NPR-XD,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

NQR, NRR, Chevrolet 4500HD, Chevrolet 5500HD and Chevrolet 5500XD, and 2020 Chevrolet 4500XD vehicles. The lug nuts on the rear outer wheels may not have been properly tightened when installed onto the rear axles. If the lug nuts were not properly tightened, they can loosen, causing the to wheel separate from the vehicle, increasing the risk of a crash. Isuzu will notify owners, and dealers will inspect the rear outer wheel lug nuts and tightening or replacing them as necessary, free of charge. Owners may contact Isuzu customer service at 1-866-441-9638 or Chevrolet customer service at 1-800-222-1020. Isuzu's number for this recall is V1906.

19V-835

Temsa is recalling certain 2020 TS45 buses. Improper installation of the aisle floor hatches may cause uneven floors. The surface level difference can increase the risk of an injury. Temsa will notify owners, and dealers will revise the floor hatches, free of charge. Owners may contact Temsa customer service at 1-407-271-8935.

19V-836

General Motors LLC (GM) is recalling certain 2020 Cadillac Escalade, Escalade ESV, Chevrolet Camaro, Silverado 1500, Suburban, Tahoe, GMC Sierra 1500, Yukon, and Yukon XL vehicles. The fuel pump may be missing a pressure regulator, allowing for over-pressurization of the fuel system. Over-pressurization can crack the fuel pump and cause leaks, increasing the risk of a fire in the presence of an ignition source. GM will notify owners, and dealers will replace the fuel pump, free of charge. The recall is expected to begin January 6, 2020. Owners may contact Cadillac customer service at 1-800-333-4223, Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-888-988-7267. GM's number for this recall is N192283991.

19V-837

Navistar, Inc. (Navistar) is recalling certain 2020 International HV 6X4 vehicles. The vehicles were built with a non-Quick Release Modulator Valve (NQRMV) instead of a Quick Release Modulator Valve (QRMV), which may affect the brake release time. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." A longer time required to exhaust the brake chambers could increase the risk of a brake or tire fire. Navistar will notify owners, and dealers will replace the NQRMV with a QRMV, free of charge. The recall is expected to begin January 20, 2020. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 19519.

19V-838

Ford Motor Company (Ford) is recalling certain 2019 Ranger trucks. The inline electrical connector terminals for the rear lights may be misaligned or not properly seated, potentially causing the rear lights to function intermittently or not at all. Intermittent or inoperative tail lamps can result in loss of stop, turn, rear position, and reverse lamp functions, which reduces the vehicle's visibility and may not fully alert other drivers that the vehicle is braking, turning, or reversing, increasing the risk of crash. Ford will notify owners, and dealers will inspect the inline connector for loose terminals and replace the connectors, if necessary, free of charge. The recall is expected to begin January 6, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S43.

19V-839

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020 Range Rover Evoque vehicles.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

The adhesive bond attaching a metal plate to the headliner can fail after exposure to very cold temperatures. In the event of a crash necessitating the deployment of side curtain air bags, the metal plate could detach from the headliner and strike vehicle occupants, increasing the risk of injury. Land Rover will notify owners, and dealers will apply self-adhesive fleece tape to the metal plate and the driver and passenger sides of the headliner, free of charge. The recall is expected to begin January 17, 2020. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N412.

19V-840

Navistar, Inc. (Navistar) is recalling certain 2019-2020 International MV and HV, 2018-2020 Workstar, and 2018-2019 Durastar vehicles equipped with feature codes 12VXT and 12VXU. With the parking brake applied and the automatic transmission in the 'Drive' or 'Reverse' position, when the stationary PTO switch is engaged by the operator, the engine RPM will ramp up and may overcome the parking brake's ability to hold the vehicle. Unintended vehicle movement increases the risk of a crash. Navistar will notify owners, and dealers will update the Engine Control Module to enable the PTO neutral interlock, free of charge. The recall is expected to begin January 20, 2020. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 19518.

19V-841

Transportation Collaborative, Inc. (Transportation Collaborative) is recalling certain 2019-2020 TransTech CST and SST school buses equipped with Safe Fleet Prolo hatches. Due to a manufacturing issue, the roof hatch external handle may unexpectedly break under reasonable use. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If the roof hatch external handle breaks, in the event of an emergency, the hatch cannot be easily opened from outside the vehicle, increasing the risk of injury. Transportation Collaborative will notify owners, and Safe Fleet dealers will replace the outer handle, free of charge. Owners may contact Transportation Collaborative customer service at 1-845-988-0419.

19V-842

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain 2019-2020 FLHTCUTG, and FLRT Trike motorcycles. The Trike Traction Control System software may respond incorrectly to a faulty rear wheel speed signal by activating one of the rear brakes. Unintended activation of one rear brake could lead to an unexpected change in vehicle direction which may increase the risk of a crash. Harley-Davidson has notified owners, and dealers will update the traction control system software, free of charge. The recall began December 2, 2019. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0175.

19V-843

Forest River, Inc. (Forest River) is recalling certain 2018-2020 Cascade and Cherokee travel trailers. The Gross Vehicle Weight Rating (GVWR) of the vehicle exceeds the GVWR of the trailer hitch coupler, potentially resulting in the coupler failing and the trailer detaching. A trailer that detaches from the tow vehicle can increase the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin January 11, 2020. Owners may contact Forest River customer service at 1-260-499-2100 or 1-541-995-3447.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

Forest River's number for this recall is 64-1114.

19V-844

Jayco, Inc. (Jayco) is recalling certain 2018-2020 Melbourne Prestige motorhomes. The liquid propane (LP) tank hangers may be the wrong size and have insufficient welding, allowing the LP tank to dislodge. If the LP tank dislodges while the motorhome is in transit, it can increase the risk of a crash with the ignition of the propane. Jayco has notified owners, and dealers will install a support bracket on each side of the propane tank, free of charge. The recall began December 9, 2019. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9903501.

19V-845

Entegra Coach (Entegra) is recalling certain 2018-2020 Qwest motorhomes. The liquid propane (LP) tank hangers may be the wrong size and have insufficient welding, allowing the LP tank to dislodge. If the LP tank dislodges while the motorhome is in transit, it can increase the risk of a crash with the ignition of the propane. Entegra has notified owners, and dealers will install a support bracket on each side of the propane tank, free of charge. The recall began December 9, 2019. Owners may contact Entegra customer service at 1-800-517-9137. Entegra's number for this recall is 9903502.

19V-846

The Toro Company (Toro) is recalling certain 2017-2019 LC922 towable log splitters, models 22618 and 22618HD. The tow bolts that secure the log splitter connection to the tow vehicle may fail while the splitter is being moved. If the tow bolts break, the log splitter can tip over or detach from tow vehicle, increasing the risk of a crash. Toro has notified owners, and dealers will upgrade the bolts, free of charge. The recall began December 4, 2019. Owners may contact Toro customer service at 1-952-887-8973.

19V-847

Forest River, Inc. (Forest River) is recalling certain 2020 XLR Boost trailers, model XLT18RLE. An undersized axle, tire, and rim combination were installed, possibly resulting in the trailer being overloaded. An overloaded trailer can have axle or tire failure, increasing the risk of a crash. Forest River will notify owners, and dealers will install properly sized axles and tire/wheel combinations, free of charge. The recall is expected to begin January 6, 2020. Owners may contact Forest River customer service at 1-574-642-0432. Forest River's number for this recall is 79-1117.

19V-848

Volvo Car of USA LLC (Volvo) is recalling certain 2011-2017 S60, S60I, V60, S60CC and V60CC vehicles. A component within the door latches may break, making the doors difficult to latch and/or leading the driver or a passenger to believe a door is securely closed when, in fact, it is not. A door that is not securely latched could open while the vehicle is in motion, increasing the risk of injury to a vehicle occupant. Volvo will notify owners, and dealers will replace all four door latches, free of charge. The recall is expected to begin January 4, 2020. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R89978.

19V-849

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

BMW of North America, LLC (BMW) is recalling certain 2020 Z4 M40i, Z4 sDrive30i, 330i and 330i xDrive vehicles as well as 2020 Toyota Supra vehicles. The headlight control units may fail causing a loss of one or both of the headlights. Headlight failure can reduce the driver's visibility, increasing the risk of a crash. BMW will notify owners, and dealers will replace the headlight control units, free of charge. The recall is expected to begin January 17, 2020. Owners may contact BMW customer service at 1-800-525-7417 or Toyota customer service at 1-888-270-9371.

19V-850

BMW of North America, LLC (BMW) is recalling certain 1999 323i and 328i vehicles equipped with Non-Azide Driver air bag Inflators (NADI) manufactured by Takata at one specific inflator production facility. These inflators do not contain phase stabilized ammonium nitrate (PSAN) propellant. Due to a manufacturing issue, the NADI inflators may absorb moisture, causing the inflators to rupture or the air bag cushion to underinflate. In the event of a crash necessitating air bag deployment, an inflator rupture may result in metal fragments striking the driver or other occupants. An underinflated air bag may not properly protect the occupant. These scenarios increase the risk of serious injury or death. Dealers will inspect the driver air bag inflators and replace them, as necessary, free of charge. Owners may contact BMW customer service at 1-800-525-7417. Note: BMW recommends that owners do not continue to drive their vehicles.

19V-851

BMW of North America, LLC (BMW) is recalling certain 1999-2000 323i and 328i and 2000 323Ci and 328Ci vehicles equipped with Non-Azide Driver air bag Inflators (NADI) manufactured by Takata. These inflators do not contain phase stabilized ammonium nitrate (PSAN) propellant. Due to a manufacturing issue, the NADI inflators may absorb moisture, causing the inflators to rupture or the air bag cushion to underinflate. In the event of a crash necessitating air bag deployment, an inflator rupture may result in metal fragments striking the driver or other occupants. An underinflated air bag may not properly protect the occupant. These scenarios increase the risk of serious injury or death. BMW will mail interim notices informing owners of the safety risk on January 17, 2020. Owners will receive a second notice when the remedy becomes available. Dealers will inspect the driver air bag inflators and replace them, as necessary, free of charge. Owners may contact BMW customer service at 1-800-525-7417.

19V-852

BMW of North America, LLC (BMW) is recalling certain 1999-2001 323i, 325i, 328i and 330i and 2000-2001 323Ci, 325Ci, 328Ci, 330Ci, 323iT, and 325iT vehicles equipped with Non-Azide Driver air bag Inflators (NADI) manufactured by Takata. These vehicles may have received a replacement driver air bag as part of a vehicle repair. Due to a manufacturing issue, the replacement NADI inflator may absorb moisture, causing the inflator to rupture or the air bag cushion to underinflate. In the event of a crash necessitating air bag deployment, an inflator rupture may result in metal fragments striking the driver or other occupants. An underinflated air bag may not properly protect the occupant. These scenarios increase the risk of serious injury or death. BMW will mail interim notices informing owners of the safety risk on January 17, 2020. Owners will receive a second notice when the remedy becomes available. Dealers will inspect the driver air bag inflators and replace them, as

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2019**

Published December 17, 2019

necessary, free of charge. Owners may contact BMW customer service at 1-800-525-7417.

19V-853