

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

CHILD SEATS:

Baby Trend, Inc. (Baby Trend) is recalling certain Hybrid LX 3-in-1 Centennial booster seats, model number FB58181, manufactured on July 23, 2016, and Hybrid LX 3-in-1 Kiwi booster seats, model number FB48417, manufactured on July 14, 2016. The affected child seats have a center adjuster rivet that may pull through or break if the harness is being used with a child weighing more than 40 lbs. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." In the event of a crash, the child seat occupant is at an increased risk of injury. Baby Trend will notify owners and replace the child seat or provide a full refund. The manufacturer has not yet provided a notification schedule. Owners may contact Baby Trend customer service at 1-800-328-7363.

16C-008

Thorley Industries LLC d/b/a 4moms (4moms) is recalling certain 4moms Self Installing Rear-facing Infant Car Seats, model number 1032, manufactured July 1, 2016, to October 31, 2016. Due to a tight rivet, the affected car seats have a coupling hook that may not properly engage around the coupling pin, preventing the infant carrier portion from securely attaching to the seat base. If the infant carrier does not properly attach to the base, the carrier can detach in a crash, increasing the risk of injury. 4moms will notify owners and will replace the infant carrier portion, free of charge. The recall began on January 10, 2017. Owners may contact 4moms at 4moms.com/recalls or by calling 1-888-614-6667.

16C-009

EQUIPMENT:

Carrier Corporation (Carrier) is recalling certain starters used for starting Carrier Transicold trailer refrigeration units. The starters, Carrier Transicold or Performance Parts Group part number 25-39316-01, or Thermo Engine Supply part number R-25-39316-00, were manufactured April 1, 2009, to August 18, 2016. These starter assemblies may come apart during the start cycle, and the pieces may strike someone that is in close proximity to the starter. Broken parts of the starter may strike someone in close proximity, increasing their risk of injury. The remedy for this recall is still under development, and Carrier has placed a stop sale on the product. The recall began on January 24, 2017. Owners may contact Carrier customer service at 1-800-448-1661.

16E-087

Lippert Components, Inc. (LCI) is recalling certain 7000lb and 8000lb Brake Axles, part numbers V000394887 and V00034684, manufactured October 12, 2016, to October 13, 2016. The flange nuts may be loose on the backing plate for the roadside brake. Loose brake flange nuts may cause the brakes to lock up or not engage, increasing the risk of a crash. LCI has notified the affected purchasers, and dealers will inspect and repair or replace the brake axles, as necessary, free of charge. Owners may contact LCI customer service at 1-574-537-8900. LCI's number for this recall is LCI-45A1-2016.

16E-088

Hickory Springs Manufacturing Company (HSM) is recalling certain Conversion Van Seats manufactured June 14, 2016, to August 31, 2016. The affected seats are equipped with Atwood slide tracks that may not properly engage, allowing the seats to move in the event of a crash. As such, these vehicles fail to comply with the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems," and 210, "Seat Belt Assembly Anchorages." If the seat moves in the event of a crash, the seat occupant would be at an increased risk of injury. HSM will notify the purchasers of the seats and will offer replacements free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact HSM customer service at 1-800-438-5341.

16E-089

Tesla Motors, Inc. (Tesla) is recalling certain Universal Mobile Connector Adapters, models NEMA 14-30 (part number 1018243-00-A or 1018243-00-B), NEMA 10-30 (part number 1016174-00-B), and NEMA 6-50 (part number 1016021-00-B or 1016021-00-A). The affected adapters may have insufficient welds within the cable which can result in increased electrical resistance. Increased electrical resistance may cause overheating or arcing, increasing the risk of a fire. Tesla will notify owners and will provide them with a replacement adapter, free of charge. The recall began on January 12, 2017. Owners may contact Tesla customer service at 1-877-798-3752.

16E-091

Agility Fuel Systems (Agility) is recalling certain Roofmount CNG Fuel Systems, EZ Pack Heil Tailgate CNG Fuel Systems, Side-Mount CNG Fuel Systems, and Heil Roofmount CNG Fuel Systems manufactured January 1, 2013, to December 31, 2014. The affected fuel systems have flexible stainless steel, sleeved, high pressure hoses that may corrode from exposure to environmental conditions such as water mixed with road salt. Corrosion of the fuel hose may result in a compressed natural gas (CNG) leak, which in the presence of an ignition source, may increase the risk of a fire. Agility will notify owners, and dealers will replace the hose assemblies, free of charge. Owners may contact Agility customer service at 1-949-267-7745.

16E-092

MORryde International, Inc. (MORryde) is recalling certain Zero G Ramp Door hinges manufactured August 21, 2016, to December 12, 2016. The welds on the hinge pin and hinge plate may be insufficient, and as a result, the top of the door may swing down with more force than normal. If the door does not open as expected, there would be an increased risk of injury to those in the door's path. MORryde will notify the trailer manufacturers that purchased the affected hinges. The trailer manufacturers will notify owners and provide remedies, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MORryde customer service at 1-574-293-1581.

16E-093

Autoliv, Inc. (Autoliv) is recalling certain seatbelt retractors equipped with pretensioners, models R200, R200 Long and R200.1, manufactured April 10, 2016, to October 15, 2016. The Micro Gas Generator (MGG), a subcomponent part used on front, rear, and rear center seat belt retractors with pretensioners, may detach after the seatbelt retractor pretensioner is deployed. Although, the seat belt will operate as intended in the event of a crash, if the MGG detaches, it may be a projectile within the vehicle cabin, increasing the risk of injury. Autoliv has notified the vehicle manufacturers that purchased the MGGs and is working with them to determine into which vehicles the affected MGGs were installed into. As this work progresses, vehicle recalls may be announced by the impacted vehicle manufacturers. Owners may contact Autoliv at 1-248-276-0722.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

16E-094

Autoliv, Inc. (Autoliv) is recalling certain AI2 Seat Belt and Air Bag Initiators manufactured June 16, 2016, to November 4, 2016. The affected initiators could contain an improper generant mix ratio that may prevent the air bags and/or the seat belt pretensioners from deploying in the event of a crash. Air bags and/or seat belt pretensioners that fail to deploy in the event of a crash increase the risk of injury. Autoliv has notified the vehicle manufacturers that purchased the initiators and is working with them to determine into which vehicles the affected initiators were installed into. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. Owners may contact Autoliv at 1-248-276-0722

16E-095

MICO, Inc. (MICO) is recalling certain aftermarket Hydraulic Pressure Switch Kits, models 02-600-017 and 02-600-030, Brake Locks with Hydraulic Pressure Switches, models 02-620-009, 02-620-172, 02-620-173 and 03-620-173, and Hydraulic Pressure Switches, models 20-580-009I0425, 20-580-009I0600, 20-580-016D02580, 20-580-016I0250, 20-580-016I0500, 20-580-021I1000, 20-580-023D0750, 20-580-024I0250, 20-580-090I0650, 20-580-024I0450, and 20-580-024I0600. The affected switches may leak brake fluid, potentially causing a loss of braking power. A loss of braking power due to a fluid leak can increase the risk of a crash. MICO will notify the purchasers of the switch, and will either replace the pressure switch free of charge or offer a refund. The recall is expected to begin in January 2017. Owners may contact MICO customer service at 1-507-625-6426.

16E-096

TIRES:

None during December 2016.

VEHICLES:

Livin' Lite Recreational Vehicles (Livin' Lite) is recalling certain model year 2017 Camplight and Quick Silver RV Trailers, Toyhaulers, and Truck Campers manufactured May 19, 2016, to November 18, 2016. The affected vehicles have a rubber liquid propane (LP) gas line connecting the range hood and the pilot light, instead of a 12" hard pipe. A rubber LP gas line connected to the pilot light can get hot and melt, increasing the risk of a fire. Livin' Lite will notify owners, and dealers will install a 12" copper extension between the range hood and pilot light, free of charge. The recall began on January 9, 2017. Owners may contact Livin' Lite customer service at 1-866-272-5578.

16V-865

Forest River, Inc. (Forest River) is recalling certain model year 2017 Puma trailers, models PT38DBS and PT38RLQ, manufactured August 15, 2016, to November 15, 2016. The Federal placards on the affected vehicles have incorrect tire and rim information. The placard incorrectly states a combination of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

ST225/75R15/D tires needing 65 PSI and a rim designation of 15X6.0JJ, while the vehicle is actually equipped with ST235/80R/16E tires needing 80 PSI and a rim designation of 16X6.0JJ. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If referencing the information that is on Federal placard, the operator could under-inflate the tires causing a reduction of vehicle handling and increasing the risk of a crash. Forest River will notify owners, and dealers will replace the incorrect Federal placard with a correct one, free of charge. The recall began on January 4, 2017. Owners may contact Forest River customer service at 1-574-642-0606. Forest River's number for this recall is 420-11162016-0276.

16V-866

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2011-2012 Outlander Sport vehicles manufactured August 26, 2010, to June 1, 2012, and 2016 Outlander Sport vehicles manufactured January 11, 2016, to July 8, 2016. The lift gate support outer tube on the affected vehicles may have insufficient anti-corrosion treatment that can allow the outer tube to corrode due to salt and water penetration. If the outer tube corrodes, there may be a rapid loss of the gas used to provide lift assistance, causing the lift gate to fall suddenly, increasing the risk of injury. MMNA will notify owners, and dealers will replace the lift gate supports, free of charge. The recall began on January 20, 2017. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-16-011.

16V-867

General Motors LLC (GM) is recalling certain model year 2010-2014 Chevrolet Tahoe Police Pursuit vehicles manufactured August 24, 2009, to December 1, 2013. The affected vehicles, equipped with special equipment options for police or government service, may experience corrosion of the under-hood cooling fan assembly due to fluid intrusion, which may result in an electrical short circuit. A short circuit increases the risk of a fire. GM will notify owners, and dealers will replace the fan motor and shroud, extend the wiring and re-orient the fan motor to reduce the risk of corrosion, free of charge. Remedy parts are currently unavailable. Interim notices were mailed to owners, notifying them of the safety recall, on January 5, 2017. Owners will receive a second notice when remedy parts become available. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 16145.

16V-868

Thor Motor Coach (TMC) is recalling certain model year 2017 Quantum RQ29 motorhomes manufactured June 27, 2016, to September 29, 2016. The affected vehicles may be missing a mid-ship marker light. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Systems (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the mid-ship marker light is missing, other drivers can mistake the length of the vehicle, increasing the risk of a crash. TMC will notify owners, and dealers will install a mid-ship marker light if it is missing, free of charge. The recall began on January 25, 2017. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000124.

16V-869

General Motors LLC (GM) is recalling certain 2017 Malibu vehicles manufactured on November 10, 2016. The right-hand rear side air bag inflator manifold may have insufficient welds. Insufficient welds could cause the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

inflator to separate and propel air bag debris into the cabin during a crash. Also, the inflator could fail to inflate during a crash, increasing the risk of injury. GM will notify owners, and dealers will replace the rear side air bag modules, free of charge. The recall began on January 25, 2017. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 16146.

16V-870

PACCAR Incorporated (PACCAR) is recalling certain model year 2017 Peterbilt 325, 330, 337, 348, 365, 367, 386, 389, and 587 vehicles manufactured April 20, 2016, to June 13, 2016. The brake lights may not illuminate when the brakes are applied. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights do not illuminate when the brakes are applied, other drivers will be unaware the vehicle is stopping, which can increase the risk of a crash. PACCAR will notify owners, and dealers will inspect and replace any brake light switches with date code 08-01760, free of charge. The recall began on January 26, 2017. Owners may contact Peterbilt customer service at 1-940-591-4000. Paccar's number for this recall is 816-F.

16V-872

Entegra Coach (Entegra) is recalling certain 2017 Cornerstone vehicles manufactured October 26, 2015, to November 18, 2016 and built on a Spartan Motors chassis. The affected vehicles are equipped with a Wabco OnGuard Collision Mitigation System that may have been installed upside down reducing its functionality. Reduced collision mitigation functionality may increase the risk of a crash. Entegra will notify owners, and Spartan Motors dealers will correct the orientation of the radar and re-calibrate the system, free of charge. The recall began on January 26, 2017. Owners may contact Spartan customer service at 1-800-543-4277 or Entegra customer service at 1-800-517-9137. Entegra's number for this recall is 9903335.

16V-873

Ford Motor Company (Ford) is recalling certain 2017 Ford Fusion vehicles manufactured September 27, 2016, to September 28, 2016. The left rear seat backs pivot pins may have been improperly welded. During a crash, the improper welds may fail, allowing any stowed luggage to move into the passenger compartment, increasing the risk of injury. Ford will notify owners, and dealers will replace the left hand, second row seat back frame, free of charge. The recall began January 10, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S43.

16V-874

Ford Motor Company (Ford) is recalling certain model year 2013-2016 Ford Fusion vehicles manufactured November 2, 2012, to July 31, 2014, and 2013-2015 Lincoln MKZ vehicles manufactured November 14, 2012, to July 31, 2014. In the event of a crash, heat from the deployment of a seat belt pretensioner may cause a front seat belt anchor cable to fail. If the driver or front passenger seatbelt cables cannot properly restrain the front seat occupants, they would be at an increased risk of injury. Ford will notify owners, and dealers will apply a protective coating to the seat belt cable, free of charge. Remedy parts are currently unavailable. Owners will be notified of the safety issue beginning on January 20, 2017. Remedy parts are expected to be available by the second quarter of 2017, and at that time, owners will be mailed a second notice. Owners may contact Ford

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

customer service at 1-866-436-7332. Ford's number for this recall is 16S42.

16V-875

Indian Motorcycle Company (Indian) is recalling certain model year 2014-2017 Chief Classic, Chief Dark Horse, Vintage, Chieftan, Chieftan Dark Horse, Springfield and Roadmaster motorcycles manufactured April 15, 2013, to July 15, 2016. In the affected motorcycles, the fuel rail may contact other components and result in a fuel leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Indian will notify owners, and dealers will install a bracket that will limit movement of the fuel rail, free of charge. The recall began on December 12, 2016. Owners may contact Indian customer service at 1-877-204-3697. Indian's number for this recall is I-16-03.

16V-877

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2012-2016 DL650 motorcycles manufactured August 30, 2011, to October 12, 2015. In the affected motorcycles, the alternator stator may have insufficient heat resistance, resulting in a short circuit of the stator wires. A short circuit of the stator wires may prevent the battery from properly charging, causing an engine stall and increasing the risk of a crash. Suzuki will notify owners, and dealers will replace the stator, free of charge. The recall began on January 6, 2017. Owners may contact Suzuki customer service at 1-714-572-1490. Suzuki's number for this recall is 2A67.

16V-878

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain model year 2016-2017 Landmark 365 fifth wheel recreational trailers manufactured September 30, 2015, to October 24, 2016 and equipped with disc brakes. The spare steel wheel on the affected vehicles may not properly fit on the axle hub, resulting in the wheel rubbing on the brake line, causing it to wear. The brake line may be worn through causing a loss of braking or vehicle control, increasing the risk of a crash. Heartland will notify owners, and dealers will replace the steel spare wheel with an aluminum wheel, free of charge. The recall began on January 11, 2017. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99.01.30.

16V-879

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2008-2009 Sterling Bullet 4500 and 5500 cab chassis vehicles manufactured November 1, 2007, to November 7, 2008. The affected vehicles have a 220 amp alternator that may develop a short circuit. If the alternator develops a short circuit, there is an increased risk of a fire. DTNA will notify owners, and DTNA dealers will replace the alternator, free of charge. The recall is expected to begin February 3, 2017. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-729.

16V-880

Starcraft RV is recalling certain model year 2017 Comet, Satellite, Launch, and Autumn Ridge mini trailers manufactured June 21, 2016, to November 18, 2016 and equipped with the extreme package. The Federal labels on the affected vehicles may state incorrect tire and rim sizes. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If there is incorrect tire and rim information on the label, owners may replace the tires or rims with items not

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

specified for the unit, increasing the risk of a crash. Starcraft has notified owners and mailed corrected labels to the affected owners, free of charge. The recall began on December 22, 2016. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902339.

16V-882

Polaris Industries, Inc. (Polaris) is recalling certain 2016-2017 GEM E2, E4, E6, and ELXD electric vehicles manufactured May 29, 2015, to November 18, 2016. The drive mode switch can send an incorrect signal, causing the vehicle to go in the opposite direction than intended. If the operator intends to go forward, but the vehicle reverses instead, there would be an increased risk of a crash. Polaris will notify owners, and dealers will replace the drive switch, free of charge. The recall began on December 28, 2016. Owners may contact GEM Consumer Service Department at 1-855-743-3436. Polaris' number for this recall is L-16-01.

16V-884

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2015 918 Spyder vehicles manufactured November 6, 2013, to July 27, 2015. The affected vehicles have front lower control arms that may crack at the ball joint. A cracked lower control arm may affect vehicle handling, increasing the risk of a crash. Porsche will notify owners, and dealers will replace the lower control arms, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AG09.

16V-885

Corp. Micro Bird Inc. (Micro Bird) is recalling certain model year 2015-2016 T-Series school buses manufactured August 24, 2015, to November 30, 2016. The affected vehicles have a battery-powered wheelchair lift with an interlock that can be deactivated by the operator, allowing the vehicle to be driven with the lift door open or while the lift platform is deployed. Driving the bus with the lift platform deployed or with the door open can result in injury to those nearby or increase the risk of a crash. Micro Bird will notify owners, and will provide a field modification to remedy this recall, free of charge. The recall began on January 18, 2017. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 16-067-IUS.

16V-886

Smeal Fire Apparatus Co., Inc. (Smeal) is recalling certain model year 1997-2016 Rear Mount Aerial Platform Apparatus emergency vehicles manufactured January 1, 1997, to November 30, 2016. The affected vehicles are equipped with a movable ladder access guardrail that may bend or break under heavy loads. A guardrail that bends or breaks under load can increase the risk of injury. Smeal will notify owners, and dealers will add a support to the opposite side of the guardrail, free of charge. The recall began on January 11, 2017. Owners may contact Smeal customer service at 1-877-415-8628.

16V-887

Honda (American Honda Motor Co.) is recalling certain model year 2017 Ridgeline AWD vehicles manufactured April 1, 2016, to August 11, 2016. Water may enter the rear wiring harness through the connector located under the truck bed drain hole, possibly causing the connection terminals to corrode.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

Corrosion of the wiring harness can cause increased electrical resistance, unexpectedly activating the vehicle stability assist (VSA) system, increasing the risk of a crash. Honda will notify owners, and dealers will inspect the rear wiring harness and related components, replacing them as necessary, free of charge. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KD3.

16V-888

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2016-2017 Land Rover Discovery Sport vehicles manufactured May 30, 2016, to August 24, 2016, and 2016-2017 Range Rover Evoque vehicles manufactured June 7, 2016, to August 26, 2016. The affected vehicles have front lower control arm fasteners that may fail due to an assembly error, possibly resulting in separation of the steering knuckle. If the fasteners were to fail causing the knuckle to separate, vehicle handling may be affected, increasing the risk of a crash. Land Rover will notify owners, and dealers will replace the hardware that connects the front lower control arm to the knuckle, free of charge. The recall began on January 27, 2017. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is Q650/Q651.

16V-889

Forest River, Inc. (Forest River) is recalling certain model year 2016 Glaval Legacy transit buses manufactured April 5, 2016, to October 5, 2016. The brake transmission shift interlock feature may be inoperable making it possible to shift into a drive gear without first pressing the brake pedal. This condition can result in the vehicle moving unintentionally or rolling away, increasing the risk of injury or a crash. Forest River will notify owners. Allison Transmission Distributors and dealers will update the vehicle's software, free of charge. The recall is expected to begin February 1, 2017. Owners may contact Allison customer service at 1-800-252-5283, or Forest River customer service at 1-574-343-5167. Forest River's number for this recall is 35-12022016-0277.

16V-890

Ducati North America (Ducati) is recalling certain model year 2015-2016 Ducati Scrambler motorcycles manufactured February 17, 2015, to November 11, 2016. The affected vehicles have a side stand pivot nut that can detach, potentially causing the side stand position sensor to no longer function properly. If the side stand position sensor does not function properly, the engine may stall, or the motorcycle may be ridden while the stand is still down. Either scenario increases the risk of a crash. Ducati will notify owners, and dealers will replace the side stand pivot bolt, free of charge. The recall began on January 24, 2017. Owners may contact Ducati customer service at 1-800-231-6696. Ducati's number for this recall is SRV-RCL-16-004.

16V-891

Yamaha Motor Corporation, USA (Yamaha) is recalling certain model year 2015 XC155F SMAX scooters manufactured September 17, 2014, to October 27, 2015. The affected motorcycles may have an insufficiently clamped speed sensor lead wire, causing the wire to fatigue and break. If the speed sensor wire breaks, the speedometer will not work, increasing the risk of a crash. Yamaha will notify owners, and dealers will replace the speed sensor assembly, free of charge. The recall began on January 27, 2017. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990111.

16V-892

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016

Published February 1, 2017

Thor Motor Coach (TMC) is recalling certain model year 2016-2017 Outlaw motorhomes, models 37BG, 37LS, 37RB, 38RE and 38RF, manufactured January 13, 2016, to December 8, 2016. The affected vehicles have rear cargo door hinges with welds that may be inadequate for securing the hinge pin to the hinge plate. If the welds are insufficient, the hinge may fail and the door could open with more force than normal, increasing the risk of injury. TMC will notify owners, and dealers will inspect the hinge weld thickness, replacing the hinge as necessary, free of charge. The recall is expected to begin February 8, 2017. Owners may contact TMC customer service at 1-877-500-1020.

16V-893

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain model year 2017 B Touring Cruiser motorhomes, model 5210, manufactured May 16, 2016 to July 15, 2016. The Certification label on the affected vehicles may contain incorrect front and rear Gross Axle Weight Rating (GAWR) and Gross Vehicle Weight Rating (GVWR) information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Labels that contain incorrect weight information can lead to the vehicle being overloaded which can cause axle failure and increase the risk of a crash. Gulf Stream will notify owners will provide a corrected Certification label, free of charge. The recall began on January 4, 2017. Owners may contact Gulf Stream customer service at 1-800-289-8787.

16V-894

DRV Suites (DRV) is recalling certain model year 2017 Full House recreational trailers, models JX450, LX410, LX450 and LX455, manufactured August 29, 2016, to November 30, 2016. The affected vehicles have rear cargo door hinges with welds on the hinge pin and hinge plate that may be insufficient, and as a result, the top of the door may swing down with more force than normal. If the door does not open as expected, there would be an increased risk of injury to those in the door's path. DRV will notify owners, and dealers will inspect the weld thickness, and if necessary replace the hinge, free of charge. The recall began on January 11, 2017. Owners may contact DRV customer service at 1-260-562-3500. DRV's number for this recall is 99.02.07.

16V-896

Triple E Recreational Vehicles (Triple E) is recalling certain model year 2017 Serenity S24CB recreational vehicles manufactured June 1, 2016 through November 23, 2016. In the affected vehicles, the circuit wire leading from the coach's power system to the battery is incorrectly connected to a 150 amp fuse, however, the wire is only rated for a maximum load of 120 amps. An overloaded wire increases the risk of a fire. Triple E will notify owners, and dealers will correct the wires at the fuse holder, free of charge. The recall began on January 5, 2017. Owners may contact Triple E customer service at 1-877-992-9906. Triple E's number for this recall is CA #8495-1.

16V-897

KZRV, L.P. (KZRV) is recalling certain model year 2016-2017 Venom and Durango Gold toyhaulers and fifth wheel trailers manufactured January 11, 2016, to December 2, 2016. The affected vehicles have rear cargo door hinges with welds on the hinge pin and hinge plate that may be insufficient, and as a result, the top of the door may swing down with more force than normal. If the door does not open as expected, there would be an increased risk of injury to those in the door's path. KZRV will notify owners, and dealers will inspect the weld

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

thickness, and if necessary replace the rear door hinges, free of charge. The recall began on January 13, 2017. Owners may contact KZR customer service at 1-800-768-4016 extension 154 or 153.

16V-898

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2013-2015 SL550, 2013-2014 SL63 AMG, 2014-2016 E350, 2014 E350 Cabriolet, E350 Coupe, 2014-2015 S550, 2015 E350 Bluetec, 2015-2016 E400, 2016 E550 Coupe, and Maybach S600 vehicles manufactured August 23, 2012, to August 14, 2015. The affected vehicles use an electric power steering system that may have improperly soldered contacts inside the control unit, potentially resulting in the power steering system deactivating while driving. If the control unit pins lose connection, there would be a loss of electric power steering assist, increasing the risk of a crash. The increase in pin contact resistance can also increase the risk of a fire, even while the vehicle is parked and ignition is off. MBUSA will notify owners, and dealers will replace the electric power steering control unit, free of charge. The recall is expected to begin during February 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-899

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2015 GL350 4Matic Bluetec, GL450 4Matic, GL550 4Matic, ML250 Bluetec, ML350, ML350 4Matic, ML400 4Matic and 2015-2016 GL63 AMG 4Matic vehicles manufactured September 29, 2014 through March 27, 2015. The affected vehicles have axle bolts on the front and/or rear drive axle carriers that may not have been assembled correctly. As a result, the remaining bolts may fracture. If any of the remaining front or rear axle bolts fracture, the vehicle may be unstable, reducing the handling capability and increasing the risk of a crash. MBUSA will notify owners, and dealers will replace the axle carrier bolts, free of charge. The recall is expected to begin in February 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-900

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2014 CLA250 vehicles manufactured December 14, 2012, to April 24, 2013 equipped with gasoline engines. The affected vehicles have a fitting that connects the vacuum line to the brake booster which may break causing increased force to be needed to apply the brakes. If the vehicles unexpectedly need increased pressure on the brake pedal to apply the brakes, there would be an increased risk of a crash. MBUSA will notify owners, and dealers will replace the connector end fitting at the brake booster, free of charge. The recall is expected to begin in February 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-901

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016-2017 GL350 4Matic Bluetec, GL550 4Matic, GLE350 4Matic, GLE43 AMG Coupe, GLE450 4Matic, 2016 GLE300d 4Matic, GLE350, GLE350d 4Matic, GLE400 4Matic, GLE550e 4Matic, GLE63 AMG, GLE63 AMG 4Matic, GLE63S AMG 4Matic Coupe, and 2017 GLS63 AMG vehicles manufactured April 23, 2014, to May 10, 2016. The front passenger seat Occupant Classification System (OCS) calibration may be incorrect, and as a result, the system can incorrectly classify the occupant as a child seat, deactivating the front passenger air bag. If the front passenger air bag does not deploy as necessary in the event of a crash, the front passenger has an increased risk

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

of injury. MBUSA will notify owners, and dealers will update the OCS software, free of charge. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-903

Halcore Group, Inc. (Halcore) is recalling certain 2016 AEV Traumahawk ambulances manufactured March 20, 2016, to October 28, 2016. The affected vehicles are equipped with Stryker Medical Performance cot mounts that may not securely attach the cot into place. If the cot dislodges from its mount, serious injury may occur to the patient and/or to individuals within the ambulance body. All affected vehicles have been contacted by Stryker, received a remedy kit and the vehicles have been repaired, therefore an owner notification letter will not be issued for this campaign. Owners may contact AEV customer service at 1-800-374-9749.

16V-904

Jayco, Inc. (Jayco) is recalling certain model year 2016 Alante and Precept motorhomes manufactured August 10, 2015, to March 15, 2016. The wiring for the entrance steps may be incorrectly installed, and as a result, the steps may unexpectedly retract. If the steps retract on their own, a person trying to enter or exit the motorhome may fall, increasing their risk of injury. Jayco will notify owners, and dealers will inspect the entrance step wiring, correcting the wiring as necessary, free of charge. The recall began on January 18, 2017. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9903340.

16V-905

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2016 Avalon, and 2017 Camry vehicles manufactured August 3, 2016, to September 12, 2016. The front passenger knee air bag module may have been attached to the lower instrument panel with incorrect fasteners. If the air bag was installed with incorrect fasteners, the fasteners may become loose over time, affecting the air bag deployment and increasing the risk of injury. Toyota will notify owners, and dealers will inspect the fasteners, and if necessary, replace the instrument panel brace and body bracket and reattach the air bag assembly, free of charge. The recall is expected to begin in February 2017. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is G05.

16V-906

Chrysler (FCA US LLC) is recalling certain model year 2016 Dodge Journey, Jeep Compass, and Jeep Patriot vehicles manufactured May 9, 2016, to July 15, 2016. The crankshaft or camshaft sensor may only work intermittently, causing the engine to stall. If the engine stalls, there is an increased the risk of a crash. Chrysler will notify owners, and dealers will replace the crankshaft or camshaft sensor, free of charge. The recall is expected to begin January 27, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S89.

16V-907

Keystone RV Company (Keystone) is recalling certain model year 2017 Keystone Carbon and Raptor fifth wheel recreational trailers, and 2016-2017 Fuzion and Dutchmen Voltage fifth wheel recreational trailers. The affected vehicles have rear cargo door hinges with welds on the hinge pin and hinge plate that may be insufficient, and as a result, the top of the door may swing down with more force than normal. If the door does not open as

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

expected, there would be an increased risk of injury to those in the door's path. Keystone will notify owners, and dealers will replace the ramp door hinge, free of charge. The recall began on January 13, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 16-274.

16V-908

C & M Trailers Inc. (C&M) is recalling certain model year 2015-2016 76x16 Utility trailers manufactured April 1, 2015, to December 4, 2016. The tire placard on the affected vehicles may not have the tire and rim size information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification", and to Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Missing information on the tire placard may result in the tires being replaced with ones of an incorrect size, increasing the risk of a crash. C&M will notify owners and will provide a corrected tire placard, free of charge. The recall is expected to begin in January 2017. Owners may contact C&M customer service at 1-972-875-4258.

16V-909

Chrysler (FCA US LLC) is recalling certain model year 2017 RAM ProMaster vehicles manufactured October 1, 2016, to December 7, 2016. The seat mounted side air bag inflator initiator may fail to ignite during a crash. If the air bag inflator initiator fails to ignite, the air bag will not deploy, increasing the risk of injury. Chrysler will notify owners, and dealers will replace the seat mounted side air bags, free of charge. The recall is expected to begin January 28, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S96.

16V-910

Nissan North America, Inc. (Nissan) is recalling certain model year 2013-2015 Altima vehicles manufactured January 3, 2013, to July 29, 2013, 2015-2016 Rogue vehicles manufactured October 14, 2014, to August 12, 2016, and 2016 Maxima vehicles manufactured June 4, 2015, to August 19, 2015. An incorrect Occupant Classification System (OCS) Electronic Control Unit (ECU) may have been installed in the front passenger seat. The incorrect ECU and seat combination may misclassify the front passenger seat occupant. If the front passenger seat occupant is misclassified, the air bag may deploy incorrectly in the event of a crash, increasing the risk of injury. Nissan will notify owners, and dealers will replace the ECU and update the OCS software free of charge. The recall is expected to begin by February 12, 2017. Owners may contact Nissan customer service at 1-800-647-7261.

16V-911

C&M Trailers Inc. (C&M) is recalling certain model year 2016 Boat Trailers, Jet Ski Trailers and 5x10 Utility Trailers manufactured June 1, 2016, to December 1, 2016. The affected trailers may be missing front reflex reflectors. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Missing reflex reflectors may make the trailer more difficult to be seen by other drivers, increasing the risk of a crash. C&M will notify owners and will send them the missing reflex reflectors to install, free of charge. The recall is expected to begin in January 2017. Owners may contact C&M customer service at 1-972-875-4528.

16V-912

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2009-2010 Volkswagen Jetta A5 Sedan, 2009 Volkswagen Jetta SportWagen, Eos, GTI, Rabbit and Audi A3 vehicles, and 2010 Volkswagen Golf A6 vehicles. The Antilock Brake System (ABS) control unit may fail during ABS or Electronic Stability Control (ESC) activation, possibly causing a loss of vehicle control. A loss of vehicle control can increase the risk of a crash. Volkswagen will notify owners, and dealers will update the ABS control module software to improve the module's self-testing abilities. Any module that fails the new diagnostic test will be replaced. These repairs will be made free of charge. The manufacturer has not yet provide a notification schedule. Owners may contact Volkswagen customer service at 1-800-893-5298.

16V-913

BMW of North America, LLC (BMW) is recalling certain model year 2017 BMW 640i, 640i xDrive, 650i, 650i xDrive, M6, 535i, 535i xDrive, 430i, 430i xDrive, 440i, 440i xDrive, M4, X1 sDrive28i, X1 xDrive28i, i3, i8, Rolls-Royce Dawn, Mini Clubman Cooper, Clubman Cooper S, Cooper All4, Cooper S All4, Mini 4-Door Cooper, Cooper S, Mini 2-Door Cooper, Cooper S, John Cooper Works and 2016 BMW 528i, 528i xDrive, 535i, 535i xDrive, 550i, 550i xDrive, M5 and 535d vehicles. The affected vehicles have seat-mounted side air bag inflator initiators that may fail to ignite during a crash. If the air bag inflator initiator fails to ignite, the seat-mounted air bag will not deploy, increasing the risk of injury. BMW will notify owners, and dealers will replace the air bag modules, free of charge. The recall is expected to begin February 6, 2017. Owners may contact BMW customer service at 1-800-525-7417.

16V-914

Bluecar SAS (Bluecar) is recalling certain 2016 Bluecar vehicles manufactured April 24, 2015, to April 19, 2016. In heavy rain or snow, water may leak into the high voltage connector between the battery and the engine possibly resulting in the engine shutting down. An uncontrolled engine shutdown may increase the risk of a crash. Bluecar has already notified owners, and technicians have applied grease on both ends of the connector, free of charge. The recall has already been completed. Owners may contact Bluecar customer service at 1-972 757-7251.

16V-915

Corp. Micro Bird Inc. (Micro Bird) is recalling certain model year 2015-2017 T-Series school buses manufactured October 1, 2014, to December 15, 2016 and built on a Ford chassis. In the event of a crash, the tension placed onto the seat belts may cause the floor at the seat mount to raise and deform. If the floor at the seat mount moves, the seat occupants are at an increased risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 16-068-RUS.

16V-916

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

Corp. Micro Bird Inc. (Micro Bird) is recalling certain model year 2015-2017 T-Series commercial buses manufactured October 1, 2014, to December 15, 2016 and built on Ford chassis. In the event of a crash, the tension placed onto the seat belts may cause the floor at the seat mount to raise and deform. If the floor at the seat mount moves, the seats would move, putting the seat occupants at an increased risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 16-068-RUC.

16V-917

Volvo Car USA LLC (Volvo) is recalling certain model year 2017 S60 and S60 Cross Country, V60 and V60 Cross Country, and XC60 vehicles manufactured August 16, 2016, through October 21, 2016. The affected vehicles have driver and front passenger seat side mounted side air bags (SAB) with inflator initiators that may fail to ignite during a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection" and number 214, "Side Impact Protection." If the air bag inflator initiator fails to ignite, the air bag will not deploy, increasing the risk of injury. Volvo will notify owners, and dealers will inspect and, if necessary, replace the front seat side air bags, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R89712.

16V-918

BMW of North America, LLC (BMW) is recalling certain model year 2016 X5 xDrive40e vehicles manufactured July 29, 2015, to September 9, 2015. The affected vehicles have a Digital Motor Electronic (DME) control unit that may have a loose electrical ground cable, possibly causing an under-voltage condition which would result in the transmission shifting to neutral. If the vehicle unexpectedly shifts to neutral, there would be an increased risk of a crash. BMW will notify owners, and dealers will tighten the ground cable, free of charge. The recall is expected to begin February 6, 2017. Owners may contact BMW customer service at 1-800-525-7417.

16V-919

Toyota Motor Company (Toyota) is recalling certain model year 2017 Toyota 86 vehicles manufactured July 1, 2016 through August 11, 2016 equipped with an automatic transmission and ignition key. Vehicles with a push-to-start button or manual transmission are not affected. In the affected vehicles, it may be possible to remove the ignition key without the transmission being in the "Park" position. As such, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard number 114, "Theft Protection and Rollaway Prevention." If the key can be removed from the ignition when the transmission is not in the "Park" position, the vehicle could roll away increasing the risk of a crash and occupant or pedestrian injuries. Toyota will notify owners, and dealers will inspect the ignition key/transmission interlock wiring connections, correcting them as necessary, free of charge. The recall is expected to begin in February 2017. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is G0E.

16V-920

General Motors LLC (GM) is recalling certain 2016 Buick Envision vehicles manufactured January 19, 2016, to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

March 18, 2016. The the master cylinder brake lines may crack and leak brake fluid. If there is a loss of brake fluid, braking performance may be reduced or lost, increasing the risk of a crash. GM will notify owners, and dealers will replace the master cylinder brake lines, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 16169.

16V-922

Pierce Manufacturing (Pierce) is recalling certain model year 2015-2016 Dash emergency vehicles manufactured October 17, 2014, to September 30, 2016 and equipped with Cummins ISL engines. The affected vehicles have a starter motor that may be damaged from interference with to an incorrect cab lift pump bracket that was installed. The interference may result in possible starter motor failure or an electrical short, increasing the risk of a fire. Pierce will notify owners, and dealers will inspect the vehicles, replacing the bracket and starter motor, as necessary, free of charge. The recall began on January 11, 2017. Owners may contact Pierce customer service at 1-414-832-3000. Pierce's number for this recall is 74B279.

16V-923

C&M Trailers Inc. (C&M) is recalling certain 2016 5x10 Cargo Trailers manufactured July 1, 2016, to December 1, 2016. The affected trailers may be missing the required license plate illumination. As such, these vehicles fail to comply with the requirement of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." A lack of trailer lighting may make it difficult for other drivers to see the trailer, increasing the risk of a crash. C&M will notify owners, and dealers correct the lights and install a new license plate cover, free of charge. Owners may contact C&M customer service at 1-972-875-4528.

16V-924

Ford Motor Company (Ford) is recalling certain model year 2016 Ford Taurus, 2016-2017 Ford Flex, Lincoln MKT, 2017 Ford Explorer and Ford Explorer Police Interceptor Utility vehicles equipped with 3.5L GTDI engines. Improperly brazed turbocharger oil supply tubes may leak oil on engine components. An oil leak, in the presence of an ignition source, increases the risk of a fire. Ford will notify owners, and dealers will inspect, and if necessary, replace the turbocharger oil supply tubes, free of charge. The recall is expected to begin during 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S46.

16V-925

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2009-2016 Predator SS Aerial vehicles manufactured June 20, 2008, to May 23, 2016, and 2009-2011 Predator Aerial vehicles manufactured March 6, 2009, to January 14, 2011. The affected vehicles have tandem rear axles with S-cam brakes that may engage without the brake pedal being pressed. If the brakes engage, a rear wheel may lock up increasing the risk of a crash. Additionally, the excessive heat caused may increase the risk of a fire. KME will notify owners, and dealers will inspect and tighten the S-cam bracket hardware, as necessary, free of charge. The recall is expected to begin February 1, 2017. Owners may contact KME customer service at 1-800-235-3926.

16V-926

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

Volvo Trucks North America (Volvo) is recalling certain 2017 Volvo VHD, VNL, and VNM trucks manufactured February 19, 2016, to June 21, 2016. The affected vehicles were built with front wheel hubs that cannot support the gross axle weight rating of the front axle. Overloaded front wheel hubs can result in premature failure of the hubs, bearings, and the related components, which can cause the front hub assembly to separate from the front axle. Because of this, the driver may lose control of the vehicle or parts may be dropped on the road, increasing the risk of a crash. Volvo will notify owners, and dealers will replace the hub assemblies, free of charge. The recall is expected to begin February 17, 2017. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1607.

16V-927

Volvo Trucks North America (Volvo) is recalling certain model year 2013-2017 VNL and VNM trucks and certain model year 2017 VNX trucks. In the affected vehicles, incorrect software for controlling the electronic air dryer may result in oil and water contaminating the brake system. If the brake system becomes contaminated, braking performance could be affected, increasing the risk of a crash. Volvo will notify owners, and dealers will reprogram the vehicle control module and replace the air dryer filter, free of charge. The recall is expected to begin February 17, 2017. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1608.

16V-928

Mack Trucks, Inc. (Mack) is recalling certain model year 2012, 2014-2015 and 2017 Granite (GU), 2012-2017 Pinnacle (CHU, CXU), and 2013-2015 and 2017 Titan (TD) trucks manufactured January 7, 2011, to September 29, 2016. The affected vehicles were built with front wheel hubs that cannot support the gross axle weight rating of the front axle. Overloaded front wheel hubs can result in premature failure of the hubs, bearings, and the related components, which can cause the front hub assembly to separate from the front axle. Because of this, the driver may lose control of the vehicle or parts may be dropped on the road, increasing the risk of a crash. Mack will notify owners, and dealers will replace the hub assemblies, free of charge. The recall is expected to begin February 17, 2017. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0406.

16V-929

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2011-2017 Predator Aerial and Predator Panther Aerial, 2014 Predator TDA, 2014-2017 Predator SS TDA, and 2012-2017 Predator SS Aerial fire trucks. In the affected vehicles, water may leak into the ladder position sensor allowing the ladder make contact with the vehicle. If the ladder contacts the truck there may be an increased risk of injury. KME will notify owners, and dealers will inspect the ladder position sensor mount and bearing system, replacing them as needed, free of charge. The recall is expected to begin on February 8, 2017. Owners may contact KME customer service at 1-800-235-3926.

16V-930

Gillig LLC (Gillig) is recalling certain model year 2015-2016 Low Floor compressed natural gas (CNG) transit buses manufactured September 1, 2015, to December 5, 2016, equipped with Amerex SafetyNet fire suppression system panel/controller units. These buses have gas detection electronics that may be disabled

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

without providing the operator with a warning of a system malfunction. Affected display panel/controller units were also provided as replacement parts for warranty claims, part numbers 16389, 24109, 24918, 24926 and 24927. If not corrected, the fire suppression systems on certain CNG-powered buses may fail to indicate the presence of a natural gas (methane) leak. In such cases, the driver will not receive a fault code indicating that the Gas Detection electronics have been disabled. This may increase the risk of asphyxiation, fire, or explosion. Gillig will notify owners, and Amerex representatives will replace the Operator Display Panel/Controllers, free of charge. The recall began January 20, 2017. Owners may contact Gillig customer service at 1-800-735-1500.

16V-931

Honda (American Honda Motor Co.) is recalling certain model year 2016 Odyssey vehicles manufactured September 23, 2016, to October 24, 2016. The affected vehicles have a second row center seat with a horizontal adjuster bar that may stick in the unlocked position, allowing the seat to unexpectedly slide. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seat Systems." An unlocked second row center seat may increase the risk of injury to the seat occupant in the event of a crash. Honda will notify owners, and dealers will inspect the slide function and replace the horizontal position adjustment bar, as necessary, free of charge. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KD4.

16V-932

Honda (American Honda Motor Co.) is recalling certain model year 2011-2016 Odyssey vehicles manufactured August 17, 2010, to October 1, 2015. The affected vehicles have second row outboard seats that have a release lever that allows the seats to move for easier access to the third row of seats. This release lever may remain in the unlocked position allowing the seats to move unexpectedly. An unlocked second row outboard seat increases the risk of injury to the seat occupant during a crash. Honda will notify owners, and dealers will install an additional bracket and spring to both second row outboard seats, free of charge. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KD5.

16V-933

HME, Inc. (HME) is recalling certain model year 2015-2016 Type-6 Wildland trucks manufactured January 2, 2015, to December 1, 2016. The Certification label on the affected vehicles may incorrectly list the Gross Vehicle Weight Rating (GVWR) as 15,876 kilograms instead of the correct GVWR of 8,845 kg. (The Gross Vehicle Weight Rating of 19,500 lbs is listed correctly on the label.) As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If there is an incorrect weight rating on the label, the operator may overload the vehicle, possibly resulting in a loss of vehicle control and increasing the risk of a crash. HME will mail a corrected certification label to owners free of charge. Owners may contact HME customer service at 1-616-534-1463.

16V-934

Daimler Vans USA, LLC (DVUSA) is recalling certain model year 2017 Mercedes-Benz Metris Vans manufactured September 9, 2016, to September 28, 2016. The affected vehicles have a passenger air bag that may have been manufactured with an incorrect Tether Activation Unit (TAU). As a result, in the event of a crash necessitating deployment of the passenger frontal air bag, the air bag may not vent properly. An improperly

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

vented air bag may not protect the front passenger as expected, increasing the risk of injury. DVUSA will notify owners, and authorized Mercedes-Benz Sprinter dealers will replace the front passenger air bag, free of charge. The recall is expected to begin February 8, 2017. Owners may contact DVUSA customer service at 1-877-762-8267.

16V-935

Maserati North America, Inc. (Maserati) is recalling certain 2017 Levante S vehicles. The engine software may cause the transmission to shift to neutral, or the engine to shut down, when the vehicle speed is approximately two miles per hour. If the transmission unexpectedly shifts to neutral, or the engine shuts down, there is an increased risk of a crash. Maserati will notify owners, and dealers will update the engine control software, free of charge. The recall began on January 6, 2017. Owners may contact Maserati customer service at 1-201-816-2638. Maserati's number for this recall is 338.

16V-936

Toyota Motor Engineering & Manufacturing (Toyota) is recalling one 2016 Toyota 4Runner vehicle manufactured November 1, 2016 and one 2017 Lexus GX460 vehicle manufactured November 16, 2016. The affected vehicles are equipped with Takata PSPI-LD front passenger air bag inflators that may have been manufactured without ignition booster tablets. As a result, in the event of a crash, the air bag may not fully inflate during deployment of the primary stage. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." The improper inflation of the passenger air bag may increase the risk of injury in the event of a crash. Toyota dealers have replaced the passenger side air bag modules, free of charge. Toyota notified the affected dealers on December 15, 2016. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is G06, GLR.

16V-937

Navistar, Inc. (Navistar) is recalling certain 2017 International ProStar, LoneStar, 9900i, and TranStar trucks. The affected vehicles have a metallic battery cover latch that may unlatch and contact the battery jump start stud, causing an electrical short to ground if the jump start stud is not covered. An electrical short to ground increases the risk of a fire. Navistar will notify owners, and dealers will install a latch stop to prevent the latch from rotating to the unlatched position, free of charge. The recall is expected to begin February 17, 2017. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 16513.

16V-938

Nissan North America, Inc. (Nissan) is recalling certain 2017 Infiniti QX30 vehicles manufactured August 11, 2016, to September 27, 2016. The affected vehicles have a passenger air bag inflator initiator that may fail to ignite during a crash, preventing the air bag from deploying. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." A passenger air bag that fails to deploy in the event of a crash can increase the risk of injury. Nissan will notify owners, and dealers will replace the passenger air bag assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

16V-939

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2017 Jaguar XE vehicles manufactured July 12, 2016, to December 2, 2016, and Jaguar F-Type vehicles manufactured July 14, 2016, to December 16, 2016. The affected vehicles have front seat seatbelt pretensioners that may not function properly in the event of a crash. If the front seat seatbelt pretensioners do not function properly, the seat occupants may not be adequately restrained in the event of a crash, increasing the risk of injury. Jaguar will notify owners, and dealers will inspect the front seat belt assemblies, replacing them as necessary, free of charge. The recall is expected to begin February 20, 2017. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J081.

16V-940

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2016 Land Rover Range Rover and Range Rover Sport vehicles and 2017 Range Rover Evoque vehicles. The affected vehicles have a front passenger air bag inflator initiator that may fail to ignite during a crash, preventing the air bag from deploying. In the event of a crash of sufficient severity, the front passenger air bag may not deploy as required, increasing the risk of injury. Land Rover will notify owners, and dealers will replace the front passenger air bag, free of charge. The recall is expected to begin February 20, 2017. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P094.

16V-941

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2017 Land Rover Discovery Sport vehicles and 2016-2017 Land Rover Range Rover and Range Rover Sport vehicles. The affected vehicles have seatbelt pretensioners that may not function properly in the event of a crash. If the front seat seatbelt pretensioners do not function properly, the seat occupants may not be adequately restrained in the event of a crash, increasing the risk of injury. Land Rover will notify owners, and dealers will inspect the front seat belt assemblies, replacing them as necessary, free of charge. The recall is expected to begin February 20, 2017. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P095.

16V-942

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2016-2017 Jaguar XJ vehicles manufactured September 12, 2016, to October 26, 2016. The affected vehicles have a front passenger air bag inflator initiator that may fail to ignite during a crash, preventing the air bag from deploying. In the event of a crash of sufficient severity, the front passenger air bag may not deploy as required, increasing the risk of injury. Jaguar will notify owners, and dealers will replace the front passenger air bag, free of charge. The recall is expected to begin February 20, 2017. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J080.

16V-943

Timberland Inc. DBA Glacier (Glacier) is recalling certain model year 2016 Glacier 17 RV Explorer recreational trailers, models A612, A614 and A165, manufactured February 1, 2016, to November 1, 2016. In the affected vehicles, the drop axle pivot pin retainer bolt may be too short for the locking nut to fully engage. If the bolt separates from the lock nut, the wheel assembly may detach from the chassis, increasing the risk of a crash.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

Glacier will notify owners, and representatives of the Ickler Company, the chassis manufacturer, will travel to the dealer's or customer's location to fix the issue, free of charge. The recall began on January 26, 2017. Owners may contact Glacier customer service at 1-218-454-1078 or the Ickler Company at 1-320-251-8282.

16V-944

Ford Motor Company (Ford) is recalling certain 2017 Ford F-250 and F-350 Super Duty trucks manufactured August 10, 2016, to September 17, 2016. The frame reinforcement bracket may not have been attached to the front fuel tank strap, allowing the fuel tank strap to separate from the frame. A fuel tank strap that separates and allows the fuel tank to contact the ground may cause a fuel leak, increasing the risk of a fire. Ford will notify owners, and dealers will inspect and, if necessary, install the reinforcement bracket, free of charge. The recall is expected to begin February 6, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S45.

16V-945

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2017 718 Boxster, 718 Boxster S, 718 Cayman, 718 Cayman S, 911 Carrera, 911 Carrera S, 911 Carrera S Cabriolet, 911 Carrera 4S, 911 Turbo, 911 Turbo S, 911 Carrera 4S Cabriolet, and 911 Turbo Cabriolet vehicles. The seat mounted side air bag inflator initiator may fail to ignite during a crash. If the air bag inflator initiator fails to ignite, the side air bag will not deploy, increasing the risk of injury in the event of a crash. Porsche will notify owners, and dealers will replace the affected air bag modules, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AG10.

16V-946

Chrysler (FCA US LLC) is recalling certain model year 2009 Dodge Durango and Chrysler Aspen vehicles manufactured January 17, 2007, to December 18, 2008, and 2010 RAM 3500 cab chassis manufactured September 25, 2009, to February 1, 2010. The affected vehicles are equipped with a dual-stage driver frontal air bag that may be susceptible to moisture intrusion which, over time, could cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. Chrysler has notified owners, and dealers will replace the driver's frontal air bag inflator, free of charge. The recall began January 11, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S92. Note: This recall covers vehicles that were accidentally excluded from recall 15V-313.

16V-947

BMW North America, LLC (BMW) is recalling certain model year 2016-2017 S 1000 RR motorcycles manufactured June 8, 2016, to November 16, 2016, and 2017 S 1000 R motorcycles manufactured on October 12, 2016. One of the bolts on the rear suspension deflection lever may loosen and adversely affect the handling of the motorcycle. If the bolt loosens and affects the motorcycle's handling, there may be an increased risk of a crash. BMW will notify owners, and dealers will replace the bolts and tighten them to the proper specifications, free of charge. The recall is expected to begin February 10, 2017. Owners may contact BMW customer service at 1-800-525-7417.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

16V-948

DRV Suites (DRV) is recalling certain model year 2016-2017 Elite Suites and Mobile Suites fifth wheel recreational trailers manufactured January 29, 2016, to November 14, 2016. The brake caliper bolts may loosen, causing a loss of braking capability. A loss of braking capability can increase the risk of a crash. DRV has notified owners, and dealers will replace the caliper bolts and sleeves using a thread adhesive, free of charge. The recall began on January 11, 2017. Owners may contact DRV customer service at 1-260-562-3500. DRV's number for this recall is 99.02.08.

16V-949

ARBOC Specialty Vehicles, LLC (ARBOC) is recalling certain model year 2015-2016 Spirit of Liberty transit buses manufactured November 7, 2014, to July 29, 2016. On the affected vehicles, the parking brake can engage if the entry door is opened at any speed. If the parking brake engages unexpectedly while the vehicle is in motion, it can increase the risk of a crash. ARBOC has notified owners, and dealers will update the vehicle's programming, free of charge. The recall began on January 13, 2017. Owners may contact ARBOC customer service at 1-866-953-5555.

16V-950

Kalmar Solutions, LLC (Kalmar) is recalling certain model year 2014-2016 Ottawa T2 vehicles manufactured August 16, 2014, to November 17, 2016. The affected vehicles are equipped with a chassis power board that is not protected from moisture. Exposure to moisture may result in an electrical short which can increase the risk of a fire. Kalmar will notify owners, and dealers will replace the chassis power distribution center with sealed modules, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Kalmar customer service at 1-785-229-6341. Note: The remedy for this recall will also remedy the safety issue addressed by recall 16V-073, therefore that recall will be superseded by this one. Any vehicle that was remedied under that campaign still needs this recall remedy.

16V-951

Southwest Products (Southwest) is recalling certain model year 2013-2016 QP25, QP35, and QP45/50 trailer-mounted generator sets manufactured January 8, 2013, to November 30, 2016. The trailer tongue portion of the trailer may separate from the rest of the trailer body carrying the generator. If the generator section of the trailer detaches from the tow vehicle, it could be a road hazard, increasing the risk of a crash. The remedy for this recall is still under development. Owners may contact Southwest customer service at 1-602-269-3581.

16V-952

Chrysler (FCA US LLC) is recalling one model year 2017 RAM ProMaster City vehicle manufactured on November 5, 2016. This vehicle has side curtain air bags that may not inflate properly in the event of a crash. If the side curtain air bags do not inflate properly, the vehicle occupants are at an increased risk of injury in the event of a crash. Chrysler has notified the owner, and a dealer inspected the side curtain air bags, free of charge. The recall began January 17, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S95.

16V-953

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2016**

Published February 1, 2017

Keystone RV Company (Keystone) is recalling certain model year 2016-2017 Alpine fifth-wheel recreational trailers manufactured August 10, 2015, to December 1, 2016, and Avalanche fifth-wheel recreational trailers manufactured September 11, 2015, to December 1, 2016. The Federal Placard on the affected vehicles may have incorrect spare tire load range information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the operator inflates the spare tire using the information on the Federal Certification label information, the tire may be overinflated, increasing the risk of tire failure.

Keystone has notified owners, and dealers will replace the Federal Placard, free of charge. The recall began on January 17, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-275.

16V-954

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2017 Audi A7, A4, A6, Volkswagen Golf and 2016 Volkswagen e-Golf vehicles for driver frontal air bags, passenger frontal air bags or head air bags that may not deploy properly. Additionally, certain 2017 Audi Q7, A4 Sedan, A4 Allroad, and 2018 Audi Q5 vehicles are being recalled because the seat belt pretensioners may not activate properly. In the event of a crash, if the air bags and/or the seat belt pretensioners do not inflate or function properly, the vehicle occupants have an increased risk of injury. Volkswagen and Audi will notify owners, and dealers will replace the affected air bags and seat belt pretensioners, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volkswagen customer service at 1-800-893-5298 or Audi customer service at 1-800-253-2834.

16V-955

Hyundai Motor Company (Hyundai) is recalling certain model year 2017 Hyundai Elantra vehicles manufactured April 15, 2016, to September 13, 2016, and Sonata vehicles manufactured May 27, 2016 to September 16, 2016. In these vehicles, the end seal for the driver's frontal air bag inflator may not have been properly installed, possibly resulting in reduced inflation of the frontal air bag in the event of a crash. In the event of a crash, an air bag that does not inflate fully increases the risk of injury. Hyundai will notify owners, and dealers will replace the driver's frontal air bag module, free of charge. The recall is expected to begin February 13, 2017. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 156.

16V-956

Forest River, Inc. (Forest River) is recalling certain model year 2017 XLR Toyhauler and Prime Time Spartan recreational fifth-wheel vehicles manufactured August 21, 2016, to December 12, 2016. The affected vehicles have rear cargo door hinges with welds on the hinge pin and hinge plate that may be insufficient, and as a result, the top of the door may swing down with more force than normal. The hinge pin may separate from the hinge plate, leading the side of the door to shift. This condition could cause the springs to lift off the hinged end of the door and could cause the top of the door to swing down with more force than normal, increasing the risk of personal injury. Forest River will notify owners, and dealers will replace the ramp door hinge, free of charge. The recall is expected to begin February 27, 2017. For more information, XLR owners may call 1-574-642-0432 and Spartan owners may call 1-574-862-1025. Forest River's number for this recall is 51-12312016-0310.

16V-957