

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

CHILD SEATS:

None during December 2017.

EQUIPMENT:

Akron Brass Company (Akron Brass) is recalling certain Ultrajet Style 1820 fire hose nozzles. These nozzles may fracture at the connection point between the nozzle body and the shutoff body, potentially causing the water flow pattern to change or the firefighter to lose control of the hose. If the water pattern changes or the firefighter loses control of the hose, the fire fighting efforts may be hindered, increasing the risk of injury. Akron Brass will notify owners, instructing them to return the affected nozzles to be retrofitted with a new component and O-rings or replace the old nozzle a new nozzle, free of charge. The recall is expected to begin January 2018. Owners may contact Akron Brass Company customer service at 1-800-228-1161 or by email at akrontech@idexcorp.com.

17E-072

AP Racing is recalling certain 16.9oz bottles of Super 600 Brake Fluid, part number CP5600. The label on this brake fluid is missing the required DOT information that the brake fluid is for Track/Race applications and not for use in vehicles on highways, nor does it state that it is DOT 4 brake fluid. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 116, "Motor Vehicle Brake Fluids." Without the correct label information, the fluid may be added to a brake system that requires a different type of brake fluid. The fluid incompatibility may reduce braking performance, increasing the risk of a crash. AP Racing will notify the distributors that purchased the brake fluid bottles from AP Racing, and will provide new labels to clarify the brake fluid's intended use, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Essex Parts Services, US distributor of AP Racing fluids at 1-704-824-6030.

17E-073

Lippert Components, Inc. (Lippert) is recalling certain Power Tongue Jacks, Smart Jack model 426514. These jacks are operated with a laminated plastic touch pad which can crack or separate allowing water to enter and cause the jack to automatically retract or extend without warning. If the jack retracts or extend unintentionally, it can increase the risk of injury to those within the trailer or increase the risk of a crash if the jack moves while the trailer is being towed. Lippert will notify purchasers of the jacks and will replace the SMART Jack Power Tongue Jack, free of charge. The recall began on January 5, 2018. Owners may contact Lippert Customer Service at 1-574-538-4514 or via email recall@lci1.com. Lipperts number for this recall is 2017-045-001.

17E-074

Autoliv, Inc. (Autoliv) is recalling certain ACH 2.4 inflatable side curtain air bags. The inflators for these air bags have a component that may detach during deployment of the inflatable curtain air bag. If the component detaches during deployment, it may enter the passenger compartment and be a projectile within the vehicle cabin, increasing the risk of injury. Autoliv will notify the vehicle manufacturers that purchased the side curtain air bags. Those manufacturers will conduct recalls and their dealers will replace the affected air bags, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Autoliv customer service at 1-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

248-276-0722.

17E-075

Chrysler (FCA US LLC) is recalling certain Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers sold through Mopar service parts to equip various Chrysler vehicles. These extinguishers may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> If the fire extinguisher does not function properly, it can increase the risk of injury in the event of a fire. Chrysler will notify owners, instructing them to contact Kidde for a replacement fire extinguisher, free of charge. The recall is expected to begin February 9, 2018. Owners may contact Chrysler customer service at 1-800-853-1403, or Kidde customer service toll-free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information. Chrysler's number for this recall is T83.

17E-076

A.L. Solutions US (A.L. Solutions) is recalling certain after market diesel fuel filters, part number ALG-7554. The cap's thread design on these filters may not match the thread design of the housing, causing the filter to be sealed improperly and possibly causing a fuel leak. A diesel fuel leak in the presence of an ignition source such as hot engine components can increase the risk of a fire. A.L. Solutions will notify its customers, and those companies will conduct recalls and notify the customers that purchased the filters, offering a refund or a replacement fuel filter, free of charge. The recall is expected to begin February 6, 2018. Owners may contact A.L. Solutions customer service at 1-201-825-4235.

17E-077

Eaton Cummins Automated Transmission Tec (Eaton Cummins) is recalling certain Endurant transmissions, part numbers EEO-17F112C, EEO-16F112C and EEO-18F112C and PACCAR transmissions, part numbers PO-14F112C, PO-15F112C, PO-16F112C, PO-17F112C and PO-18F112C. The transmission control module (TCM) may allow the engine to crank briefly even if the transmission shifter is not in neutral. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 102, "Transmission Shift Lever Sequence/Starter Interlock/Transmission Braking Effect." If the transmission is not in neutral when the engine begins running, there may be unintended vehicle movement, increasing the risk of a crash. Eaton Cummins will notify the affected vehicle manufacturers who will file and conduct recalls to install updated TCM software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Eaton Cummins at 1-269-342-3184.

17E-078

TIRES:

Cooper Tire & Rubber Co. (Cooper) is recalling certain Cooper Cobra Radial G/T tires, sizes P215/70R14, P225/70R14 and P225/70R15, Cornell 1000 tires, size P235/75R15, El Dorado Golden Fury GFT tires, size P205/75R15, Futura GLS Super Sport tires, size P225/70R14, Mastercraft Avenger G/T tires, size

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

P225/70R14, Mastercraft MC-440 tires, sizes 185/60R15, 215/60R16, 225/60R16, 225/60R17 and 205/55R16, Starfire RS-C 2.0 tires, sizes 215/60R16 and 205/55R16, Starfire SF-340 tires, sizes P215/65R16, P185/60R15, P215/60R16 and P225/60R16, Cooper Trendsetter SE tires, sizes P205/75R15 and P235/75R15, Mastercraft A/S IV tires, sizes P205/75R15 and P235/75R15, and Vanderbilt Turbo-Tech G/T Radial tires, size P225/70R14. These tires were manufactured with an incorrect belt rubber compound that may result in poor adhesion of the rubber to the belt wires, potentially resulting in a belt separation. If the belt separates from the tire it can cause loss of vehicle control, increasing the risk of a crash. Cooper will notify owners, and dealers will replace the tires, free of charge. The recall began on January 3, 2018. Owners may contact Cooper customer service at 1-800-854-6288. Cooper's number for this recall is 170.

17T-019

VEHICLES:

MV Agusta USA, LLC (MV Agusta) is recalling certain 2017 Brutale 800 Dragster RR motorcycles. The spokes on the rear wheel may loosen, potentially affecting the motorcycle's handling. If the handling is compromised from the loose spokes on the rear wheel, there would be an increased risk of a crash. MV Agusta will notify owners, and dealers will replace the rear wheels, free of charge. The recall began on December 13, 2017. Owners may contact MV Agusta customer service at 1-215-781-1770. MV Agusta's number for this recall is 2813.

17V-772

Kia Motors America (Kia) is recalling certain 2012-2014 Forte and Forte Koup vehicles. The brake pedal stopper pad can deteriorate allowing the brake light switch plunger to remain extended when the brake pedal is released. This will allow the brake lights to remain illuminated continuously. It can also allow the shift lever to be moved without depressing the brake pedal, or activate the engine management brake pedal override feature. If the brake light switch plunger does not retract as it should when the brake pedal is not being pressed, the brake lights may stay illuminated preventing accurate communication to following vehicles that the vehicle is slowing or stopping. Additionally, if the brake switch plunger is not retracted, then the transmission can be shifted out of PARK without depressing the brake pedal. Either condition increases the risk of a crash. Kia will notify owners, and dealers will replace the brake pedal stopper pad, free of charge. The recall is expected to begin January 30, 2018. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC158.

17V-773

Kawasaki Motors Corp., U.S.A. (Kawasaki) is recalling certain 2017-2018 Z125 PRO & PRO KRT Edition motorcycles, models BR125JHF and BR125JJF. The Electronic Control Unit (ECU) may have an improper setting for the fuel injection, allowing the engine to stall. An engine stall can increase the risk of a crash. Kawasaki will notify owners, and dealers will replace the ECU, free of charge. The recall began on December 21, 2017. Owners may contact Kawasaki customer service at 1-866-802-9381.

17V-774

Ford Motor Company (Ford) is recalling certain 2018 Expedition vehicles. The second row outboard seats may have excessive forward adjustment capability and/or may have an improperly installed bolt that secures the seat

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

back to the seat base. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 202a, "Head Restraints", number 207, "Seating Systems", and number 210, "Seat Belt Anchorage System." If the seat back is not adequately secured, and/or the seat occupant is improperly positioned, there can be an increased risk of injury in a crash. Ford will notify owners, and dealers will inspect the second row outboard seats for proper seat adjustment travel, replacing the seat frame assembly if necessary. Dealers will also inspect the bolts attaching the seat back to the seat base for the proper installation, correcting it as necessary. These repairs will be made free of charge. The recall began on January 10, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17C20.

17V-775

Burch Tank and Truck (Burch) is recalling certain 1984 Evans Cargo Tank trailers, equipped with MPA/MTA suspensions and Meritor EX225 brakes. The brake caliper bolts on these axles may not be properly torqued which can allow the caliper to detach from the mounting flange. If the caliper bolts are improperly torqued and the caliper detaches from the mounting flange, a loss of braking ability would occur, increasing the risk of a crash. Burch has notified owners, and fleets will be reimbursed by Meritor to inspect the bolts, and replace any loose or missing ones. The recall began on October 3, 2017. Owners may contact Burch customer service at 1-800-882-7640 or the Meritor call center at 1-866-668-7221.

17V-776

Temsa Global Sanayi Ve Ticaret A.S. (Temsa) is recalling certain 2017-2018 TS30, TS35E, and TS45 buses. These vehicles have an engine fire suppression system that may contain contaminated ABC dry chemical. If there are contaminants in the fire suppression dry chemical, the chemical may discharge improperly, affecting the suppression of a fire and increasing the risk of injury. Temsa will notify owners, and dealers will replace the dry chemical in the fire suppression system, free of charge. The recall is expected to begin January 2018. Owners may contact Temsa's agent, CH Bus Sales, at 1-407-271-8935.

17V-777

Triple E Recreational Vehicles (Triple E) is recalling certain 2016-2018 Wonder motorhomes, model W24MB. The bolts that fasten the passenger side seat pedestal may be improperly tightened. In the event of a crash, the improperly tightened bolts may cause the passenger side seat pedestal bolts to fail, preventing the passenger from being restrained, increasing their risk of injury. Triple E will notify owners, and dealers will correctly tighten the passenger side seat pedestal mounting bolts, free of charge. The recall began on December 18, 2017. Owners may contact Triple E customer service at 1-204-325-4361. Triple E's number for this recall is CA#8809-1.

17V-778

Travel Lite RV (Travel Lite) is recalling certain 2018 Falcon recreational trailers, models F-23TH, and F-23RB. A 2" Class III hitch coupler was mistakenly installed instead of a 2 5/16" Class III hitch coupler. Because the coupler is under rated for the gross vehicle weight rating (GVWR) of the trailer, the trailer could become unhitched from the tow vehicle, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Travel Lite customer service at 1-574-831-3000.

17V-779

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

Forest River, Inc. (Forest River) is recalling certain 2017 Starcraft Bus Prodigy, Prodigy LP, and Quest school buses. The screws used to secure the floor in these buses may be too long and can damage the fuel lines underneath. If the fuel lines are damaged from the screws that are too long, fuel may leak and cause an engine stall, increasing the risk of a crash. Additionally, the leaking fuel may increase the risk of a fire. Forest River has notified owners, and dealers will inspect the fuel lines, replacing them as necessary, and will install shorter length screws to secure the floor, free of charge. The recall began on December 14, 2017. Owners may contact Starcraft customer service at 1-800-348-7440. Forest River's number for this recall is 05-0592.

17V-780

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2012-2014 Audi A6 and A7 vehicles. The fuel line has a compression point that can weaken, potentially resulting in a fuel leak. A fuel leak in the presence of an ignition source, increases the risk of a fire. Audi will notify owners, and dealers will replace the fuel line, free of charge. The recall is expected to begin February 5, 2018. Owners may contact Audi customer service at 1-888-237-2834. Volkswagen's number for this recall is 20AR.

17V-781

Winnebago Industries, Inc. (Winnebago) is recalling certain 2013-2018 Winnebago Era, Travato, Minnie Winnie, Fuse, View, Trend, Aspect, Brave, Vista, Sightseer, Adventurer, Forza, Journey, Tour, Revel, Paseo, Chalet, Access, and Intent motorhomes and Commercial vehicles, and 2013-2018 Itasca Spirit, Navion, Cambria, Tribute, Sunstar, Sunova, Suncruiser, Solei, Meridian, Elipse, Horizon, Reyo, and Via motorhomes. These vehicles are equipped with Kidde Plastic-Handle or Push Button 'Pindicator' fire extinguishers that may become clogged, preventing the extinguisher from discharging as expected or excessive force may be needed to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Winnebago will notify owners, instructing them to contact Kidde for replacement or aftermarket fire extinguishers, free of charge. The recall began on January 19, 2018. Owners may contact Winnebago customer service at 1-641-585-3535, or Kidde customer service toll-free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information.

17V-782

Autocar, LLC (Autocar) is recalling certain 2017-2018 Xpeditor vehicles. These vehicles are equipped with an HVAC defrost door actuator system mechanism that may overheat due to inadequate circuit protection. Overheating of the defrost actuator increases the risk of a fire. Autocar will notify owners, and dealers will install an additional harness with a one amp fuse to the circuit, free of charge. The recall began on January 12, 2018. Owners may contact Autocar customer service at 1-888-218-3611. Autocar's number for this recall is ACX-1704.

17V-783

Kia Motors America (Kia) is recalling certain 2018 Kia Sorento vehicles. The side curtain air bags on these vehicles have a component that may detach during deployment of the inflatable curtain air bag. If the component

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

detaches during deployment, it may enter the passenger compartment and be a projectile within the vehicle cabin, increasing the risk of injury. Kia will notify owners, and dealers will replace the driver and passenger side curtain air bags, free of charge. The recall began on December 18, 2017. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC159.

17V-784

KZRV, L.P. (KZRV) is recalling certain 2014-2015 Durango Gold recreational trailers. In the affected vehicles, a rivet for the quad entry steps may shear and fail, causing the steps to give when being used. If the rivet shears causing the quad step to fail, the step user may fall, increasing the risk of personal injury. KZRV will notify owners, and dealers will inspect and replace the two rivets joining the second and third step, and the four rivets on the top step, free of charge. The recall is expected to begin February 2, 2018. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. Note: This recall is an expansion of KZRV recall 15V-173.

17V-785

Midwest Automotive Designs, LLC (Midwest) is recalling certain Custom Vans and Camper Van recreational vehicles built on 2014-2017 Mercedes Benz Sprinter chassis and 2016-2017 RAM Promaster chassis. These vehicles are equipped with Kidde Plastic-Handle or Push Button 'Pindicator' fire extinguishers that may become clogged, preventing the extinguisher from discharging as expected or excessive force may be needed to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rcl/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Midwest will notify owners, and dealers will replace the fire extinguisher with a different brand, free of charge. The recall is expected to begin January 2018. Owners may contact Kidde customer service for their replacement extinguisher at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information.

17V-786

Ford Motor Company (Ford) is superseding a previous recall for certain 2004-2006 Ford Ranger trucks to implement a final repair. Upon deployment of the driver side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. Ford will notify owners, and dealers will replace the driver's frontal air bag inflator with an alternate inflator, free of charge. The recall is expected to begin December 26, 2017, and will be launched in phases through the end of March 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S42. Note: This recall supersedes recall 16V-036 which was an interim repair. Vehicles that received a replacement air bag inflator under the previous campaign need to return to a dealer to have an alternate inflator installed.

17V-787

Ford Motor Company (Ford) is superseding a previous recall for certain 2004-2006 Ford Ranger trucks to implement a final repair. Upon deployment of the passenger side frontal air bag, excessive internal pressure may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

cause the inflator to rupture. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants, potentially resulting in serious injury or death. Ford will notify owners, and dealers will replace the passenger's frontal air bag inflator with an alternate inflator, free of charge. The recall began on December 22, 2017, and will be launched in phases through the end of March 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S42. Note: This recall supersedes recall 15V322 which was an interim repair. Vehicles that received a replacement air bag inflator under the previous campaign need to return to a dealer to have an alternate inflator installed. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S42.

17V-788

Grand Design RV, LLC (Grand Design) is recalling certain 2017-2018 Reflection and Imagine travel trailers equipped with a Smart-Jack model power tongue jack. The laminated plastic touch pad on the jack may crack or separate allowing water to enter, potentially causing the jack to operate unintentionally. If the tongue jack retracts or extends unexpectedly, there could be an increased risk of a crash or injury. Grand Design will notify owners, and dealers will replace the power tongue jack, free of charge. The recall began on December 29, 2017. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 900012.

17V-789

Forest River, Inc. (Forest River) is recalling certain 2018 Salem and Wildwood recreational trailers. The Federal Placard on these vehicles incorrectly states that the trailers are equipped with ST215/75R15 Load Range D tires, however, the installed tires are size ST205/75R15 Load Range D. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims," and these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the incorrect label causes the operator to install tires of the wrong size, vehicle handling may be affected, increasing the risk of a crash. Forest River will notify owners and provide corrected Federal Placards, free of charge. The recall began on December 18, 2017. Owners may contact Forest River customer service at 1-574-848-1335. Forest River's number for this recall is 05-0595.

17V-790

JH Global Services, Inc. (JH Global) is recalling certain 2017 Star EV Sport 4+2 vehicles. Due to a casting problem, the tie rod connection may break off from the front axle spindle resulting in a loss of steering control. A loss of steering control from the tie rod connection breaking from the front axle spindle can increase the risk of a crash. JH Global has notified owners, and dealers will replace the front axle spindle, free of charge. The recall began on November 20, 2017. Owners may contact JH Global customer service at 1-888-878-9988. JH Global's number for this recall is IRN 171101.

17V-791

Mitsubishi Motors North America, Inc. (MMNA) is recalling all 2016-2017 i-MiEV vehicles, equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. MMNA will notify owners, and dealers will replace the passenger side frontal air bag inflator, free of charge. The recall began on December 15, 2017. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-17-008.

17V-793

Aston Martin The Americas (Aston Martin) is recalling certain 2005-2009 DB9, and DBS vehicles. The battery supply cable on these vehicles may become damaged when the driver seat is positioned in the full rearward location. If the battery cable is damaged and then grounded, the short circuit can increase the risk of a fire. Aston Martin will notify owners, and dealers will inspect the battery supply cable for damage, and install a routing block to keep the battery supply cable from being compressed by the seat, free of charge. The recall is expected to begin February 1, 2018. Owners may contact Aston Martin customer service at 1-888-923-9988. Aston Martin's number for this recall is RA-18-0026.

17V-795

Aston Martin The Americas (Aston Martin) is recalling certain 2009-2016 DB9, 2009-2012 DBS, 2010-2015 Rapide, 2012 Virage, and 2014 Vanquish vehicles equipped with a 6-Speed Touchtronic II Automatic Transmission. A communication error between the Engine Control Module (ECM) and the Transmission Control Module (TCM) can cause the transmission park pawl to not engage. If the park pawl does not engage and the vehicle is stopped on a slope and exited without the parking brake being applied, the vehicle may unexpectedly roll, increasing the risk of a crash. Aston Martin will notify owners, and dealers will update the TCM software, free of charge. The recall is expected to begin February 1, 2018. Owners may contact Aston Martin customer service at 1-888-923-9988. Aston Martin's number for this recall is RA-07-0028.

17V-796

Newmar Corporation (Newmar) is recalling certain 2018 Bay Star and Bay Star Sport motorhomes. The front side marker lights on these vehicles may not be connected to the wiring harness. Additionally, when the headlight high beams are activated, the low beams may not illuminate as intended. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the front side marker lights are not connected to the wiring harness, and the low beams do not illuminate when high beams are activated, it can reduce visibility to the operator and to other drivers, increasing the risk of a crash. Newmar will notify owners, and dealers will connect the front side marker lights to the wiring harness, and ensure the low beam lights illuminate with high beam activation, free of charge. The recall began on January 16, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

17V-797

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2006-2017 G5 school buses with an unloaded weight more than 10,013 pounds. In a rollover, the roof may crush excessively. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 220, "School Bus Rollover

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

Protection." If roof crushes more than the rollover standards allow for the weight and configuration of the bus, the occupants have a greater risk of injury in the event of a rollover crash. Micro Bird will notify owners, and dealers will modify the buses to prevent the roof from crushing excessively in a rollover, free of charge. The recall is expected to begin January 2018. For more information, owners may contact Micro Bird at 1-819-475-9633. Micro Bird's number for this recall is 17-072-GUS.

17V-798

Forest River, Inc. (Forest River) is recalling certain 2016-2018 Berkshire XLT motorhomes. Incorrect circuit breakers were used that may not contact the electrical sub-panel correctly. If the breakers do not contact the sub-panel properly, the electrical resistance can cause excessive heat, increasing the risk of a fire. Forest River will notify owners, and dealers will replace the incorrect circuit breaker, free of charge. The recall began on January 11, 2018. Owners may contact Forest River customer service at 1-574-522-1368. Forest River's number for this recall is 40-0594.

17V-799

East Manufacturing Corp. (East) is recalling certain 2016-2018 Frame Dump trailers built with a pintle hook or brackets for the future installation of a pintle hook. Cracks may develop in the cross member that the pintle hook is connected to, possibly resulting in the cross member failing. If the cross member fails, vehicle handling would be affected, increasing the risk of a crash. East will notify owners, and dealers will weld any cracks and install reinforcing plates to the cross member, or replace the cross member, as necessary. These repairs will be performed free of charge. The recall began on December 20, 2017. Owners may contact East customer service at 1-330-325-9921.

17V-800

Hyundai Motor America (Hyundai) is recalling certain 2018 Santa Fe Sport vehicles. The side curtain air bags on these vehicles have a component that may detach during deployment of the inflatable curtain air bag. If the component detaches during deployment, the curtain air bag may not inflate properly during a crash, increasing the risk of injury. Additionally, if the detached component were to enter the vehicle occupant compartment, there could be an increased risk of occupant injury. Hyundai will notify owners, and dealers will replace the driver and passenger side curtain air bags, free of charge. The recall is expected to begin February 9, 2018. Owners may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for this recall is 171.

17V-801

REV Recreation Group (REV) is recalling certain 2018 Fleetwood Axon, Bounder, Flair, Southwind, Pace Arrow and Pace Arrow LXE motorhomes, and 2018 Holiday Rambler Navigator, Navigator XE, Reno, Vacationer, and Vacationer XE motorhomes. The satellite dish on these vehicles may detach from the roof while driving and become a road hazard. If the satellite dish detaches from the roof while driving it can increase the risk of a crash or injury. REV will notify owners, and dealers will resecure the satellite dish to the roof with a metal reinforcement, free of charge. The recall is expected to begin February 9, 2018. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 171208REV.

17V-802

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

Ford Motor Company (Ford) is recalling certain 2018 Ford Escape vehicles. The side curtain air bags on these vehicles have a component that may detach during deployment of the inflatable curtain air bag. If the component detaches during deployment, it may enter the passenger compartment and be a projectile within the vehicle cabin, increasing the risk of injury. Ford will notify owners, and dealers will replace the driver and passenger side curtain air bags, as necessary, free of charge. The recall is expected to begin January 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S44.

17V-803

Daimler Vans USA, LLC (DVUSA) is recalling certain 2017 Mercedes-Benz Sprinter 3500 and Freightliner Sprinter 3500 vehicles equipped with the Crosswind Assist function. In the event of strong crosswind, automatic brake interventions by the vehicle dynamics control system (ADAPTIVE ESP) might not be activated. If Crosswind Assist system does not activate the automatic braking system as expected in the event of a strong crosswind, there would be an increased risk of a crash. DVUSA will notify owners, and dealers will update the ESP control unit with corrected software, free of charge. The recall is expected to begin in January 2018. Owners may contact DVUSA customer service at 1-854-888-3214.

17V-804

Honda (American Honda Motor Co.) is recalling certain 2017 Honda VT1300CX Fury motorcycles and 2010 and 2016 Honda VT1300CX Fury motorcycles that received a replacement fuel tank. The fuel tank may be missing welds around the mounting bracket. If the welds are missing, the mounting bracket can separate from the tank, allowing fuel to leak and increasing the risk of a fire in the presence of an ignition source. Honda will notify owners, and dealers will inspect the fuel tank welds and, as necessary, replace the fuel tank, free of charge. The recall began December 14, 2017. Owners may contact Honda customer service at 1-888-234-2138.

17V-805

Mazda North American Operations (Mazda) is recalling certain 2004-2006 Mazda B-series trucks. Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants, potentially resulting in serious injury or death. Mazda will notify owners, and dealers will replace the passenger side frontal air bag inflator with an alternate inflator, free of charge. The recall began on January 17, 2018. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 1817L. Note: This recall supersedes recall 15V-346. Vehicles that received a replacement air bag inflator under the previous campaign need to return to a dealer to have an alternate inflator installed.

17V-806

Mazda North American Operations (Mazda) is recalling certain 2004-2006 B-Series trucks. Upon deployment of the driver side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. Mazda will notify owners, and dealers will replace the driver's frontal air bag inflator with an alternate inflator, free of charge. The recall began on January 17, 2018. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

this recall is 1917L. Note: This recall supersedes recall 16V-048. Vehicles that received a replacement air bag inflator under the previous campaign need to return to a dealer to have an alternate inflator installed.

17V-807

Forest River, Inc. (Forest River) is recalling certain 2018 Sandpiper and Sierra recreational trailers. The Federal Placard may incorrectly indicate the recommended tire pressure to be 110psi, however, the actual tire pressure should be 95psi. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims," and these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the tires are inflated incorrectly to 110psi, it can cause premature wear of the tire, potentially causing a loss of control and increasing the risk of a crash. Forest River will notify owners, and dealers will install a corrected Federal Placard, free of charge. The recall began on January 2, 2018. Owners may contact Forest River customer service at 1-574-534-4574. Forest River's number for this recall is 03-0599.

17V-808

Newmar Corporation (Newmar) is recalling various 1995-2018 motorhomes. A list of the affected vehicles available at: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17V809-2309.pdf>. These motorhomes are equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers that may become clogged, preventing the extinguisher from discharging as expected or excessive force may be needed to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Newmar will notify owners, and instruct them to contact Kidde for a replacement fire extinguisher, free of charge. The recall is expected to begin February 13, 2018. Owners may contact Kidde customer service toll-free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information or owners may contact Newmar customer service at 1-574-773-7791. Newmar's number for this recall is 17E-062.

17V-809

Daimler Trucks North America LLC (DTNA) is recalling certain 2002-2017 Freightliner Cascadia, Century Class, Columbia and Coronado trucks and Western Star 4700, 4900, 5700, 5900 and 6900 trucks. These vehicles are equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers that may become clogged, preventing the extinguisher from discharging as expected or excessive force may be needed to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. DTNA will notify owners, and instruct them to contact Kidde for a replacement fire extinguisher, free of charge. The recall is expected to begin February 12, 2018. Owners may contact DTNA customer service at 1-800-547-0712, or contact Kidde customer service toll-free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information. DTNA's number for this recall is FL-759.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

17V-810

Piaggio Group Americas, Inc. (Piaggio) is recalling certain 2016-2017 Aprilia RSV4 1000 motorcycles (including RR, Factory Superpole, and RF Superpole), and 2017 Aprilia Tuono V4 1100 motorcycles (including RR and Factory Superpole). These motorcycles are equipped with Brembo front brake master cylinders that may fail. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 122, "Motorcycle Brake Systems." If the front brake master cylinder fails, the loss of front braking ability can increase the risk of a crash. Aprilia will notify owners, and dealers will replace the front brake master cylinder piston, free of charge. The recall is expected to begin January 2018. Owners may contact Aprilia customer service at 1-212-380-4433.

17V-811

Ducati North America (Ducati) is recalling certain 2015-2018 1299 motorcycles (including STD, S, FE and SL models), Monster 1200 motorcycles (including S and R models), Multistrada motorcycles (including S and PP models), 2015-2017 Panigale R, 2016-2018 XDaviel S motorcycles and 2017-2018 Scrambler 800 Café Racer motorcycles. These motorcycles are equipped with Brembo front brake master cylinders that may fail. If the front brake master cylinder fails, the loss of front braking ability can increase the risk of a crash. Ducati will notify owners, and dealers will replace the front brake master cylinder piston, free of charge. The recall is expected to begin February 15, 2018. Owners may contact Ducati customer service at 1-800-231-6696.

17V-812

Bluecar SAS (Bluecar) is recalling certain 2016 Bluecar vehicles. While driving, the front driver, passenger, and side curtain air bags may deploy without warning and without a crash occurring. Unexpected deployment of the air bags without a crash can increase the risk of injury. Bluecar has notified the company that owns the vehicles, and the air bag software is being updated, free of charge. The recall began on December 4, 2017. Owners may contact Bluecar customer service at 1-972-757-7251.

17V-813

Ford Motor Company is recalling certain 2018 Ford Mustang vehicles equipped with an automatic transmission and a 12.4" digital instrument cluster. If the ignition is turned off when the transmission is not in PARK, the instrument cluster may not illuminate the PRNDL gear position display and the operator may not receive the "Key in Ignition" chime when the driver's door is opened. As such, these vehicles fails to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 102, "Transmission Shift Lever Sequence/Starter Interlock/Transmission Braking Effect," and number 114, "Theft Protection." Without a visual or audible warning to the driver that the vehicle is in PARK, the vehicle may roll away after it has been exited if the parking brake has not been applied, increasing the risk of injury or a crash. Ford will notify owners, and dealers will update the instrument cluster software, as necessary, free of charge. The recall is expected to begin February 5, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17C21.

17V-814

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2017 GLE400 4Matic, GLE350 4Matic, GLE350,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

GLE550e 4Matic, GLE43 AMG 4Matic, GLE63 AMG 4Matic, GLS450, GLE63S 4Matic, GLS63 4Matic, S550e, S600, S63 AMG 4Matic, S65 AMG, S550, Mercedes-Maybach S600, Mercedes-Maybach S550 4Matic, GLE43 AMG 4Matic Coupe, GLE63S 4Matic Coupe, 2017-2018 GLS550 4Matic, S550 4Matic, 2018 S450, and S63 AMG 4Matic vehicles. The rear passenger door on the driver side may indicate that it is locked, when it may not be. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 206, "Door Locks and Door Retention Components." If the door appears to be locked, the door may be unintentionally opened, increasing the risk of injury. MBUSA will notify owners, and dealers will inspect the left rear door lock, replacing it as necessary, free of charge. The recall is expected to begin in January 2018. Owners may contact MBUSA customer service at 1-877-496-3691.

17V-816

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2017 Mercedes G550 & G550 4x4 Squared vehicles. The vacuum hose for the brake booster may collapse resulting in increased braking effort. Increased braking effort may increase the risk of a crash. MBUSA will notify owners, and dealers will replace the vacuum hose, as necessary, free of charge. Parts are not currently available. Owners will be notified of the recall in January 2018 and they will receive a second letter when the parts become available, currently expected to be in March 2018. Owners may contact MBUSA customer service at 1-877-496-3691.

17V-817

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2017 AMG GT & AMG GT-C Roadster and 2018 AMG GT-S & GT Roadster vehicles equipped with AMG Performance Seats. The passenger occupant classification system (OCS) might not function properly, possibly causing the passenger frontal air bag to be incorrectly deactivated or incorrectly activated in the event of a crash. A passenger air bag that is incorrectly activated or deactivated in the event of a crash increases the risk of injury due to potential incorrect airbag deployment or non-deployment. MBUSA will notify owners, and dealers will update the OCS software, and if necessary, replace the passenger seat cushion, free of charge. Owners will be notified of the recall in January 2018 and they will receive a second letter when the parts become available, currently expected to be in February 2018. Owners may contact MBUSA customer service at 1-877-496-3691.

17V-818

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2016-2017 GLC300, GLC300 4MATIC and GLC43 4MATIC vehicles. These vehicles may have misadjusted headlights, possibly resulting in the low beam headlights insufficiently illuminating the roadway. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." An insufficiently illuminated roadway may increase the risk of a crash. MBUSA will notify owners, and dealers will inspect the headlamp adjustment, adjusting it as necessary, free of charge. The recall began on January 12, 2018. Owners may contact MBUSA customer service at 1-877-496-3691.

17V-819

Fiat Chrysler Automobiles US LLC (Chrysler) is recalling certain 2005 Dodge Dakota pickup trucks equipped with heated seats. These driver and passenger seats may develop hot spots that can result in the seat cushion or seat back having burn holes. The hot spots and burn holes can injure the seat occupant and can increase the risk

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

of a fire. Chrysler will notify owners and dealers will update the seat heating system control features, free of charge. The recall is expected to begin February 8, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T80.

17V-820

Chrysler (FCA US LLC) is recalling certain 2016-2017 Ram 3500 Cab Chassis with a Gross Vehicle Weight Rating (GVWR) of less than 10,000 lbs, 2011-2017 Ram 3500, 4500 and 5500 Cab Chassis vehicles, 2009-2017 Ram 1500 and 2010-2017 Ram 2500 and 3500 pickup trucks, all equipped with a column shifter. Pushing the brake pedal for prolonged periods when the vehicle is running and in PARK may cause the Brake Transmission Shift Interlock (BTSI) pin to stick in the open position. With the pin in the open position, the transmission can be shifted out of PARK into any gear without pushing the brake pedal or having the key in the ignition. Being able to shift the transmission without pushing the brake pedal and/or without a key in the ignition can increase the risk of an unintended vehicle rollaway that may result in personal injury or a crash. The remedy for this recall is still under development. The recall is expected to begin February 8, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T79.

17V-821

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Audi A5 Coupe vehicles. The affected vehicles were built with head curtain air bag assemblies that may not unfold properly. As such, these vehicle fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 226, "Ejection Mitigation." In the event of a crash necessitating deployment of the head curtain air bag, if the air bag does not deploy properly, the vehicle occupants have an increased risk of injury. Audi will notify owners, and dealers will modify the head curtain air bags so that they deploy properly, free of charge. The recall began on January 18, 2018. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 69T7.

17V-822

Chrysler (FCA US LLC) is recalling certain 2018 Alfa Romeo Giulia and Stelvio vehicles. The braking system on these vehicles may have been filled with contaminated brake fluid, possibly damaging the system and affecting its performance. A reduction in braking performance can increase the risk of a crash. Alfa Romeo will notify owners, and dealers will inspect the braking system, replacing it as necessary, free of charge. The recall is expected to begin February 8, 2018. Owners may contact Alfa Romeo customer service at 1-844-253-2872. Chrysler's number for this recall is T84.

17V-823

Chrysler (FCA US LLC) is recalling various Dodge, Chrysler, and RAM vehicles equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers. A list of the affected trailer models is available at: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17V824-0103.pdf>. These extinguishers may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> If the fire extinguisher does not function properly,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

it can increase the risk of injury in the event of a fire. Chrysler will notify owners instructing them to contact Kidde for a replacement fire extinguisher, free of charge. The recall is expected to begin February 9, 2018. Owners may contact Chrysler customer service at 1-800-853-1403 or Kidde customer service toll-free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information. Chrysler's number for this recall is T82.

17V-824

Forest River, Inc. (Forest River) is recalling certain 2018 Coachmen Galleria motorhomes, models GAB24FLM, GAB24QM and GAB24TM. The inverter was installed using a lead wire that may not be able to handle the amperage draw. If the lead wire cannot handle the draw, the lead wire may melt, increasing the risk of a fire. Forest River will notify owners, and dealers will replace the lead wire, free of charge. The recall is expected to begin February 14, 2018. Owners may contact Forest River customer service at 1-574-825-8590. Forest River's number for this recall is 225-0587.

17V-825

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2018 Mercedes-Benz AMG GT, AMG GT R, AMG GT C and AMG GT S vehicles. The seat belts may bind within the guidance loops possibly causing slack in the seat belts. If the seat belt binds, slack may develop through occupant movement which may lead to increased personal injury in the event of a crash. MBUSA will notify owners, and dealers will reconfigure the seat belt guides, free of charge. Owners will be notified of the recall in January 2018 and they will receive a second letter when the parts become available, currently expected to be in February 2018. Owners may contact MBUSA customer service at 1-877-496-3691.

17V-826

Keystone RV Company (Keystone) is recalling certain 2018 Hideout recreational trailers, model 310. The Federal Placard on these vehicles incorrectly lists the Gross Axle Weight Rating (GAWR) as 5,080 lbs and the tire size as ST225/75R15D with 65 PSI, when the correct GAWR is 5,200 lbs and the correct tire size is ST225/75R15E with 80 PSI. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The incorrect label information may cause the operator to underinflate the tires, possibly resulting in their failure and an increased risk of a crash. Keystone has notified owners and provided a corrected Federal Placard, free of charge. The recall began on December 27, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-310.

17V-827

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2016-2017 Mercedes GLE 550e 4MATIC vehicles. The tire pressure label on the B-pillar lists incorrect seating capacity and front and rear tire dimension information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FVMSS) number 101, "Tire Selection and Rims." Applying incorrectly sized tires to the vehicle will affect the speedometer reading, which can increase the risk of a crash. MBUSA will notify owners, and dealers will inspect the tire pressure label, replacing it, as necessary, free of charge. The recall is expected to begin in January 2018. Owners may contact MBUSA customer service at 1-877-496-3691.

17V-828

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

REV Recreation Group (REV) is recalling certain 2018 American Coach American Dream, American Revolution, Fleetwood Discovery, Discovery LXE, Holiday Rambler Endeavor, Endeavor XE, and Monaco Marquis recreational vehicles. Water may enter the 12-volt harness connectors due to missing gaskets or the placement of the pin connectors, potentially causing an electrical short. An electrical short can increase the risk of a crash. REV Recreation Group will notify owners, and dealers will inspect, and if necessary, install a gasket for each affected harness pin connector and re-route harnesses that terminate near luggage compartment number five, free of charge. The recall is expected to begin February 15, 2018. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 171213REV.

17V-829

Newmar Corporation (Newmar) is recalling certain model year 2016-2018 Bay Star, Bay Star Sport, Canyon Star, Dutch Star, Essex, King Aire, London Aire, Mountain Aire, New Aire, Ventana and Ventana LE motorhomes. These vehicles may have a loose power connection at the Automatic Transfer Switch (ATS), possibly resulting in a build up of heat. The build up of heat in the wiring from the loose power connection can increase the risk of a fire. Newmar will notify owners, and dealers will inspect the electrical connection at the ATS, tightening it as necessary, free of charge. The recall is expected to begin February 17, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

17V-830

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2017-2018 Toyota 4Runner and Tundra, 2018 Toyota Highlander, RAV4 and Lexus GX460 and 2017 Toyota Sienna and Tacoma vehicles. These vehicles may have incorrect load carrying capacity modification labels. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." An incorrect load information label can result in the operator overloading the vehicle and increasing the risk of a crash. Toyota will notify owners and provide them with corrected labels, free of charge. The recall began on January 23, 2018. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's numbers for this recall are H0Z for Toyota vehicles, and HLF for Lexus vehicles.

17V-831

Wabash National Corporation (Wabash) is recalling certain 2018 Wabash National Truck Body vehicles. The affected vehicles may be missing a weld on the vertical leg support. In the event of a rear-end collision, the occupants have an increased risk of injury. Wabash will notify owners, and dealers will inspect the vertical leg support, welding it as necessary, free of charge. The recall began on January 17, 2018. Owners may contact Wabash customer service at 1-765-771-5300. Wabash's number for this recall is B18001.

17V-832

Walker Stainless Equipment Company LLC (Walker) is recalling certain 2018 Tank Trailers, equipped with MPA/MTA suspensions and Meritor EX225 brakes. The brake caliper bolts on these axles may not be properly torqued which can allow the caliper to detach from the mounting flange. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the caliper bolts are improperly torqued, the caliper can detach resulting in a loss of braking ability, increasing the risk of a crash. Walker has notified owners, and dealers will inspect the bolts, replacing any loose or missing

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

ones, free of charge. The recall began on January 5, 2018. Owners may contact Walker customer service at 1-800-356-5734. Walker's numbers for this recall are W-6430 and W-6431.

17V-833

Maserati North America, Inc. (Maserati) is recalling certain 2018 Maserati Quattroporte and Ghibli vehicles. These vehicles have a fuel delivery pipe in the engine compartment that may leak fuel at the connections. A fuel leak within the engine compartment increases the risk of a fire. Maserati will notify owners, and dealers will install a new fuel delivery line kit, free of charge. The recall is expected to begin February 9, 2018. Owners may contact Maserati customer service at 1-877-969-2737. Maserati's number for this recall is 363.

17V-834

Forest River, Inc. (Forest River) is recalling certain 2018 Prime Time Crusader and Sanibel recreational trailers. A bracket used to secure the furnace in place may be missing, allowing the furnace to shift, possibly resulting in the fresh air intake and the furnace exhaust tubes being misaligned with the furnace. If the tubes are misaligned, carbon monoxide could enter the passenger compartment, increasing the risk of illness or death. Additionally, flames may escape the furnace during start up, increasing the risk of a fire. Forest River will notify owners, and dealers will install a bracket to secure the furnace, free of charge. The recall is expected to begin February 16, 2018. Owners may contact Forest River customer service at 1-574-862-1025. Forest River's number for this recall is 48-0600.

17V-835

Mobility Ventures LLC (Mobility Ventures) is recalling certain 2011-2016 MV-1 vehicles. During a hard rear impact, the driver's seat-height adjustment assembly may disengage from the seat track and the fore/aft seat adjuster may be released, potentially causing the seat to disengage from the seat track. If the driver's seat partially or fully disengages from the seat track in a rear-end crash, they have an increased risk of injury. Mobility Ventures will notify owners, and dealers will install a seat track reinforcement kit, free of charge. The recall is expected to begin February 14, 2018. Owners may contact Mobility Ventures customer service at 1-877-681-3678. Mobility Ventures number for this recall is R1801.

17V-836

Nissan North America, Inc. (Nissan) is recalling certain 2018 Nissan Versa Note vehicles. During deployment of the side curtain air bag, a component of the air bag inflator may detach. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standards (FMVSS) number 214, "Side Impact Protection," and 226, "Ejection Mitigation." If the component detaches during deployment, it may enter the passenger compartment and be a projectile within the vehicle cabin, increasing the risk of injury. Nissan will notify owners, and dealers will replace the side curtain air bags, free of charge. The recall is expected to begin February 8, 2018. Owners may contact Nissan customer service at 1-800-647-7261.

17V-837

Forest River, Inc. (Forest River) is recalling certain 2015-2018 Cascade and Cherokee recreational trailers. The trailer wiring may have been improperly routed, allowing the wires to be pinched between the chassis and the vehicle body. Pinched wires may short circuit, increasing the risk of a fire. Forest River will notify owners,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

and dealers will inspect the trailers, rerouting the wires, as necessary, free of charge. The recall is expected to begin February 16, 2018. Owners may contact Forest River customer service at 1-541-644-8072. Forest River's number for this recall is 64-0456.

17V-838

MV Agusta USA, LLC (MV Agusta) is recalling certain 2015-2017 F4 RC and F4 RR motorcycles. These motorcycles are equipped with Brembo front brake master cylinders that may fail. If the front brake master cylinder fails, the loss of front braking ability can increase the risk of a crash. MV Agusta will notify owners, and dealers will replace the front brake master cylinder piston, free of charge. The recall began on January 19, 2018. Owners may contact MV Agusta customer service at 1-215-781-1770. MV Agusta's number for this recall is 18RC01.

17V-839

PACCAR Incorporated (PACCAR) is recalling certain 2018 Peterbilt 567, 579, Kenworth T680, and T880 trucks, equipped with certain Eaton Endurant and PACCAR AMT transmissions. The transmission control module (TCM) may allow the engine to crank briefly even if the transmission shifter is not in neutral. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 102, "Transmission Shift Lever Sequence/Starter Interlock/Transmission Braking Effect." If the transmission is not in neutral when the engine begins running, there may be unintended vehicle movement, increasing the risk of a crash. PACCAR will notify owners, and dealers will update the TCM software, free of charge. The recall is expected to begin February 16, 2018. Owners may contact Peterbilt customer service at 1-940-591-4000, or Kenworth customer service at 1-425-828-5000. PACCAR's numbers for this recall are 1217F and 1717KWF.

17V-840

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain 2009-2018 Allegro and Allegro RED, Bus and Phaeton vehicles, 2009-2010 Bay vehicles, 2011-2018 Breeze vehicles, and 2009-2015, and 2017-2018 Zephyr vehicles. These motorhomes are equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers that may become clogged, preventing the extinguisher from discharging as expected or excessive force may be needed to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Tiffin will notify owners, and instruct them to contact Kidde for a replacement fire extinguisher, free of charge. The recall is expected to begin February 13, 2018. Owners may contact Kidde customer service toll-free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information. Owners may also contact Tiffin customer service at 1-256-356-8661.

17V-841

Hyundai Translead is recalling certain 2017 Hyundai Translead Composite trailers, model number 30012130, and HyCube trailers model numbers 30012400, 30012409, 30012410, 30012431, 30012434, 30012481, and 30012595. These trailers are equipped with MPA/MTA suspensions and Meritor EX225 brakes. The brake caliper bolts on these axles may not be properly torqued which can allow the caliper to detach from the mounting

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

flange. If the caliper bolts are improperly torqued and the caliper detaches from the mounting flange, a loss of braking ability would occur, increasing the risk of a crash. Hyundai Translead will notify owners, and dealers will inspect the bolts, replacing any loose or missing ones, free of charge. The recall began on January 19, 2018. Owners may contact Hyundai Translead customer service at 1-819-574-1500 or Meritor at 1-866-668-7221. Hyundai Translead's number for this recall is 17E049.

17V-842

Newmar Corporation (Newmar) is recalling certain 2017 Bay Star, Bay Star Sport, and Canyon Star vehicles, built on Ford chassis and equipped with Antilock Brake Systems (ABS). The brake Hydraulic Electronic Control Units (HECU) on these vehicles may be missing valve block ball plugs, potentially causing a brake fluid leak or air ingestion during electronic brake distribution and/or ABS activation. A brake fluid leak or air ingestion can lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Newmar will notify owners, and Ford or Lincoln dealers will inspect the HECU for missing valve block ball plugs, replacing the unit as necessary, free of charge. The recall began on January 24, 2018. Owners may contact Ford customer service at 1-866-436-7332 or Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 17V-768.

17V-843

Thor Motor Coach (TMC) is recalling certain 2018 Freedom Traveler motorhomes, model A27. These vehicles may be missing a heat shield between the liquid propane (LP) tank and the generator exhaust pipe. The missing heat shield can increase the risk of a fire. TMC has notified owners, and dealers will install the missing heat shield, free of charge. The recall began on January 12, 2018. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000150.

17V-844

Volvo Bus Corporation (Volvo) is recalling certain 2016-2018 9700 buses equipped with I-Start. The hardware that attaches the power supply cable to the fuse box may not be properly tightened, possibly causing the power cable and fuse box to overheat. The power cable and fuse box can overheat, increasing the risk of a fire. Volvo will notify owners, and dealers will inspect the fuse box for damage, and replace it if necessary, as well as replace and tighten the nuts attaching the power cable, free of charge. The recall is expected to begin February 1, 2018. Owners may contact Volvo customer service at 1-866-870-2046. Volvo's number for this recall is SR17-85.

17V-845

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Georgetown recreational vehicles, models GTA31L5, GTA31R5, GTA369XLF, GTA36B5, GTA36B5F, GTA377XLF, GTA378XLF, built on Ford chassis and equipped with Antilock Brake Systems (ABS). The brake Hydraulic Electronic Control Units (HECU) on these vehicles may be missing valve block ball plugs, potentially causing a brake fluid leak or air ingestion during electronic brake distribution and/or ABS activation. A brake fluid leak or air ingestion can lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Forest River will notify owners, and Ford or Lincoln dealers will inspect the HECU for missing valve block ball plugs, replacing the unit as necessary, free of charge. The recall is expected to begin February 23, 2018. Owners may contact Ford

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2017**

Published January 26, 2018

customer service at 1-866-436-7332 or Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 68-0606.

17V-846

ShowHauler Trucks, Inc. (ShowHauler) is recalling all 2003-2018 Garage Coach, Motorhome, and Toter Coach recreational vehicles. These motorhomes are equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers that may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit:

<https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. ShowHauler will notify owners to contact Kidde for a replacement fire extinguisher, free of charge. The recall is expected to begin February 28, 2018. Owners may contact Kidde customer service toll-free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information or owners may call ShowHauler customer service at 1-574-825-6764.

17V-847