

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

CHILD SEATS:

None during December 2019.

EQUIPMENT:

IMT Standen's Limited Partnership (Standen) is recalling certain 3 Leaf Tapered Springs, part numbers 355-00 and TRA 2727, sold as aftermarket replacements for installation on dry van or refrigerated and flatbed trailers. The leaf springs may crack allowing the leaf springs to break prematurely. If the leaf spring breaks, it can separate from the vehicle and become a road hazard, increasing the risk of a crash. Standen will notify owners, and will replace the springs, free of charge. The recall is expected to begin in January 2020. Owners may contact Standen customer service at 1-403-258-7800.

19E-081

Zamzow Mfg Co Inc. (Zamzow) is recalling one Aero Easy Cover tarping pawl assembly. The spring return pin within the pawl assembly may have not been tack welded, allowing the pawl assembly to separate from the hub on the manual crank assembly. Separation of the pawl assembly and hub may cause the swing arms on the Easy Cover tarping system to unexpectedly swing to the back of the dump body, increasing the risk of injury. Aero industries sent the affected customer a pawl retrofit kit, free of charge. Owners may contact Zamzow customer service at 1-816-483-5213.

19E-082

TIRES:

Cooper Tire & Rubber Co. (Cooper Tire) is recalling certain Cooper Evolution Tour, Mastercraft SRT Touring, Hercules Roadtour 455 Sport, Starfire Solarus AS and Mastercraft Stratus AS tires, all in size 225/50R17 and with DOT date code 3019. The subject tires were manufactured with an improper sidewall component. The improper sidewall component may cause tire deflation and tread separation, increasing the risk of a crash. Cooper Tire will notify owners, and dealers will replace the tires, free of charge. Consumers who have had their tires replaced before this recall may be eligible to receive reimbursement. The recall began January 2, 2020. Owners may contact Cooper Tire customer service at 1-800-854-6288. Cooper Tire's number for this recall is 175.

19T-024

Michelin North America, Inc. (Michelin) is recalling certain CrossClimate+ tires in size 225/60R17 103V XL tires with DOT date code 4618. The tires are not marked with the required UTQG treadwear, traction or temperature gradings. In addition, on the designated outboard sidewall and on the inboard sidewall, the ζ DOT ζ certification symbol, which precedes the TIN (Tire Identification Number) has not been molded into the sidewall. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 139, "New Pneumatic Radial Tires for Light Vehicles." Without the proper markings, the tires may not be used in the appropriate driving conditions, increasing the risk of a crash. Michelin will notify owners, and dealers will replace the tires, free of charge. The recall is expected to begin January 30, 2020. Owners may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

contact Michelin customer service at 1-866-324-2835.

19T-025

VEHICLES:

REV Ambulance Group Orlando, Inc. (REV) is recalling certain 2018-2019 Wheeled Coach Type 1 ambulances equipped with QR-D-S- and QR-TDS bracket assemblies used to secure D-cylinder oxygen tanks. The bracket may loosen, potentially allowing the oxygen tank to be unsecured. If the bracket loosens, in the event of a crash, the oxygen tank may become airborne, increasing the risk of injury. REV will notify owners, and Ziamatic Corp dealers will refund the purchase price paid, or provide replacement bracket assemblies, free of charge. Owners may contact REV customer service at 1-855-661-9232 or Ziamatic Corp customer service at 1-800-711-3473.

19V-854

Subaru of America, Inc. (Subaru) is recalling certain 2019 Ascent vehicles. The transmission hydraulic sensor may inaccurately measure the hydraulic fluid pressure. If the fluid pressure is measured higher than its actual value, the hydraulic pressure will be reduced. If this occurs, the transmission drive chain may not have the proper tension, resulting in a loss of drive power and an increased risk of a crash. Subaru will notify owners, and dealers will reprogram the transmission control unit. The hydraulic sensor harness will be replaced on vehicles with certain stored diagnostic trouble codes. In addition, any vehicle confirmed to have experienced low drive chain tension will have the transmission assembly replaced. All repairs will be free of charge. The recall is expected to begin January 24, 2020. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WUV-07.

19V-855

Subaru of America, Inc. (Subaru) is recalling certain 2019 Crosstrek, Forester, and Ascent vehicles. The aluminum Positive Crankcase Ventilation (PCV) valve can separate, allowing the separated components to enter the engine, resulting in a loss of power while driving. An unexpected loss of power while driving can increase the risk of a crash. Subaru will notify owners, and dealers will inspect and replace the PCV valve, free of charge. If the PCV valve has separated and the components cannot be found, the short block engine will be replaced, free of charge. The recall is expected to begin January 24, 2020. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WUW-08.

19V-856

Piaggio Group Americas, Inc. (Piaggio) is recalling certain 2020 Moto Guzzi V 85 TT motorcycles. The final drive output seal may leak oil onto the rear tire. An oil leak onto the rear tire may cause a loss of vehicle control, increasing the risk of a crash. Piaggio will notify owners, and dealers will inspect the final drive transmission box for an oil leak, and install an extra seal. If an oil leak is found, both seals and the gasket will be replaced. These repairs will be performed free of charge. Owners may contact Piaggio customer service at 1-212-380-4433. Piaggio's number for this recall is PGJZZQ1904.

19V-857

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

Piaggio Group Americas, Inc. (Piaggio) is recalling certain 2020 Moto Guzzi V 85 TT motorcycles. The footrest mounting pin retaining clip may break, allowing the pin to disconnect and the footrest to fall off the motorcycle. A footrest that falls off while the motorcycle is in motion may become a road hazard, increasing the risk of a crash. Piaggio will notify owners, and dealers will inspect the retaining rings on all four footrests. If any of the clips are found to be defective, the dealer will replace the retaining clips on all four footrest pins, free of charge. Owners may contact Piaggio customer service at 1-212-380-4433. Piaggio's number for this recall is PGJZZQ1905.

19V-858

Ford Motor Company (Ford) is recalling certain 2020 Explorer and Lincoln Aviator vehicles. Over time, the protective sleeve on the vapor fuel line may chafe through the plastic liquid fuel line and cause a fuel leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Ford will notify owners, and dealers will install a longer protective sleeve on the liquid fuel line, as necessary, free of charge. Owners will be notified of the safety risk with an interim letter on January 20, 2020. A second notice will be sent once parts are available, expected to be late in the first quarter of 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S49.

19V-859

REV Recreation Group (REV) is recalling certain 2016-2020 Fleetwood Bounder, Holiday Rambler Vacationer, and 2018-2020 Fleetwood Southwind motorhomes. The generator exhaust pipe placement exits the motorhome within the vehicle's departure angle. If the generator exhaust pipe is damaged, it may cause carbon monoxide to enter the vehicle, increasing the risk of an injury or death. REV will notify owners, and dealers will inspect, replace and reroute the generator exhaust pipe, free of charge. The recall is expected to begin January 31, 2020. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 191125REV.

19V-860

REV Recreation Group (REV) is recalling certain 2020 Fleetwood Pace Arrow LXE, Discovery and Discovery LXE, and Holiday Rambler Navigator and Endeavor motorhomes. The wire harness/plumbing bundle within the slideout raceway may have been improperly wrapped and secured. Without the proper securement, the wire harness/plumbing bundle can become damaged, increasing the risk of a fire. REV will notify owners, and dealers will inspect, repair, reroute and resecure the wire harness/plumbing bundle, free of charge. The recall is expected to begin January 31, 2020. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 191126REV.

19V-861

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2012-2015 Passat, 2011-2014 Golf A6, and 2011-2013 Audi A3 diesel vehicles, thought to have been previously repaired under one of the Takata air bag recalls. The driver's side air bag inflator may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, high temperatures, and high temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Volkswagen will notify owners, and dealers will replace the driver's side air bag inflators, free of charge. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

recall began December 20, 2019. Owners may contact Volkswagen customer service at 1-800-893-5298 or Audi customer service at 1-800-253-2834. Volkswagen's numbers for this recall are 69R6, 69Q8, 69Q9, and 69Y5.

19V-862

Bentley Motors, Inc. (Bentley) is recalling certain 2017-2018 Continental Supersports vehicles. The Power Assisted Steering (PAS) cooler pipe may be the incorrect size, allowing the cooler hose to detach and leak power steering fluid. A power steering fluid leak may cause a loss of vehicle control, or a hazard to following traffic, increasing the risk of a crash. In addition, the fluid leak in the presence of an ignition source can increase the risk of a fire. Bentley will notify the owners, and dealers will replace the PAS cooler pipe, free of charge. The recall began January 7, 2020. Owners may contact Bentley customer service at 1-800-777-6923. Bentley's number for this recall is RE19/27.

19V-863

Ford Motor Company (Ford) is recalling certain 2017-2019 Super Duty F-250, F-350, and F-450 trucks equipped with an electric tailgate latch release switch mounted in the tailgate handle. Water may enter the electrical wiring system and cause a short circuit, activating the switch and releasing the tailgate latches. Unintended tailgate opening may allow unrestrained cargo to fall out of the truck bed and become a road hazard, increasing the risk of a crash. Ford will notify owners, and dealers will modify the tailgate/frame wiring harnesses by adding jumper pigtailed to isolate the tailgate release control circuits and will install a new tailgate handle release switch, free of charge. The recall is expected to begin January 20, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S48.

19V-864

Honda (American Honda Motor Co.) is recalling certain 2019-2020 CR-V vehicles. The rear subframe bolts were improperly manufactured and may loosen, allowing the rear subframe to separate. A separated rear subframe reduces vehicle handling and can suddenly disable the vehicle, increasing the risk of a crash. Honda will notify owners, and dealers will inspect the rear subframe bolts and retorque them or replace them, as necessary, free of charge. The recall is expected to begin January 17, 2020. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is R6M.

19V-865

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2013-2015 Jetta Hybrid vehicles equipped with a DQ200 7-Speed DSG Automatic Transmission. Hairline cracks can develop within the transmission electronic gearbox (mechatronic unit), causing an internal transmission oil leak and a decrease in oil pressure. A decrease in transmission oil pressure can cause the clutch to fail to engage, resulting in a sudden loss of drive power, increasing the risk of a crash. Volkswagen will notify owners, and dealers will update the transmission software, free of charge. The software remedy is currently under development. The recall is expected to begin February 4, 2020. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 34J6.

19V-866

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

Mercedes-Benz USA, LLC. (MBUSA) is recalling one 2020 GLE450 4MATIC vehicle. The third-row seating headrests were manufactured with insufficient padding and a securing rod that may not hold the headrest in place, affecting the adjustment and operation of the headrest. The headrest may not properly protect the occupant in the event of a crash, increasing their risk of injury. MBUSA will notify the owner, and a dealer will replace the third row headrests, free of charge. The recall is expected to begin February 4, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-867

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2019 E53 AMG 4MATIC, E63 AMG 4MATIC Wagon, and E63S AMG 4MATIC Wagon vehicles. The incorrect driver air bag and software version may have been installed. Incorrect driver air bag and software version can cause the restraint systems to not function as intended during a crash, increasing the risk of injury. MBUSA will notify owners, and dealers will inspect and, as necessary, replace the driver's air bag and update the air bag software, free of charge. The recall is expected to begin February 4, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-868

Daimler Trucks North America LLC (DTNA) is recalling certain 2020-2021 Thomas Built Saf-T-Liner C2 school buses equipped with Detroit Diesel DD5 engines. The fan hub bolts may have been may have been insufficiently tightened. The loose bolts can cause the fan to damage surrounding components and/or detach from the engine, disabling the bus and resulting in an evacuation in an uncontrolled traffic situation, thereby increasing the risk of an injury. DTNA will notify owners, and dealers will inspect and repair the fan hub bolts, as necessary, free of charge. The recall expected to begin February 3, 2020. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-841.

19V-869

ARBOC Specialty Vehicles, LLC (ARBOC) is recalling certain 2017-2019 Spirit of Freedom and Spirit of Mobility vehicles equipped with Specialty Prolo Roof Hatches. The roof hatch external handle may unexpectedly break under reasonable use. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If the roof hatch external handle breaks, in the event of an emergency, the hatch cannot be easily opened from outside the vehicle, increasing the risk of injury. ARBOC will notify owners, and Specialty will replace the roof hatch handles free of charge. The recall began December 19, 2019. Owners may contact ARBOC customer service at 1-866-953-5555 or Specialty customer service at 1-800-951-7867.

19V-870

Proterra, Inc. (Proterra) is recalling certain 2019 Catalyst buses. A body controller software update may have disabled the audible and visible warnings that notifies the operator that the brake interlock could be engaged. If the vehicle does warn the driver that the brake interlock is engaged, the rear brakes may overheat, increasing the risk of a fire or crash. Proterra will notify owners, and dealers will update the body controller software, free of charge. The recall is expected to begin January 2020. Owners may contact Proterra customer service at 1-864-438-0000.

19V-871

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

Keystone RV Company (Keystone) is recalling certain 2020 Springdale trailers, models 1700FQ, 1750RD, 1760BH, 1790FQ, and 1800BH. The Federal Identification Tag lists incorrect rim size, tire size, and tire pressure information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." An incorrect label may lead to unintentionally overinflating the tires, affecting the vehicle's stability, which increases the risk of a crash. Keystone will notify owners, and will provide replacement Federal Identification Tags, free of charge. The recall is expected to begin January 15, 2020. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 20-366.

19V-872

Jayco, Inc. (Jayco) is recalling certain 2019-2020 White Hawk (144) travel trailers, model 24MBH. The rear emergency escape window can not fully open due to the placement of exterior ladder. In the event of an emergency, occupants may not be able to exit through the escape window, increasing risk of injury. Jayco will notify owners, and dealers will remove and relocate the existing ladder to prevent interference with the emergency escape safety window, free of charge. The recall began December 20, 2019. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901503.

19V-873

Marion Body Works Inc. (Marion Body Works) is recalling certain 2018-2019 Spartan Gladiator & Metro Star emergency response chassis. The brake relay valve may have an air flow restriction, which may result in an extended stopping distance. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If additional distance is needed to stop the vehicle, there would be an increased risk of crash. Marion Body Works will notify owners, and Spartan dealers will inspect and replace the valve, as necessary, free of charge. The recall began December 27, 2019. Owners may contact Marion Body Works customer service at 1-715-754-5261 or Spartan customer service at 1-800-543-5008.

19V-874

Porsche Cars North America, Inc. (Porsche) is recalling certain 2014 Cayman and Cayman S, 2014-2016 911 GT3, 2016 911 GT3 RS and 911 R, 2018 911 GT3 and 911 GT2 RS and 2019 911 GT3 RS, 911 GT3, and 911 GT2 RS vehicles. The Child Restraint System (CRS) instructions within the Owner's Manual may not provide enough specificity for proper installation. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 225, "Child Restraint Anchorage Systems." Improper CRS installation increases the risk of an injury to the occupant in the event of a crash. Porsche will notify owners, and dealers will provide a an Owner's Manual supplement with proper CRS installation instructions, free of charge. The recall is expected to begin February 9, 2020. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AKC0.

19V-875

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2019 Prius vehicles. An electrical short circuit in the combination meter could occur, causing the speedometer, the odometer, and the fuel gauge to go blank. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Controls and Displays." A blank main display will not show important information like

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

vehicle speed or fuel level. Driving with an inoperative display can increase the risk of a crash. Toyota will notify owners, and dealers will inspect the flash memory chip (ROM) production date, and if necessary, replace it along with the combination meter circuit board, free of charge. The recall is expected to begin February 3, 2020. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's numbers for this recall are 19TA21 and 19TB21.

19V-876

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2019-2020 C-HR and 2020 Corolla and Corolla Hybrid vehicles equipped with rear seat belt assemblies with a dual-mode locking mechanism. The seat belt webbing sensor locking mechanism may not lock as intended. In the event of a crash involving multiple impacts, the seat belt may not properly restrain the occupant, increasing the risk of injury. Toyota will notify owners, and dealers will inspect the rear seat belt assembly production dates, and replace the assemblies, as necessary, free of charge. The recall is expected to begin February 3, 2020. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's numbers for this recall are 19TB22 and 19TA22.

19V-877

Porsche Cars North America, Inc. (Porsche) is recalling certain 2020 911 Carrera S Coupe, Cabrio, Coupe, 4 Coupe, 4S Coupe, 4 Cabrio, 4S Cabrio, and S Cabrio vehicles. Due to a software error, the hazard warning lights may not function when activated by an operator. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the hazard warning lights cannot be activated, there is an increased risk of a crash in a hazard situation. Porsche will notify owners, and dealers will reprogram the control unit, free of charge. The recall is expected to begin February 9, 2020. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AKC1.

19V-878

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2019 Jetta GLI, Golf Alltrack, and Golf GTI vehicles. The front wheel bearings may have been improperly machined, potentially causing excessive stress on the wheel, wheel bolts, or wheel bearings. The excessive stress can cause steering, traction or other stability issues or breakage relating to the front wheels, and increase the risk of a crash. Volkswagen has notified owners, and dealers will replace the wheel bearing assemblies, wheels, and wheel bolts, free of charge. The recall began December 11, 2019. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 40P1. Note: The affected owners are advised not to drive their vehicles until the repairs have been made.

19V-879

Ford Motor Company (Ford) is recalling certain 2017-2019 F-Super Duty F-250, F-350, F-450, and F-550 SuperCrew Cab vehicles with carpet flooring. If a front seat belt pretensioner deploys as the result of a crash, the sparks may ignite materials such as carpeting or insulation within the B-pillar area. A vehicle fire could result if materials ignite inside the vehicle. Ford will notify owners, and dealers will apply heat resistant tape to the carpet and its insulation, and modify the B-Pillar insulation as necessary, free of charge. The recall is expected to begin January 20, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

recall is 19S52.

19V-880

Polaris Industries, Inc. (Polaris) is recalling certain 2019 Slingshot, Slingshot SL, Slingshot SLR, and Slingshot GT motorcycles. A 10A circuit breaker may be defective, tripping unexpectedly and causing a sudden loss of power and an engine stall. An engine stall increases the risk of a crash. Polaris will notify owners and provide a new 10A circuit breaker and installation instructions. Owners may choose to have the part installed at a dealership, free of charge. The recall is expected to begin January 2020. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is T-19-02.

19V-881

Indian Motorcycle Company (Indian) is recalling certain 2019 Chieftain, Vintage, Roadmaster, Dark Horse, Springfield, and FTR1200 motorcycles. A 10A circuit breaker may be defective, tripping unexpectedly and causing a sudden loss of power and an engine stall. An engine stall increases the risk of a crash. Indian will notify owners and provide a new 10A circuit breaker and installation instructions. Owners may choose to have the part installed at a dealership, free of charge. The recall is expected to begin January 2020. Owners may contact Indian customer service at 1-877-204-3697. Indian's number for this recall is I-19-05.

19V-882

BMW of North America, LLC (BMW) is recalling certain 2019-2020 M5 and 2020 M8 Gran Coupe, M8 Coupe, and M8 Convertible vehicles. The transmission wiring harness can become damaged, resulting in an electrical short circuit. An electrical short circuit can cause the transmission to shift to neutral resulting in a loss of propulsion, increasing the risk of a crash. BMW will notify owners, and dealers will replace any damaged transmission harnesses. All harnesses will be rerouted and secured. These repairs will be performed, free of charge. The recall is expected to begin February 3, 2020. Owners may contact BMW customer service at 1-800-525-7417.

19V-883

Triple E Recreational Vehicles (Triple E) is recalling certain 2020 Unity U24RL trailers. The propane tubing for the water heater may be routed too close to the tire tread possibly resulting in contact between the tire and the tubing. Tire contact with the propane tubing can create a hole in the tubing, releasing propane gas, increasing the risk of a fire in the presence of an ignition source. Triple E will notify owners, and dealers will install a metal shield around the propane tubing for protection, free of charge. The recall began December 30, 2019. Owners may contact Triple E customer service at 1-877-992-9906. Triple E's number for this recall is CA#9572-1.

19V-884

Chrysler (FCA US LLC) is recalling certain 2005-2006 Dodge Viper vehicles. The Occupant Restraint Control (ORC) module may inadvertently deploy the air bags and/or seat belt pretensioners. The unexpected deployment of the air bags and/or seat belt pretensioners increase the risk of injury and a crash. Chrysler will notify owners, and dealers will replace the ORC module, free of charge. The recall is expected to begin January 31, 2020. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is VE4.

19V-885

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

Chrysler (FCA US LLC) is recalling certain 2018-2019 Pacifica vehicles equipped with an 8.4 inch radio display, 360 degree surround view camera system, and seat back video screens. A software error can cause the rearview camera image to remain displayed on the radio after the vehicle has been shifted out of reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rearview Mirrors." The lingering rearview image can distract the driver, increasing the risk of a crash. Chrysler will notify owners, and dealers will update the radio software, free of charge. The recall is expected to begin January 31, 2020. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is VE2.

19V-886

Chrysler (FCA US LLC) is recalling certain 2019 Ram 1500 trucks. An incorrect Tire Pressure Monitoring System (TPMS) sensor could have been installed during production causing the sensor to not display the low tire pressure warning indicator. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems." Without a warning indicator, the driver will be unaware if low tire pressure occurs, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the TPMS sensor, free of charge. The recall is expected to begin January 31, 2020. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is VE1.

19V-887

General Motors LLC (GM) is recalling certain 2019-2020 Chevrolet Silverado 1500 and GMC Sierra 1500 trucks. The battery positive (B+) cable rings may have been manufactured with excessive glue, potentially causing an intermittent electrical connection between the B+ cable and alternator. An intermittent electrical connection between the B+ battery cable and the alternator could cause the vehicle to stall, increasing the risk of a crash. The intermittent connection could also lead to electrical arcing, which could generate sufficient heat to damage surrounding material, increasing the risk of a fire. GM will notify owners, and dealers will inspect for the presence of glue or other contamination at the B+ cable attachment to the alternator and clean the connection and reattach the B+ cable connection, as necessary. If arcing has damaged the cable, nut, or alternator, the dealer will replace the damaged components. All services will be performed free of charge. The recall is expected to begin January 27, 2020. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-888-988-7267. GM's number for this recall is N192273510.

19V-888

General Motors LLC (GM) is recalling certain 2019 Chevrolet Silverado 1500, Cadillac CT6, and GMC Sierra 1500 vehicles. Due to an Electronic Brake Control Module (EBCM) software error, the vehicle's Electronic Stability Control (ESC) and Antilock Brake System (ABS) may become disabled. Furthermore, if this specific error occurs, the vehicle's diagnostics will not illuminate the instrument cluster ESC and ABS malfunction warning lights. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control" and 135, "Light Vehicle Brake Systems." If the driver operates the vehicle unaware that ESC and ABS are not functioning, there is an increased risk of a crash. GM will notify owners, and dealers will reprogram the EBCM, free of charge. The recall is expected to begin January 27, 2020. Owners may contact Chevrolet customer service at 1-800-222-1020, Cadillac customer

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

service at 1-800-333-4223, or GMC customer service at 1-888-988-7267. GM's number for this recall is N192268090.

19V-889

Maintainer Corporation of Iowa, Inc. (Maintainer) is recalling one 2019 Custom Bodies Heavy Rescue emergency response vehicle. The brake relay valve may have an air flow restriction, which may result in an extended stopping distance. An increase in stopping distance increases the risk of crash. Maintainer has notified the owner, and a Spartan dealer will inspect and replace the valve, free of charge. The recall began on December 20, 2019. Owners may contact Maintainer customer service at 1-800-831-8588 or Spartan customer service at 1-800-543-5008.

19V-890

Forest River, Inc. (Forest River) is recalling certain 2020 Georgetown and FR3 motorhomes. The trailer hitch bolts may not have been properly tightened, which can allow cause the hitch to detach from the chassis. If the motorhome is towing a trailer or vehicle, the hitch detaching from the motorhome can the risk of a crash. Forest River will notify owners, and dealers will properly torque the bolts, free of charge. The recall began January 7, 2020. Owners may contact Forest River customer service at 1-574-296-7600. Forest River's number for this recall is 68-1119.

19V-891

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2015-2018 CLA250 and CLA250 4MATIC, and 2017-2018 CLA45 AMG vehicles. The Occupant Classification System (OCS) may have been improperly calibrated, which may prevent the proper deployment of the front passenger air bag. In the event of a crash, if the air bag does not deploy as designed, the front seat passenger has an increased risk of an injury. MBUSA will notify owners, and dealers will replace the passenger seat cushion, free of charge. The recall is expected to begin February 11, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-892

Foretravel, Inc. (Foretravel) is recalling certain 2020 Realm and iH45 vehicles built on a Spartan chassis. The brake relay valve may have an air flow restriction, which may result in an extended stopping distance. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." An increase in stopping distance increases the risk of crash. Foretravel will notify owners, and Spartan dealers will inspect and replace the valves, free of charge. The recall began December 16, 2019. Owners may contact Foretravel customer service at 1-800-955-6226.

19V-893

Maintainer Corporation of Iowa, Inc. (Maintainer) is recalling one 2019 Custom Bodies Heavy Rescue emergency response vehicle. The front shocks may separate from their upper mount on the front suspension. The loose shock may contact and damage the steering gear housing, possibly causing a steering fluid leak and a loss of power steering assist. A loss of power steering assist increases the risk of a crash. Maintainer has notified the owner, and a Spartan dealer will install new shock bolts, and shims if necessary, free of charge. The recall began December 20, 2019. Owners may contact Maintainer customer service at 1-800-831-8588 or Spartan

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

customer service at 1-800-543-5008.

19V-894

Mack Trucks, Inc. (Mack) is recalling certain 2019-2020 TerraPro (TE) vehicles. The headlamps may not be properly aimed, possibly reducing the driver's visibility. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Reduced visibility can increase the risk of a crash. Mack will notify owners, and dealers will inspect and readjust the headlamps, free of charge. The recall is expected to begin February 6, 2020. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0421.

19V-895

Mack Trucks, Inc. (Mack) is recalling certain 2020 Anthem (AN), Granite (GR), and Pinnacle (PI) vehicles. The castle nuts and cotter pins used to connect the steering drag link to the pitman arm and steering arm may have not been correctly installed, potentially causing separation of the drag link. If the drag link separates, loss of steering control may occur, increasing the risk of a crash. Mack will notify owners, and dealers will inspect the drag link attachment points, repairing them, as necessary, free of charge. The recall is expected to begin February 6, 2020. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0420.

19V-896

Oliver Travel Trailers Inc. (Oliver) is recalling certain 2017-2019 Elite II travel trailers. The nuts and bolts that secure the brake drum to the axle shaft flange may not have been properly tightened. The improperly tightened axle bolts/nuts may affect the trailer's braking ability or result in the hub and wheel becoming detached from the axle, increasing the risk of crash. Oliver has notified owners, and Dexter Axle dealers will retorque the bolts, as necessary, free of charge. The recall began December 20, 2019. Owners may contact Oliver customer service at 1-866-205-2621 or Dexter Axle customer service at 1-574-295-7888. Oliver's number for this recall is 1ZP-ABC19-12.

19V-897

Maintainer Corporation of Iowa, Inc. (Maintainer) is recalling certain 2015-2019 Custom Bodies Heavy Rescue emergency response vehicles equipped with a pneumatically-controlled automatic tire chain system. The air pressure control lines may not be pressure-protected. Without the control line being pressure-protected, in the event the control line is severed, air may suddenly be lost from the service reservoir system, causing the brakes to apply unexpectedly, increasing the risk of a crash. Maintainer has notified owners, and Spartan dealers will inspect the routing of the control lines, rerouting them into the auxiliary air reservoir as necessary, free of charge. The recall began December 23, 2019. Owners may contact Maintainer customer service at 1-800-831-8588 or Spartan customer service at 1-800-543-5008.

19V-898

Daimler Trucks North America LLC (DTNA) is recalling certain 2011-2021 Thomas Built Saf-T Liner HDX school buses built with a wall mounted barrier at the first rafter on the passenger side. The forward barrier may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

not provide sufficient protection. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." In the event of a crash, the occupant may come in contact with the barrier, experiencing a higher impact than intended, increasing the risk of injury. The remedy for this recall is still under development. The recall is expected to begin February 14, 2020. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-843.

19V-899

Prevost Cars, Inc. (Prevost) is recalling certain 2020 Prevost X3-45 VIP, X3-45 Passenger, H3-45 VIP, and H3-45 Passenger coach buses. The driveshaft clamp bolts may not be properly tightened. The driveshaft connection may separate resulting in a loss of drive. Additionally, a section of the driveshaft may detach from the vehicle, becoming a road hazard. Either condition increases the risk of a crash. Prevost has notified owners, and will replace and properly tighten the driveshaft clamp bolts, free of charge. The recall began December 19, 2019. Owners may contact Prevost customer service at 1-866-870-2046. Prevost's number for this recall is SR19-43.

19V-900

MORryde International, Inc. (MORryde) is recalling certain 2020 Forest River Georgetown and FR3 motorhomes that they modified. The trailer hitch bolts may have been improperly tightened, which can cause the hitch bolts to loosen. If the bolts loosen, a towed trailer or vehicle could detach from the motorhome, increasing the risk of a crash. Forest River will notify owners, and Forest River dealers will properly tighten the bolts, free of charge. The recall began December 9, 2019. Owners may contact MORryde customer service at 1-574-293-1581.

19V-901

Forest River, Inc. (Forest River) is recalling certain 2018-2020 Dynamax Isata motorhomes. The slim-rack slide out mechanisms may activate unintentionally, extending or retracting the slide room unexpectedly. If the slide-room extends or retracts unexpectedly, there is an increased risk of injury or a crash. Forest River will notify owners, and dealers will install a new controller and switch for the slideout mechanism, free of charge. The recall is expected to begin January 27, 2020. Owners may contact Forest River at 1-574-206-7600. Forest River's number for this recall is 55-1030.

19V-902

Ford Motor Company (Ford) is recalling certain 2020 F-150 trucks equipped with 17-inch spare tires. The spare tire could have been damaged when it was installed on the rim. The damage can cause the tire to rapidly lose air pressure or detach from the wheel, increasing the risk of a crash. Ford will notify owners, and dealers will replace the spare tire, free of charge. The recall is expected to begin January 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S55.

19V-903

Ford Motor Company (Ford) is recalling certain 2006-2010 Ford Fusion, Mercury Milan, Lincoln Zephyr and MKZ vehicles. The valves within the ABS Hydraulic Control Units (HCU) may react with brake fluids

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

containing specific corrosion preventative additives. This reaction may cause the valves to not close properly. If the valves do not properly close, additional brake pedal travel may be required to stop the vehicle, increasing the risk of a crash. Ford will notify owners, and dealers will flush the brake system with DOT 4 fluid and install a new brake fluid reservoir cap. In addition, the HCU will be tested to detect a possible stuck valve condition, replacing the HCU as necessary. All services will be performed free of charge. Owners will be notified of the safety risk with an interim letter on January 13, 2020. A second notice will be sent once parts are available, expected to be late in the first quarter of 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S54.

19V-904

Cruise Car, Inc. (Cruise Car) is recalling certain 2019 Moke vehicles. The vehicles may be equipped with a windshield of the incorrect glass quality rating. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 205, "Glazing Materials." The incorrect windshield could affect the driver's visibility, increasing the risk of a crash. Cruise Car will notify owners, and dealers will replace the windshield, free of charge. The recall is expected to begin January 2020. Owners may contact Cruise Car customer service at 1-941-929-1630.

19V-905

Airstream, Inc. (Airstream) is recalling certain 2018-2019 Interstate motorhomes. The Occupant and Cargo Carrying Capacity (OCCC) Label may indicate the incorrect occupant cargo carrying capacity, which can allow the vehicle to be overloaded. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Wheels and Rims - Other Than Passenger Cars." An incorrect label may lead to unintentionally overloading the vehicle, increasing the risk of a crash. Airstream will notify owners, and dealers will provide new OCCC labels with the correct occupant and cargo carry capacity, free of charge. The recall is expected to begin February 13, 2020. Owners may contact Airstream customer service at 1-877-596-6505 or 1-937-596-6111 extension 7401 or 7411.

19V-906

Mazda North American Operations (Mazda) is recalling certain 2019-2020 Mazda3 vehicles. The Smart Brake System (SBS) can falsely detect an obstacle while driving, activating the automatic emergency braking system and suddenly stopping the vehicle. Stopping the vehicle unexpectedly increases the risk of a crash. Mazda will notify owners, and dealers will update the SBS software. In addition, vehicles with certain production dates will receive an instrument cluster software update or replacement and a replacement owner's manual. These repairs will be performed free of charge. The recall is expected to begin February 17, 2020. Owners may contact Mazda customer service at 1-800-222-5500, Option 4. Mazda's number for this recall is 4219L.

19V-907

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Mercedes-Benz Sprinter and Freightliner Sprinter vehicles. The lashing rails on the side walls may not have been properly installed, possibly resulting in the lashing rails detaching. If the lashing rails disconnect, the cargo could become unsecured, increasing the risk of a crash. DVUSA will notify owners, and dealers will correctly affix the lashing rails to the side walls, free of charge. The recall is expected to begin February 10, 2020. Owners may contact DVUSA customer service at 1-877-762-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

8267. DVUSA's number for this recall is VS3ZUSCHI.

19V-908

Chrysler (FCA US LLC) is recalling certain 2020 Jeep Renegade and Fiat 500X vehicles. The right rear brake caliper could have been fractured during the casting process. A cracked right rear brake caliper can fail, reducing braking performance and increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect and replace the right rear brake calipers, as necessary, free of charge. The recall is expected to begin February 7, 2020. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is VE8.

19V-909

Subaru of America, Inc. (Subaru) is recalling certain 2016-2017 Outback vehicles. A replacement air bag control module may have been installed that is not compatible with the passenger air bag module, possibly affecting air bag deployment. In the event of a crash necessitating passenger frontal air bag deployment, the air bag may not deploy properly, increasing the risk of injury. Subaru will notify owners, and dealers will replace the passenger air bag module, free of charge. The recall is expected to begin February 14, 2020. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WUX-09.

19V-910

PACCAR Incorporated (PACCAR) is recalling certain 2020 Kenworth T800, T880 and W990 and Peterbilt 348, 367, 389, 520, and 567 vehicles. The forward rear axle output shafts may have been improperly heat treated during manufacturing, possibly resulting in the shafts fracturing. If the rear axle output shaft fractures, the shaft or interaxle driveline could detach and become a road hazard, increasing the risk of a crash. PACCAR will notify owners, and dealers will inspect and replace the output shafts, as necessary, free of charge. The recall is expected to begin February 19, 2020. Owners may contact Kenworth customer service at 1-425-828-5888 or Peterbilt customer service at 1-940-591-4220. PACCAR's numbers for this recall are 19KWE and 19PBG.

19V-911

BMW of North America, LLC (BMW) is recalling certain 2019-2020 330i and 330i xDrive vehicles. The outboard rear seat belt pretensioners may not lock as intended during a crash. In the event of a crash, if the seat belt pretensioners fail to lock, there is an increased risk of injury. BMW will notify owners, and dealers will replace the rear seat belts, free of charge. The recall is expected to begin February 10, 2020. Owners may contact BMW customer at 1-800-525-7417.

19V-912

SVI Trucks is recalling certain vehicles built on 2019 Spartan Emergency Response MetroStar chassis. The brake relay valve may have an air flow restriction, which may result in an increased stopping distance. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." A longer distance needed to stop the vehicle can increase the risk of crash. Spartan will notify owners, and Spartan dealers will inspect and replace the valves, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Spartan customer service at 1-800-543-5008 or SVI Trucks customer service at 1-888-784-1112.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

19V-913

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2019 GLC 300 4MATIC coupe, AMG GLC 43 Coupe, AMG GLC 43, AMG GLC 63, GLC 300, GLC 350e 4MATIC, GLC300 4MATIC, AMG GLC 63 Coupe, and AMG GLC 63 S Coupe vehicles. The passenger side sun visor may have incorrect air bag warning labels, written in a foreign language. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." If an air bag label is in a foreign language, an occupant may not be aware of the risks to children sitting in the front seat, increasing the risk of injury in the event of a crash. MBUSA will notify owners, and dealers will inspect the air bag warnings and replace them, as necessary, free of charge. The recall is expected to begin February 14, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-914

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2018 S560 and S450 vehicles. These vehicles may be equipped with front brake components (brake discs, calipers, and pads) with different dimensions than specified for the vehicle. The incorrect size brake components may lead to the wrong replacement components fitted to the vehicle during brake repairs, possibly affecting braking performance and increasing the risk of a crash. MBUSA will notify owners, and dealers will replace the front brake system, free of charge. The recall is expected to begin February 14, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-915

Daimler Trucks North America LLC (DTNA) is recalling certain 2020 FCC MT45G vehicles equipped with Ioxus 12V uSTART MD battery support modules. The uSTART module electronics can short circuit internally, causing the vehicle's battery to fully discharge into the uSTART module. A short circuit in the uStart module can increase the risk of a fire. DTNA will notify owners, and dealers remove the uSTART and replace it with an equivalent battery, free of charge. The recall is expected to begin February 17, 2020. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-842.

19V-916

PACCAR Incorporated (PACCAR) is recalling certain 2018-2019 Peterbilt 520 vehicles built in Right-Hand Stand-Up configuration. The steering assist cylinder bracket may not have been properly mounted. The improperly mounted steering assist cylinder bracket may break and cause damage to surrounding components and/or lock up the steering, increasing the risk of a crash. PACCAR will notify owners, and dealers will correct the mounting, free of charge. The recall is expected to begin February 20, 2020. Owners may contact Peterbilt customer service at 1-940-591-4220. PACCAR's number for this recall is 19PBF.

19V-917

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2001-2011 vehicles. The bonding between the glass panel and the sliding roof frame may deteriorate, possibly resulting in the glass panel detaching from the vehicle. For a full list of the affected models visit: <https://static.nhtsa.gov/odi/rcl/2019/RMISC-19V918-4126.pdf> A detached glass panel can separate from the vehicle and become a road hazard, increasing the risk of a crash. MBUSA will notify owners, and dealers will inspect the glass panel bonding and replace the sliding roof, as

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

necessary, free of charge. The recall is expected to begin February 14, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-918

Forest River, Inc. (Forest River) is recalling certain 2016-2018 Dynamax Rev and Coachmen Orion motorhomes built on Ram ProMaster chassis equipped with 3.0L diesel or 3.6L gasoline engines and air conditioning (A/C). The engine cooling fan may seize which can cause the cooling fan motor to overheat. An overheated fan motor increases the risk of a fire. Forest River will notify owners. The remedy for this recall is still under development. Forest River began sending interim notices on January 6, 2020. Final remedy notices will be sent when a final remedy is available. Owners may contact Forest River customer service at 1-800-348-7440 or Chrysler customer service at 1-800-853-1403. Forest River's number for this recall is 51-1121 and Chrysler's number for this recall is VB2.

19V-919

Riverside RV (Riverside) is recalling certain 2020 Intrepid recreational trailers. The stove top flame may invert to below the stove top when the furnace engages. If the stove flame inverts when the furnace engages, it can increase the risk of a fire. Riverside will notify owners, and dealers will install a panel to shut off air flow between furnace and stove, as necessary, free of charge. The recall began January 8, 2020. Owners may contact Riverside customer 1-260-499-4511.

19V-920

Aluminum Trailer Company (ATC) is recalling certain 2016-2019 Quest Stacker trailers. The guide block may fail causing the car lift to drop into the tilt position. While in tilt position, lift may become unseated from the ladder causing front end of lift to fall, increasing the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact ATC customer service at 1-877-441-2440, extension 342.

19V-921

Autocar, LLC (Autocar) is recalling certain 2015-2020 Xspotter vehicles. The headlamp relay may disconnect from the fuse box, causing the headlights to shut off. Headlights failing can cause reduced visibility, increasing the risk of a crash. Autocar will notify owners, and dealers will install a fuse box relay retainer, free of charge. The recall is expected to begin February 24, 2020. Owners may contact Autocar customer service at 1-888-218-3611 or 1-877-973-3486. Autocar's number for this recall is ACTT-2002.

19V-922

Autocar, LLC (Autocar) is recalling certain 2016-2019 Xspotter vehicles. Due to the placement of the shift pad, the shift pad may fail, and not display the transmission range or sequence. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 102, "Transmission Shift Lever Sequence/Starter Interlock/Transmission Braking Effect." If the shift pad display fails, the operator will not know the transmission range or sequence information, increasing the risk of a crash or injury. Autocar will notify owners, and dealers will relocate the shift pad, free of charge. The recall is expected to begin February 24, 2020. Owners may contact Autocar customer service at 1-888-218-3611 or 1-877-973-3486. Autocar's

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2019**

Published January 8, 2020

number for this recall is ACTT-2001.

19V-923

Motor Coach Industries (MCI) is recalling certain 2018-2020 D4505 and D4500 coaches equipped with an optional steerable tag axle. The tag axle mounting block clamps that retain the tie rod to obtain the forward steer orientation may slip, resulting in the tag axle being out of alignment. If the tag axle becomes misaligned with the front of the vehicle, the rear of the vehicle may strike other vehicles or pedestrians, increasing the risk of a crash or injury. MCI will notify owners, and dealers will replace the block clamps and retorque the fasteners, free of charge. The recall is expected to begin February 3, 2020. Owners may contact MCI customer service at 1-800-241-2947.

19V-924

Toyne Inc. (Toyne) is recalling certain vehicles built on 2018-2019 Spartan Emergency Response Metro Star and Gladiator chassis. The brake relay valve may have an air flow restriction, which may require an extended distance in order to stop the vehicle. An increase in stopping distance increases the risk of crash. Toyne will notify owners, and dealers will inspect and replace the valves, as necessary, free of charge. The recall is expected to begin in January 2020. Owners may contact Toyne customer service at 1-712-673-2328.

19V-925