

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

CHILD SEATS:

None during December 2020.

EQUIPMENT:

Curt Manufacturing LLC (Curt Manufacturing) is recalling certain Securelatch Adjustable Pintle Mounts, part number 48543. The 2" shank may fracture while hauling less weight than the advertised capacity. If the pintle mount fractures while being used, it can increase the risk of a crash. Curt Manufacturing will notify owners, and dealers will replace the pintle mount with a different style product, free of charge, or provide reimbursement. The recall began December 22, 2020. Owners may contact Curt Manufacturing customer service at 1-800-798-0813.

20E-089

Icon Vehicle Dynamics, LLC (Icon) is recalling all 05-UP FSD 2.5 Centerline Stabilizer Kits with part number 65050. The kits were sold as an accessory for certain 2005-2021 Ford F-250 4X4 and F-350 4X4 pickup trucks. The foam ring inside the stabilizer "through shaft" may block the piston ports, possibly causing the steering to lock up. If the steering locks, it can increase the risk of a crash. Icon will notify owners, and dealers will install a new shock assembly with a revised foam ring and steel support disc, free of charge. The recall began December 21, 2020. Owners may contact Icon customer service at 1-951-689-4266.

20E-090

Ohlins USA, Inc (Ohlins) is recalling certain Front Struts, part number POS 5N20. These struts were sold as part of Ohlins strut kits part number POZ MN02, intended for installation on 1999-2005 Porsche 911 Carrera 4 and 4S (generation 996), and 2001-2006 Porsche 911 Turbo / Turbo S (generation 996) and kit part number POZ MN05, intended for installation on 2005-2012 Porsche 911 Carrera 4 and 4S (generation 997), and 2006-2013 Porsche 911 Turbo / Turbo S (generation 997). The pin of the strut may experience excessive stress during maximum steering, possibly resulting breakage of the pin. If the pin fails, it will cause separation of the strut from the vehicle, affecting vehicle control and increasing the risk of a crash. Ohlins will notify owners, and dealers will request the return of all unsold kits containing the subject part from dealer/distributor inventory for a full refund. All owners who purchased one of the kits (POZ MN02 or POZ MN05) will receive replacement front struts (POS 5N20 or POS 5N21 - These parts are interchangeable), along with new top mount interface solutions, free of charge. The recall began December 22, 2020. Owners may contact Ohlins customer service at 1-800-336-9029.

20E-091

Bendix Commercial Vehicle Systems, LLC (Bendix) is recalling certain SL-4 Brake Light Pressure switches with part numbers K101993, K101996, K108141, and K108142 manufactured between December 1, 2019 and January 31, 2020. When air pressure is supplied to the brake light switch it may leak, possibly causing the internal electrical contacts to become jammed. Jammed electrical contacts in the brake light switch can cause the brake lights to remain illuminated, or fail to illuminate. Either of these scenarios can increase the risk of a crash. Bendix will notify owners, and dealers will replace the brake light switch, free of charge. The recall is expected to begin February 1, 2021. Owners may contact Bendix customer service at 1-877-345-9526.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

20E-092

Autosales Inc. (Autosales) is recalling certain Summit Racing 3-Ton Jack Stands, part number SUM-918005. The ratchet bar may fail during use, allowing a vehicle to fall without any warning. Under load, the stand may drop suddenly, increasing the risk of injury to people near or under a lifted vehicle. Autosales will notify owners, and Summit Racing will provide a full refund and an additional \$25.00 gift certificate, upon return or evidence of destruction. The recall is expected to begin in January 2021. Owners may contact Autosales customer service at 1-800-230-3030.

20E-093

Autosales Inc. (Autosales) is recalling certain Summit Racing 6-Ton Jack Stands, part number SUM-918006. The ratchet bar may fail during use, allowing the vehicle to fall without any warning. Under load, the stand may drop suddenly, increasing the risk of injury to people near or under a lifted vehicle. Autosales will notify owners, and Summit Racing will provide a full refund and an additional \$25.00 gift certificate, upon return of the stand or evidence of destruction. The recall is expected to begin in January 2021. Owners may contact Autosales customer service at 1-800-230-3030.

20E-094

TIRES:

None during December 2020.

VEHICLES:

Forest River, Inc. (Forest River) is recalling certain 2021 Coachmen Galleria motorhomes built on a Mercedes-Benz Sprinter chassis. The outer area of the brake hoses on the front and rear axles may have been damaged during production. The hoses could begin to leak brake fluid, affecting the braking performance of the vehicle, including the potential loss of directional stability when braking, thereby increasing the risk of a crash. Forest River will notify owners, and DVUSA dealers will check the condition of the brake hoses on the front and rear axles and replace them as needed, free of charge. The recall began December 10, 2020. Owners may contact Forest River customer service at 1-574-825-6310 or Daimler Vans customer service at 1-877-762-8267. Forest River's number for this recall is 51-1263.

20V-743

Vac-Tron Equipment, LLC is recalling certain 2016-2020 LP873XDT, 2015-2020 LP873SGT, 2019-2020 LPSGT and LPXDT excavator trailers. The trailers are not equipped with a rear impact guard. As such, these trailers fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 224, "Rear Impact Protection." If a vehicle strikes the rear of the vacuum excavator, the vehicle may travel under the rear of the vacuum excavator, increasing the risk of injury and/or death. Vac-Tron will notify owners, and dealers will install a field remedy kit, free of charge. The recall is expected to begin January 21, 2021. Owners may contact

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

Vac-Tron customer service at 1-877-342-5374. Vac-Tron's number for this recall is VVK0016.

20V-744

Halcore Group, Inc. (Halcore) is recalling certain 2020 Horton Emergency Vehicles Type I and III and ambulances equipped with Weldon i4G Vivtech Displays. The processor that runs the display may stop functioning without warning, causing items operated through the control panel to not function. If the control panel stops functioning, a delay in emergency services may occur, increasing the risk of injury. Halcore will notify owners, and dealers will inspect and repair the i4G Vivtech rear and/or front display within the serial number range, free of charge. The recall began December 8, 2020. Owners may contact Halcore customer service at 1-800-447-0343.

20V-745

Hyundai Motor America (Hyundai) is recalling certain 2015-2016 Veloster, 2012 Santa Fe, 2011-2013 Sonata Hybrid, and 2016 Sonata Hybrid vehicles. The connecting rod bearings inside the engine may wear prematurely, which over time can result in engine damage. A damaged engine can increase the risk of a fire or it can cause an engine stall, increasing the risk of a crash. Hyundai will notify owners, and dealers will inspect the engine. If bearing damage is found, the engine will be replaced. Dealers will also install a software update containing a new Knock Sensor Detection System (KSDS). Repairs will be performed free of charge. The recall is expected to begin January 22, 2021. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 198.

20V-746

Nissan North America, Inc. (Nissan) is recalling certain 2002-2006 Sentra vehicles whose passenger air bags were previously inspected and may have been released without replacing the Takata air bag inflator. In the event of a crash, Takata frontal passenger air bag inflators may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, high temperatures, and high temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Nissan will notify owners, and dealers will re-inspect the vehicle and, if necessary, replace the air bag inflator, free of charge. The recall is expected to begin January 2021. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's number for this recall is PM964.

20V-747

Hyundai Motor America (Hyundai) is recalling certain 2019-2020 Nexo Fuel Cell and 2019-2021 Kona Electric vehicles. The Integrated Electronic Brake (IEB) system may detect an abnormal sensor signal and as a result, may significantly reduce braking performance. Reduced braking power could lengthen the distance required to stop the vehicle, increasing the risk of a crash. Hyundai will notify owners, and dealers will update the IEB software, free of charge. The recall is expected to begin January 22, 2021. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 199.

20V-748

Volkswagen Group of America, Inc. (Audi) is recalling certain 2021 Audi A6 Allroad, Q7, RS6 and RS7 vehicles. The electrical connector can detach from the door crash sensor in either of the front doors. A detached

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

connector can delay the activation of the restraint systems, including the side air bag, curtain air bag and/or seat-belt pretensioners during a side impact crash, increasing the risk of injury. Audi will notify owners, and dealers will inspect, and as necessary, replace the crash sensors in both front doors, free of charge. The recall began December 23, 2020. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 69BM.

20V-749

Kia Motors America (Kia) is recalling certain 2012-2013 Sorento, 2012-2015 Forte and Forte Koup, 2011-2013 Optima Hybrid, 2014-2015 Soul, and 2012 Sportage vehicles. An engine compartment fire can occur while driving. An engine compartment fire increases the risk of injury. Kia will notify owners, and dealers will inspect the engine compartment for fuel and/or engine oil leaks, perform an engine test and make any repairs, including engine replacement, as necessary, free of charge. In addition, Kia is currently developing a Knock Sensor Detection System (KSDS) software update, which when available, will be performed by dealers free of charge. The recall is expected to begin January 27, 2021. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC200.

20V-750

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020 Discovery Sport and Range Rover Evoque vehicles. A software error may cause the instrument cluster to randomly alternate the speedometer and odometer units between Miles Per Hour (MPH) and Kilometers Per Hour (KM/H) without driver input to the display unit. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays." The changing displays may cause driver distraction or confusion and possibly result in excessive speed, which can increase the risk of a crash. Land Rover will notify owners, and dealers will update the vehicle software, free of charge. The recall is expected to begin January 29, 2021. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N516.

20V-751

E-One Incorporated (E-One) is recalling certain 2020-2021 Commercial, 2019-2020 Cyclone 2 and 2020 Cyclone N, Quest 2, Typhoon and Typhoon N vehicles, equipped with Weldon V-Mux Vista IV Standard LCD displays used for controlling emergency vehicle lighting and HVAC functions. These displays may experience low voltage spikes, causing the LCD display to lock up or become nonfunctional. A locked up or non-functional LCD display can delay emergency efforts, increasing the risk of injury. E-One will notify owners, and dealers will replace the display or apply a retrofit remedy, free of charge. E-One issued owners an interim notification on December 15, 2020. Owners may contact E-One customer service at 1-352-237-1122.

20V-752

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2019 A220 vehicles. Certain labels containing important information such as tire pressure may not have been installed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If the tires are inflated to an incorrect tire pressure, the tires may be overloaded, and increase the risk of a crash. MBUSA will notify owners, and dealers will inspect the vehicle for the labels and apply them, as

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

necessary, free of charge. The recall is expected to begin February 2, 2021. Owners may contact MBUSA customer service at 1-800-367-6372.

20V-753

Forest River, Inc. (Forest River) is recalling certain 2021 East to West Della Tera and Silver Lake recreational trailers. The outdoor grill may be able to be stowed away while the propane hose is still attached and while the burners are on. A grill that is stowed with the propane hose attached and the burner on can increase the risk of a fire. Forest River will notify owners, and to prevent the condition from occurring, dealers will move the propane hose connection to the edge of the drawer slide in the outside kitchen, free of charge. The recall is expected to begin January 16, 2021. Owners may contact Forest River customer service at 1-574-264-6664. Forest River's number for this recall is 500-1265.

20V-754

Nissan North America, Inc. (Nissan) is recalling certain 2011-2013 Infiniti M56, 2012-2013 M35 Hybrid, and 2014 Q70 and Q70 Hybrid vehicles. These models, equipped with 2WD and with a hybrid or VK56 powertrain, have a driveshaft that may break. A broken driveshaft can cause a loss of propulsion, increasing the risk of a crash, or may disable the parking brake, increasing the risk of a rollaway and injury. Infiniti will notify owners, and dealers will replace the driveshaft, free of charge. The recall is expected to begin January 29, 2021. Owners may contact Infiniti customer service at 1-800-662-6200.

20V-755

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Mercedes Benz Sprinter vehicles. These vehicles may have been delivered with a version of the printed and digital operator's manual that may be inaccurate and/or incomplete. If the operator relies on the provided owner's manual, the information about vehicle functions and other safety relevant information may be inaccurate and/or incomplete, which could lead to improper operation of the vehicle and potentially increase the risk of a crash or injury. DVUSA will notify owners, and dealers will replace the printed version of the operator's manual with the latest version and update the software of the digital version, free of charge. The recall is expected to begin January 18, 2021. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3PRIDIBA.

20V-756

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain 2020 Bridgemaster Mixer vehicles. These mixer trucks do not have the position at which the pusher axles should be operated listed on the information plate. If the position in which the pusher axles should be operated is not listed, the operator may not know how the pusher axle should be positioned while the vehicle is not carrying a load, increasing the risk of a crash. McNeilus will notify owners and provide a new information plate, free of charge. The recall began December 21, 2020. Owners may contact McNeilus customer service at 1-888-686-7278.

20V-758

Nissan North America, Inc. (Nissan) is recalling certain 2020 Titan and Titan XD pickup trucks. The engine wiring harness could contain an exposed wire that can cause an electrical short or arcing if it contacts another wire. An electrical short can impair the performance of the engine, transmission, or fuel pump, increasing the risk

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

of an engine stall and a crash. An electrical short or arcing increases the risk of a fire. Nissan will notify owners, and dealers will inspect the engine harness, replacing it if necessary, free of charge. The recall is expected to begin January 27, 2021. Owners may contact Nissan customer service at 1-800-647-7261

20V-759

Volkswagen Group of America, Inc. (Audi) is recalling certain 2018-2019 Audi RS5 Coupe vehicles. An incorrect positive battery terminal cover was installed. In the event of a rear crash, the incorrect cover can cause the 12-volt power supply to be compromised, preventing the vehicle doors from being opened from the outside, or the hazard warning lights from functioning, increasing risk of injury. Audi will notify owners, and dealers will replace the positive terminal cover, free of charge. The recall is expected to begin February 7, 2021. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 27i6.

20V-760

BMW of North America, LLC (BMW) is recalling certain 2021 M340i xDrive, M440i xDrive Coupe, 530i, 530i xDrive, 540i, 540i xDrive, 740Li, 740Li xDrive, 840i Gran Coupe, 840i xDrive Gran Coupe, X5 sDrive40i, X5 xDrive40i, X6 sDrive40i, X6 xDrive40i, and X7 xDrive40i vehicles. The connection between the 48-Volt battery and the starter-generator may not have been assembled properly, which can cause increased electrical resistance at the connections. Increased electrical resistance can increase the risk of a fire. BMW will notify owners, and dealers will inspect the connection between the 48-Volt battery and the starter-generator assembly, replacing it if necessary, free of charge. The recall is expected to begin February 1, 2021. Owners may contact BMW customer service at 1-800-525-7417.

20V-761

Spartan Fire, LLC (Spartan Fire) is recalling certain 2019-2021 Gladiator and MetroStar vehicles equipped with Weldon V-Mux Vista IV Standard LCD displays used for controlling emergency vehicle lighting and HVAC functions. These displays may experience low voltage spikes, and cause the LCD display to lock up or become nonfunctional, due to varying electrical installations. Operator of vehicle may not be able to read the LCD screen and may not be able to use buttons or both unless they reset the power. If the LCD display appears blank, emergency personnel may not have immediate access to the functions and controls operated by the LCD screen which could delay emergency operations, increasing the risk of injury. Spartan Fire will notify owners, and dealers will replace the unit or apply a retrofit remedy, free of charge. The recall began December 23, 2020. Owners may contact Spartan Fire customer service at 1-517-543-6400.

20V-762

Forest River, Inc. (Forest River) is recalling certain 2018-2020 RPOD travel trailers. The sewer termination bracket may fail, causing the plumbing to drag on the ground or to detach completely. If the plumbing were to detach, it can become a road hazard and increase the risk of a crash. Forest River will notify owners, and dealers will install a new securement bracket, free of charge. The recall is expected to begin January 19, 2021. Owners may contact Forest River customer service at 1-574-642-3119, option 2. Forest River's number for this recall is 51-1265.

20V-763

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

General Motors, LLC (GM) is recalling certain 2012-2013 Buick Regal, 2013 Chevrolet Malibu, and 2010-2013 Buick Lacrosse vehicles sold or ever registered in Connecticut, Delaware, the District of Columbia, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, or Wisconsin. These vehicles may have rear toe links that received excessive electrocoating (e-coat) corrosion protection, which could cause the e-coat to become brittle and break away when contacted by road debris. Over time, the e-coat may chip away, exposing the metal toe link and making it more susceptible to corrosion. Corrosion may eventually cause the toe link to thin and ultimately to fracture. A rear toe link fracture may reduce the driver's ability to control the vehicle, increasing the risk of a crash. GM will notify owners, and dealers will replace the rear suspension toe links and adjuster fasteners free of charge. Parts are not currently available. Owners will be mailed an interim notification on February 15, 2021. A second notification will be mailed when parts are available, currently expected to be around March 15, 2021. Owners may contact Buick customer service at 1-800-521-7300 or Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N202308930.

20V-764

Altec Industries, Inc. (Altec) is recalling certain 2018-2020 AA, AM, AN, A-Class, TA, DM, DL, DXXXX, DC, and DT digger derricks and aerial device vehicles equipped with a DC pump. A hydraulic check valve can have a snap ring failure resulting in the snap ring becoming lodged in a counterbalance or control valve allowing continued movement. Unintended boom movement may result in potential injury and or property damage. Altec will notify owners, and dealers will replace the valve's snap ring, free of charge. The recall is expected to begin February 10, 2021. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 787.

20V-765

Subaru of America, Inc. (Subaru) is recalling certain 2020 Legacy and Outback vehicles equipped with "high" grade and "mid" grade multimedia navigation. The August 2020 over-the-air software update may have timed out without completing the installation, corrupting the data, and causing the rearview display to shutoff intermittently. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility." The intermittent loss of the rearview image reduces the driver's visibility and increases the risk of crash. Subaru will notify owners, and dealers will reprogram the software and, if necessary, replace the Cockpit Control Module, free of charge. The recall is expected to begin January 22, 2021. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WRH-20.

20V-766

Forest River, Inc. (Forest River) is recalling certain 2020-2021 XLR Boost Toy Hauler recreational vehicles. The Federal Placard and Cargo Carrying Capacity (CCC) label may state a lower weight than the actual weight. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 120, "Wheels and Rims-Other Than Passenger Cars." An inaccurate weight on the Federal Placard can cause the vehicle to be overloaded, possibly causing damage to the tires and increasing the risk of a crash. Forest River will notify owners and will provide a new Federal Placard and replace any damaged tires, free of charge. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

recall is expected to begin January 18, 2021. Owners may contact Forest River customer service at 1-574-642-0432. Forest River's number for this recall is 79-1257.

20V-767

Honda (American Honda Motor Co.) is recalling certain 2002-2006 CR-V vehicles. Moisture may enter the driver side power window master switch, causing the switch to fail or melt. If the switch fails, it could overheat and smoke, increasing the risk of a fire. Honda will notify owners, and dealers will replace the power window master switch and inspect the wiring harness for damage, replacing it if necessary, free of charge. The recall is expected to begin January 18, 2021. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is P9D.

20V-768

Honda (American Honda Motor Co.) is recalling certain 2013-2015 Accord vehicles equipped with a 4-cylinder engine and a continuously-variable transmission that were originally sold, or ever registered, in Connecticut, Delaware, District of Columbia, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, and Wisconsin. The drive shafts were assembled with a lubricant that may have degraded the drive shafts' protective coating, making it more susceptible to damage from road salt or other contaminants, and potentially cause it to break. A broken drive shaft may cause a sudden loss of drive power. The vehicle could also roll away if the parking brake has not been applied before the vehicle has been exited. Either condition can increase the risk of a crash or injury. Honda will notify owners, and dealers will inspect the drive shafts, replacing both the left and right drive shafts, if necessary, free of charge. The recall is expected to begin February 1, 2021. Owners may contact Honda customer service at 1-888-234-2138.

20V-769

Honda (American Honda Motor Co.) is recalling certain 2013-2015 Acura ILX, 2013 Acura ILX Hybrid, 2012 Honda Civic Hybrid, and 2007-2008 Honda Fit vehicles with a manual transmission and 2009-2014 Honda Fit vehicles originally sold, or ever registered, in Connecticut, Delaware, District of Columbia, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, and Wisconsin. The drive shafts' protective coating may not have been applied properly during manufacturing, making it more susceptible to damage from road salt, or other contaminants, and potentially cause it to break. A broken drive shaft may cause a sudden loss of drive power. The vehicle could also roll away if the parking brake has not been applied before the vehicle has been exited. Either condition can increase the risk of a crash or injury. Honda will notify owners, and dealers will inspect the drive shafts, replacing either the left or right drive shaft, if necessary, free of charge. The recall is expected to begin February 1, 2021. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are E9B and A9A.

20V-770

Honda (American Honda Motor Co.) is recalling certain 2018-2020 Accord Sedan, Accord Hybrid, and 2019-2020 Insight vehicles. A software error may cause intermittent or continuous disruptions in communication between the Body Control Module (BCM) and other components. This may result in malfunctions of various

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

systems such as the windshield wipers and defroster, rearview camera, exterior lights, audible warning of a stopped vehicle, and power window operation. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 103, "Windshield Defrosting and Defogging Systems" and number 111, "Rear Visibility" as well as FMVSS numbers 104, 108, 114, 118 and 305. Various system malfunctions such as inoperative windshield wipers, defroster, rearview camera, or exterior lighting can increase the risk of a crash. Honda will notify owners, and dealers will update the BCM software, free of charge. The recall is expected to begin January 18, 2021. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is X95.

20V-771

Daimler Vans USA, LLC (DVUSA) is recalling one 2019 Mercedes-Benz Sprinter 2500 vehicle. The engine hood may not have been installed properly. In the event of a crash, the hood could make contact with the windshield, entering the passenger compartment and increasing the risk of an injury. DVUSA will notify the owner, and a dealer will replace the engine hood, free of charge. The recall is expected to begin January 18, 2021. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3SCHAUBE.

20V-772

Airstream, Inc. (Airstream) is recalling certain 2019 International, Flying Cloud, and Classic recreational trailers, equipped with Dometic 3 burner cooking stoves. The stove's saddle valve securing bolt may be overtightened, possibly damaging the O-ring seal and causing a continuous gas leak. A gas leak can increase the risk of a fire. Airstream will notify owners, and dealers will install a remedy kit of gaskets, washers, thread locker bolts, and two round orange labels, free of charge. The recall is expected to begin February 9, 2021. Owners may contact Airstream customer service at 877-596-6111 ext. 7491.

20V-773

Kawasaki Motors Corp., U.S.A. (KMC) is recalling certain 2021 Z400 ABS (ER400D), Ninja 400 (EX400H) and Ninja 400 ABS (EX400G) motorcycles. The strength of the camshaft chain tensioner may be insufficient due to improper heat treatment, possibly causing it to be damaged. A damaged camshaft chain tensioner can cause the engine to stall, increasing the risk of a crash. KMC will notify owners, and dealers will replace the camshaft chain tensioner, free of charge. Note: Owners are advised to not ride their motorcycles until the repair has been completed. The recall began December 21, 2020. Owners may contact KMC customer service at 1-866-802-9381. KMC's number for this recall is MC20-13.

20V-774

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2020 AMG GT vehicles. The headlights may have been incorrectly aimed too high. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamp, Reflective Devices and Associated Equipment." Incorrectly aimed headlights can reduce the visibility of oncoming traffic, increasing the risk of a crash. MBUSA will notify owners, and dealers will check the headlight aim, and correct it, if necessary, free of charge. The recall is expected to begin February 9, 2021. Owners may contact MBUSA customer service at 1-800-367-6372.

20V-775

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018-2020 AMG GLC 63 4MATIC vehicles. The power supply cable on the starter might not have been installed correctly, possibly allowing the cable to chafe against the starter housing and short-circuit. If the power supply cable short-circuits, it can result in a stall, increasing the risk of a crash. In addition, a short-circuit can increase the risk of a fire. MBUSA will notify owners, and dealers will inspect the starter harness and power supply cable installation, and correct it as necessary, free of charge. The recall is expected to begin February 9, 2021. Owners may contact MBUSA customer service at 1-800-367-6372.

20V-776

Altec Industries, Inc. (Altec) is recalling certain 2020 AN67-E100 articulating non-overcenter aerial device vehicles. The boom valve has a shuttle cartridge installed instead of a plug. The valve not having a plug could result in unintended boom movement, increasing the risk of an injury. Altec will notify owners and Parker Hannifan Corporation will provide a replacement plug, free of charge. The recall is expected to begin on February 4, 2021. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 789.

20V-777

Yamaha Motor Corporation, USA (Yamaha) is recalling certain 2019-2020 Skeeter ZXR, FXR, WR, ZX, WX, SX, and Solera Series boat trailers. The slide pins in the brake caliper assemblies may have been improperly torqued or assembled with the incorrect locking agent, allowing the brake calipers to dislodge. A dislodged brake caliper can cause a loss of trailer braking, increasing the risk of a crash. Skeeter will notify owners, and dealers will tighten or, as necessary replace, the slide pins, free of charge. The recall is expected to begin January 2021. Owners may contact Skeeter customer service at 1-903-984-0541 or at www.skeeterboats.com.

20V-778

Rosenbauer America (Rosenbauer) is recalling certain 2018-2021 Commander and 2019-2020 Warrior vehicles equipped with Weldon V-Mux Vista IV Standard LCD displays used for controlling emergency vehicle lighting and HVAC functions. These displays may experience low voltage spikes and cause the LCD display to lock up or become nonfunctional, due to varying electrical installations. If the LCD display becomes locked up or non-functional it can delay emergency efforts, which can increase the risk of injury. Rosenbauer will notify owners, and dealers will repair or replace the IV Standard LCD displays, free of charge. Owners may contact Rosenbauer customer service at 1-651-462-1000. Rosenbauer's number for this recall is 20E-078.

20V-779

Jayco, Inc. (Jayco) is recalling certain 2020-2021 Greyhawk, Greyhawk Pestige, Redhawk, Redhawk SE, Odyssey, and Esteem motorhomes. The mounting brackets for the leveling system hydraulic pump and reservoir may fail, allowing the components to contact the ground. Contact with the ground may cause the pump and reservoir to detach or leak hydraulic fluids, increasing the risk of a crash. Jayco will notify owners, and dealers will install a new support bracket, free of charge. The recall is expected to begin January 31, 2021. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9903528.

20V-780

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

Ducati North America (Ducati) is recalling certain 2018-2021 Scrambler 1100 motorcycles. The exhaust valve cable could contact the main positive battery wire and potentially short-circuit. An electrical short-circuit increases the risk of fire. Ducati will notify owners, and dealers will install a new cable guide and self-locking cable tie to the exhaust valve cable, free of charge. The recall is expected to begin January 25, 2021. Owners may contact Ducati customer service at 1-888-391-5446. Ducati's number for this recall is SRV-RCL-20-003.

20V-781

Volvo Trucks North America (Volvo Trucks) is recalling 2021 VNL, VNR, VAH, and VHD vehicles. The collets (internal jaws) for the brass fitting inserts used in the pneumatic pass-through plate may have been damaged during leak testing. As a result, the brass fitting may completely release the air brake line from the pass-through plate while under pressure. If this occurs on the park brake circuit, signal pressure that holds off the mechanical spring in the park brake chambers will be lost allowing the park brakes to apply. If the park brakes apply unexpectedly, the driver may lose control of the vehicle, increasing the risk of a vehicle crash. Volvo Trucks will notify owners, and dealers will inspect the air brake line for proper engagement of the fitting in the pass-through plate, free of charge. The recall is expected to begin January 31, 2021. Owners may contact Volvo Trucks customer service at 1-800-528-6586. Volvo Trucks' number for this recall is RVXX2006.

20V-782

Halcore Group, Inc. (Halcore) is recalling certain 2020-2021 American Emergency Vehicle Traumahawk Type I Ram 4500, 2020 American Emergency Vehicle Type I Ford F-450 and Ford F-550, and 2021 American Emergency Vehicle Medium Duty Ambulance Freightliner M2 vehicles, equipped with Weldon V-Mux Vista IV Standard LCD displays used for controlling emergency vehicle lighting and HVAC functions. These displays may experience low voltage spikes, and cause the LCD display to lock up or become nonfunctional, due to varying electrical installations. If the LCD display becomes locked up or non-functional it can delay emergency efforts, which can increase the risk of injury. Halcore will notify owners, and dealers will provide updated replacement Vista IV units, free of charge. Owners may contact Halcore customer service at 1-800-447-0343. Halcore's number for this recall is 20E-078.

20V-783

Aston Martin The Americas (Aston Martin) is recalling certain 2021 DBX vehicles. The vehicles were incorrectly built without headliner foam blocks. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 201, "Occupant Protection in Interior Impact." The missing foam blocks can increase the risk of injury to unbelted occupants in the event of a crash. Aston Martin will notify owners, and dealers will install the headliner foam blocks, free of charge. The recall is expected to begin January 31, 2021. Owners may contact Aston Martin customer service at 1-888-923-9988. Aston Martin's number for this recall is RA-30-1471.

20V-784

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2012-2014 Volkswagen Beetle and Beetle Convertible vehicles. The driver's side air bag inflator may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, high temperatures, and high temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

injury or death. Volkswagen will notify owners, and dealers will replace the driver frontal air bag, free of charge. The recall is expected to begin February 12, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 69BC.

20V-785

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2020 Audi Q3 vehicles. The brake pedal plate can bend or detach under the pressure applied during sudden stopping. A bent or detached brake pedal plate decreases the contact area for the driver's foot and increases the risk of a crash. Audi will notify owners, and dealers will inspect the weld between the brake pedal and the brake pedal plate and, as necessary, replace the entire brake pedal, free of charge. The recall is expected to begin January 31, 2021. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 46i7.

20V-786

Daimler Trucks North America, LLC (DTNA) is recalling certain 2021 Thomas Built Saf-T-Liner C2 Jouley electric school buses. If the service brake pedal is pressed and then released while the parking brake is engaged, the parking brake may release unexpectedly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." An unexpected disengagement of the parking brake without continual application of the service brake may allow the vehicle to roll freely, increasing the risk of a vehicle crash. DTNA will notify owners, and dealers will update the electronic control unit (ECU) software, free of charge. The recall is expected to begin February 13, 2021. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-870.

20V-787

Ford Motor Company (Ford) is recalling certain 2020-2021 Explorer and Lincoln Aviator vehicles. The right hand motor mount fasteners may have been incorrectly tightened, and may loosen over time. With a loose motor mount, motor vibration may cause the axle to disconnect from the engine and could result in loss of power, increasing the risk of a crash. Ford will notify owners, and dealers will remove and replace the right hand motor mount fasteners, free of charge. The recall is expected to begin February 8, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20S72.

20V-788

Navistar, Inc. (Navistar) is recalling certain 2021-2022 IC Bus CE school buses. The weather seal of the illuminated stop sign unit may allow contaminants to enter into the unit, resulting in reduced performance. In certain cases, an electrical short may occur which would render the unit inoperable. If the sign performance is inhibited, or completely inoperable, it can reduce the visibility for oncoming drivers, increasing the risk of a crash. Navistar will notify owners, and dealers will replace the LED illuminated school bus signs, free of charge. The recall is expected to begin in January 2021. Owners may contact Navistar customer service at 1-800-448-7825.

20V-789

General Motors, LLC (GM) is recalling certain 2021 Cadillac Escalade and Escalade ESV vehicles. The front passenger seat belt and airbag status telltale lights located in the overhead console in these vehicles may be set to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

"night mode" when the vehicle is started using remote start or when the vehicle is turned off and re-started after approximately ten minutes without opening the door. In daytime, if night mode is active, the telltale lights may not be visible, and fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 101, "Control and Displays" and 208, "Occupant Crash Protection." If the telltale lights are not visible, the driver and front passenger may not know that the front passenger is unbuckled or has a deactivated air bag, increasing the risk of passenger injury in a crash. GM will notify owners, and dealers will update the software free of charge. The recall is expected to begin February 1, 2021. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is N202319980.

20V-790

Ford Motor Company (Ford) is recalling certain 2020 EcoSport and 2019-2020 Transit Connect vehicles. Depending on the model, either the driver side or passenger side frontal air bag modules are missing the first-stage booster propellant and sleeve. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." Air bag modules missing the first-stage booster propellant will not deploy as intended in a crash, increasing the risk of injury. Ford will notify owners, and dealers will replace the affected air bag module on either the driver or passenger side, free of charge. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20C26.

20V-791

General Motors, LLC (GM) is recalling certain 2019-2021 Chevrolet Silverado 1500 and GMC Sierra 1500, 2021 Chevrolet Suburban and Tahoe and GMC Yukon XL and 2020-2021 Chevrolet Silverado 2500 and 3500 and GMC Sierra 2500 and 3500 vehicles. The seat belt brackets may not be secured to the seat frame in the front-row center seating position. If a seat-belt bracket is not secured, the seat belt may not properly restrain an occupant in the front-row center seat position, increasing the risk of injury in a crash. GM will notify owners, and dealers will inspect left-side and right-side front-row center seat-belt bracket attachments and reassemble it correctly as necessary, free of charge. The recall is expected to begin February 1, 2021. Owners may contact GMC customer service at 1-800-462-8782, Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N202314670.

20V-792

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020 Range Rover Evoque vehicles equipped with a replacement part for the second-row seat belt assembly. These seat belt assemblies may not function properly in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standards (FMVSS) numbers 208, "Occupant Crash Protection" and 209, "Seat Belt Assemblies." Seat belts that do not function properly can increase the risk of injury during a crash. Land Rover will notify owners, and dealers will replace the second-row seat belt assemblies, free of charge. The recall is expected to begin February 12, 2021. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N523.

20V-793

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020 Range Rover Evoque vehicles

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

equipped with climate specification front seats trimmed with "Dinamica" cloth. In the event of a fire, the seat material may burn quicker than allowed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 302, "Flammability of Interior Materials." A seat cover that burns too quickly can increase the risk of injury in the event of a fire. Land Rover will notify owners, and dealers will replace the front seat covers, free of charge. The recall is expected to begin February 12, 2021. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N524.

20V-794

Ford Motor Company (Ford) is recalling certain 2021 E-350 and E-450 vehicles. The underside of the engine cover may have mispositioned insulation, allowing the cover to get excessively hot. Direct and continuous contact with certain areas of engine cover surface in the passenger compartment may increase the risk of injury or burns to the skin of the driver or front seat passenger. Ford will notify owners, and dealers will inspect the engine cover for gaps between the rubber seal and the insulation. If gaps are present, the dealer will install engine cover insulation patches in the right hand and left hand inner lower corners of the engine cover. The dealer will also update the powertrain calibration for heat management under elevated idle conditions should a vehicle be equipped with SEIC or BCP, free of charge. The recall is expected to begin February 8, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20S73.

20V-795

Jayco, Inc. (Jayco) is recalling certain 2016-2020 Seneca Class C motorhomes. The mounting brackets for the leveling system hydraulic pump and reservoir may fail, allowing the components to contact the ground. Contact with the ground may cause the pump and reservoir to detach or leak hydraulic fluids, increasing the risk of a crash. The remedy for this recall is currently under development. The recall is expected to begin February 15, 2021. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9903529.

20V-796

Honda (American Honda Motor Co.) is recalling certain 2018-2019 Africa Twin Adventure Sports (CRF1000L) and 2020 Africa Twin Adventure Sports (CRF1100L) motorcycles. Contaminants inside the fuel tank may cause the fuel filter to clog, possibly resulting in an engine stall. An engine stall can increase the risk of a crash or injury. Honda will notify owners, and dealers will drain and clean the fuel tank, and replace the fuel filter assembly, free of charge. The recall is expected to begin February 15, 2021. Owners may contact Honda customer service at 1-866-784-1870. Honda's number for this recall is KL4.

20V-797

Honda (American Honda Motor Co.) is recalling certain 2020 CR-V Hybrid, Accord Hybrid, and 2020-2021 Insight vehicles. The DC-DC converter may shut down and prevent the 12-volt battery from recharging, possibly resulting in a loss of drive power. A loss of drive power can increase the risk of a crash. Honda will notify owners, and dealers will update the power converter unit (PCU) software, free of charge. The recall is expected to begin February 25, 2021. Owners can contact Honda customer service at 1-888-234-2138. Honda's number for this recall is K9E.

20V-798

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

Forest River, Inc. (Forest River) is recalling certain 2021 Puma travel trailers. The outdoor cooktop may be stowed away while the propane hose is still attached and the burner is on. If the cooktop is stowed away while the propane hose is attached and the burner is on, it will increase the risk of a fire. Forest River will notify owners, and dealers will install a bracket to the drawer housing the outside cooktop preventing the drawer from being closed while the propane line is still attached, free of charge. The recall is expected to begin January 27, 2021. Owners may contact Forest River customer service at 1-574-642-0606. Forest River's number for this recall is 425-1269.

20V-799

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2019-2020 AMG GT53 4MATIC and AMG GT63 4MATIC vehicles. The wheel-hub caps may detach while driving. If the wheel-hub caps detach, they can become a road hazard, and increase the risk of a crash or injury for other road users. MBUSA will notify owners, and dealers will replace the wheel-hub caps, free of charge. The recall is expected to begin February 16, 2021. Owners may contact MBUSA customer service at 1-800-367-6372.

20V-800

Keystone RV Company (Keystone) is recalling certain 2020 Cougar 22MLS, 22RBS, 25RDS, 26RBS, 26RKS, 27RES, 29BHS, 30RKD, 31MBS, 32RLI and 34TSB recreational trailers equipped with a Solar Prep or an off-the-grid "OTG" Solar Camping Package. The Solar Prep wiring to the 12VDC breakers located by the battery may not be connected to the protected side of the breaker. Since it is not connected properly to the breaker, if the Solar Prep wiring experiences an electrical short, it will increase the risk of a fire. Keystone will notify owners, and dealers will inspect the installation of the Solar Prep wiring at the circuit breaker mounted close to the battery and remount the wiring if needed, free of charge. The recall is expected to begin February 12, 2021. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 21-392.

20V-801

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019-2020 Mercedes-Benz Sprinter and Freightliner Sprinter vehicles equipped with electric parking brakes. The rear brake calipers may leak brake fluid into the housing of the electric parking brake connected to the rear axle service brake system, allowing air to enter the hydraulic brake system. Air in the brake system can result in extended brake pedal travel, increasing the risk of a crash. DVUSA has not yet established a remedy. The recall is expected to begin January 25, 2021. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3BREPB.

20V-802

Volvo Bus Corporation (Volvo Bus) is recalling certain 2015-2020 9700 buses. The transmission C1 hub may fail which may lead to a disabled vehicle. A disabled bus may require passengers to transfer to a different bus on the side of the road, increasing the risk of injury. Volvo Bus will notify owners, and dealers will update the Transmission Control Module (TCM) calibration software, free of charge. The recall is expected to begin February 12, 2021. Owners may contact Volvo Bus customer service at 1-866-870-2046.

20V-803

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

Thor Motor Coach (TMC) is recalling certain 2018-2019 Hurricane and Windsport motorhomes. The overhead cabinets located above the driver and front passenger seats may detach and fall onto the seat occupants, possibly causing the driver to lose control of the vehicle. A loss of vehicle control can increase the risk of a crash. TMC will notify owners, and dealers will inspect the overhead cabinets, and reinstall them as necessary, free of charge. The recall is expected to begin February 5, 2021. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000208.

20V-804

SVI Trucks is recalling certain 2020 Fire Rescue Trucks equipped with Weldon V-MUX Vista IV displays. The lighting and HVAC display may lock up affecting functions like the back up camera, emergency warning lights, or patient care devices depending on the application. If the LCD display becomes locked up or non-functional it can delay emergency efforts, which can increase the risk of an injury. SVI Trucks will notify owners, and dealers will repair or replace the IV Standard LCD displays, free of charge. Owners may contact SVI Trucks customer service at 1-888-784-1112. SVI Trucks' number for this recall is 20E078.

20V-805

Daimler Trucks North America, LLC (DTNA) is recalling certain 2022 Thomas Built Saf-T-Liner C2 school buses. The hydraulic caliper tie bar support fasteners on the steer axles may not have been properly tightened or the tie bar may have not been installed in some cases. A dangling tie bar could come in contact with the rotating wheel-end components or damage may occur from the brake parts flexing. Either scenario may increase the risk of a crash. DTNA will notify owners, and dealers will inspect both steer axle wheel-ends to make sure that the four tie bar mounting fasteners are properly tightened. If the required tie bar is missing, the caliper anchor mounts and functionality (brake pad slide pins and pad movement) will be inspected before installing a tie bar. All repairs will be performed free of charge. The recall is expected to begin February 18, 2021. DTNA's number for this recall is FL-871.

20V-806

Daimler Trucks North America, LLC (DTNA) is recalling certain 2021 Freightliner Custom Chassis MC, Business Class M2, Custom Chassis MBC Chassis, Custom Chassis S2 Chassis, Custom Chassis MT55 Chassis, and 2022 Custom Chassis Saf-T-Liner C2 vehicles. The hydraulic caliper tie bar support fasteners on the steer axles may not have been properly tightened or the tie bar may have not been installed in some cases. A dangling tie bar could come in contact with the rotating wheel-end components or damage may occur from the brake parts flexing. Either scenario may increase the risk of a crash. DTNA will notify owners, and dealers will inspect both steer axle wheel-ends to make sure that the four tie bar mounting fasteners are properly tightened. If the required tie bar is missing, the caliper anchor mounts and functionality (brake pad slide pins and pad movement) will be inspected before installing a tie bar. All repairs will be performed free of charge. The recall is expected to begin February 18, 2021. DTNA's number for this recall is FL-871.

20V-807

General Motors, LLC (GM) is recalling certain 2020 Chevrolet Bolt EV vehicles. These vehicles may have an improperly cast front left brake caliper that can fracture during a high-pressure braking event. If a brake caliper fractures and brake fluid is lost, the vehicle may experience reduced brake performance, increasing the risk of a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

crash. GM will notify owners, and dealers will inspect the casting lot number on the front left brake caliper and replace it if necessary, free of charge. The recall is expected to begin February 5, 2021. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N202321400.

20V-808

Escape Trailer is recalling certain 2020 19, 21C, 21NE and 5.0 RV trailers equipped with Dometic 3 burner cooking stoves. The stove's saddle valve securing bolt may be overtightened, possibly damaging the O-ring seal and causing a continuous gas leak. A gas leak can increase the risk of a fire. Escape Trailer will notify owners, instructing them to visit a Dometic repair center that will install a remedy kit of gaskets, washers, thread locker bolts, and two round orange labels, free of charge. The recall is expected to begin February 10, 2021. Owners may contact Escape Trailer customer service at 1-604-703-1650. Escape Trailer's number for this recall is E012020.

20V-809

Navistar, Inc. (Navistar) is recalling certain 2019-2021 International MV, 2020-2021 International HV, 2014-2020 International DuraStar and 2015-2018 International WorkStar vehicles. When the parking brake is applied and the automatic transmission is still in the drive or reverse position and the stationary PTO switch is engaged by the operator, the engine may rev and overcome the parking brake's ability to keep the vehicle from moving. Unexpected Vehicle movement can increase the risk of a crash or injury. Navistar will notify owners, and dealers will update the parameters in the Cummins ECM for feature codes 12VXT or 12VXU that enables the PTO neutral interlock, free of charge. The recall is expected to begin February 19, 2021. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 20510.

20V-810

General Motors, LLC (GM) is recalling certain 2020 Chevrolet Bolt EV and 2021 GMC Canyon and Sierra 1500, 2500 and 3500, Yukon, Yukon XL, Cadillac Escalade and Escalade ESV and Chevrolet Blazer, Camaro, Colorado, Equinox, Silverado 1500, 2500 and 3500, Suburban and Tahoe vehicles. Incorrect bolts may have been used at one or more fastening locations to secure the seat belts to the vehicle. If an incorrect bolt was used, the seat belt may not be properly attached to the vehicle. If a seat belt assembly is not properly attached to the vehicle, the seat belt may not properly restrain an occupant in the event of a crash, increasing the risk of injury. GM will notify owners, and dealers will replace the suspect bolts, free of charge. The recall is expected to begin February 6, 2021. Owners may contact GMC customer service at 1-800-462-8785, Cadillac customer service at 1-800-458-8006, or Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N202322230.

20V-811

Marion Body Works Inc. is recalling certain 2020 Spartan Gladiator and MetroStar vehicles equipped with Weldon V-Mux Vista IV Standard LCD displays used for controlling emergency vehicle lighting and HVAC functions. These displays may experience low voltage spikes, and cause the LCD display to lock up or become nonfunctional, due to varying electrical installations. If the LCD display becomes locked up or non-functional it can delay emergency efforts, which can increase the risk of injury. Marion Body Works will notify owners, and dealers will replace the IV Standard LCD displays, free of charge. Owners may contact Marion Body Works

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING DECEMBER 2020**

Published January 8, 2021

customer service at 1-715-754-5261. Marion Body Works' number for this recall is 20V-762.

20V-812

Yamaha Motor Corporation, USA (Yamaha) is recalling certain 2016-2020 Yamaha FJR13A and FJR13AE motorcycles. The second gear of the transmission can crack and break under high speed loads. A broken gear can cause the transmission and rear wheel to lock causing a loss of control and increasing the risk of a crash. Yamaha will notify owners, and dealers will inspect and, as necessary, reprogram the Engine Control Unit (ECU) and replace the main axle and drive axle assemblies, free of charge. The recall is expected to begin January 13, 2021. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990141. Note: Owners are advised not to operate their motorcycle until the repairs have been performed.

20V-813

Yamaha Motor Corporation, USA (Yamaha) is recalling certain 2018-2020 MTT9GT (Tracer GT), 2019 MXTGTKL (NIKEN GT), 2017-2020 MT10, 2018-2020 XTZ12 (Super Ténéré), 2013-2020 FJR13, 2018 XV19B (Star Eluder), and 2018-2021 XV19 (Star Venture) motorcycles. The front brake switch can fail due to increased resistance from silicon oxide. Failure of the front brake switch can cause the brake light to stay on constantly and/or the cruise control system to shutoff unexpectedly. Both situations increases the risk of a crash. Yamaha will notify owners, and dealers will replace the front brake switch, free of charge. The recall is expected to begin January 13, 2021. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990140. Note: Owners are advised not to operate their motorcycle until the repairs have been performed.

20V-814