





XXXXXXXXXXXX	XXXXXXXXXXXX			XXXXXXXXXXXX	XXXXXXXXXXXX	XXXXXXXXXXXX
Dealer Operator / General Manager	Sales New Vehicles	Sales Used Vehicles	Business Manager (F&I)	Service	Parts & Accessories	Administration
Date: 12/13/2013 Bulletin # SV-ZMC-R-059 Safety recall Code 13V-059 2012 & 2013 Firmware update Controller.		Source: Zero Motorcycles Aftersales Department Name: Richard Kenton Title: Service and Technical Dept. Phone #: 888-786-9376 ext 43				Program Period: 12/10/2013 -06/29/2014


3. Connect the programming cable to the controller and attach the alligator clip to the B- side of the auxiliary charge connector. Note, this is the side without the slot. Make sure you look as this connector can be mounted in either direction.

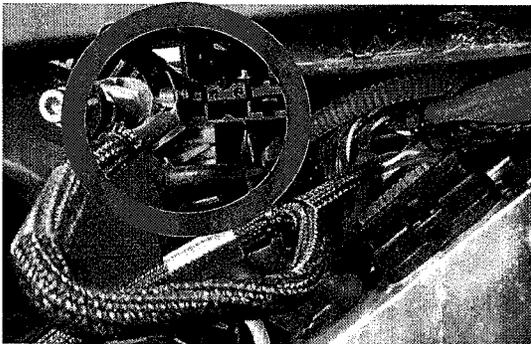

Correct

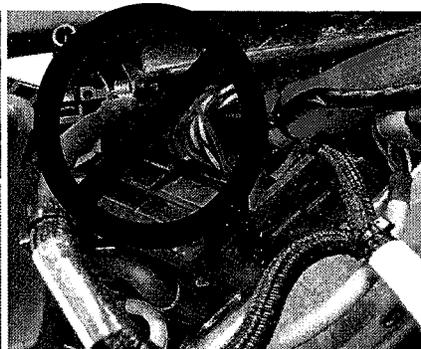

Incorrect

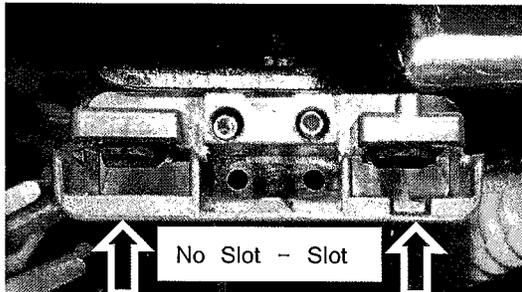

4. Attach the OBDII connector to the end of the IXXAT diagnostic cable (same as above).
5. Connect the power supply to the cable, and using the bikes charge cord, plug into a standard wall outlet.

