



Brake Parts INC LLC
4400 Prime Parkway
McHenry, IL 60050

SAFETY RECALL NOTICE

To: Raybestos

Subject: NHTSA Campaign Number: 14E-036 - Recall of certain Raybestos Part Nos. 855PG, 855SG, 960PG, 815PG, 815SG, 589PG, and 589SG (rear wheel brake shoes)

Dear Valued Customer:

Brake Parts Inc (“BPI”) has decided that a defect which relates to motor vehicle Safety exists in certain Raybestos 855PG, 855SG, 960PG, 815PG, 815SG, 589PG, and 589SG (rear wheel brake shoes) manufactured date codes from 040113 to 041914 MMDDYY April 1, 2013 to April 19, 2014. These products were intended for installation in the vehicles identified in the table below. Accordingly, a recall to address this issue is being initiated effective July 11, 2014.

| Part Nos. | Vehicles |
|------------------------------|--|
| Raybestos 855PG, 855SG | Chevrolet Truck: Silverado 1500 (2005-2009), Silverado Classic 1500 (2007); GMC Truck: Sierra 1500 (2005-2009), Sierra Classic 1500 (2007) - Rear Brake Shoe |
| Raybestos 960PG | Chevrolet Truck: Silverado 1500 (2008-2013); GMC Truck: Sierra 1500 (2008-2013) - Rear Brake Shoe |
| Raybestos 815PG, 815SG | Chevrolet Truck: Colorado (2004-2008); GMC Truck: Canyon (2004-2008); Isuzu Truck: I-280 (2006), I-290(2007-2008),I-350(2006),I-370(2007-2008) Rear Brake Shoe |
| Raybestos 589PG and 589SG | Toyota Truck: 4 Runner (1987-2000), Pickup (1987-1995), T100 (1993-1998), Tacoma (1995-2002), Tundra (2000-2002) - Rear Brake Shoe |

The defect involves the adhesion between the friction lining and the steel shoe. The lining of the brake shoe may detach from the steel shoe during normal service, causing the affected brake to fail. The defect does not affect the other brakes on the vehicle, and those brakes will continue to operate normally. If the lining detaches from the steel shoe, it could cause rear wheel lockup and it will reduce the available braking force which could lengthen the required stopping distance, and increase the risk of a crash without prior warning.

Vehicle owners will be notified by mail about the recall and will be instructed to go to their installer to have the affected part replaced. There is no cost to owners for this recall.

What You Should Do

(a) Recalled product in Raybestos inventory: Our records indicate that you have purchased the subject brake shoes from Brake Parts Inc. To determine if a brake shoe is part of this recall, please check the date code to see if it contains any of the date codes listed above. Raybestos should please forward copies of this letter to installer customers who have purchased from you. Please call 1-800-323-0354 to request an RMA (Return Materials Authorization) No. Recalled product should be returned to:

Brake Parts Inc
1380 Corporate Drive
McHenry IL 60050
Attention: Joel Krollman

Please submit including RMA# for the brake shoes returned and freight charges to BPI customer service. ***Under federal law, you may not sell the recalled brake shoes. Substantial penalties apply to violations of this law.*** Please return them to us for credit as soon as possible. Replacement brake shoes are available for shipment.

(b) Recalled product installed on vehicles: We also request that installers transmit copies of the attached letter to vehicle owners. It advises owners of steps to be taken by them to obtain replacement brake shoes free of charge. Alternatively, you may provide customer contact information to BPI and BPI will coordinate notification to these customers.

Your assistance with this recall is appreciated. Should you have any questions or concerns, please contact Brake Parts Inc Customer Service.

Sincerely,

Brake Parts Inc

SAFETY RECALL NOTICE

Dear Valued Customer:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Brake Parts Inc (“BPI”) has decided that a defect which relates to motor vehicle Safety exists in certain Raybestos Part Nos. 855PG, 855SG, 960PG, 815PG, 815SG, 589PG, and 589SG (rear wheel brake shoes). Our records indicate that you may have had this replacement part installed on your vehicle.

Why is a recall being conducted?

The lining of the brake shoe may detach from the steel shoe during normal service, causing the affected brake to fail. The defect does not affect the other brakes on the vehicle, and those brakes should continue to operate normally. If the lining detaches from the steel shoe, it could cause rear wheel lockup and it will reduce the available braking force which could lengthen the required stopping distance, and increase the risk of a crash without prior warning.

What are we doing about the problem?

BPI will replace the item free of charge.

What should you do?

If you have purchased one or more of the above listed brake shoes through a dealer or installer for installation, you should contact your dealer or installer as soon as possible and arrange an appointment to have the affected brake shoe(s) replaced. The dealer or installer will check the manufacturing date of the part at issue and if it is included in the recall, will replace it, free of charge to you. When scheduling an appointment, please verify that the dealer or installer already has a replacement part on hand. If they do not or are unaware of the recall, please call BPI Customer Service at 1-800-323-0354.

What if you no longer own this vehicle with the rear brake shoe affected?

Please forward this notice and information to the new owner.

If you have already paid to have your rear brake shoe repaired for this condition, you may be eligible for reimbursement of the charges you paid for the replacement. Please file for recall reimbursement through your installer, jobber or WD. To learn more about what you need to do to obtain reimbursement, or if you have other questions, please call the BPI Warranty Administrator at 815-759-7757.

If you are unable to obtain a remedy without charge within a reasonable time, you may submit a complaint to: Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE, Washington, D.C. 20590; or call the toll-free Auto Safety Hotline at 1-888-327-4326 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.


Federal Regulations require any lessor receiving this letter to forward it to the lessee within 10 days.

We apologize for any inconvenience this may cause, but we are taking this action in the interest of your personal safety and satisfaction with our products.

Sincerely,

Brake Parts Inc

Date Code Example On Brake Shoe

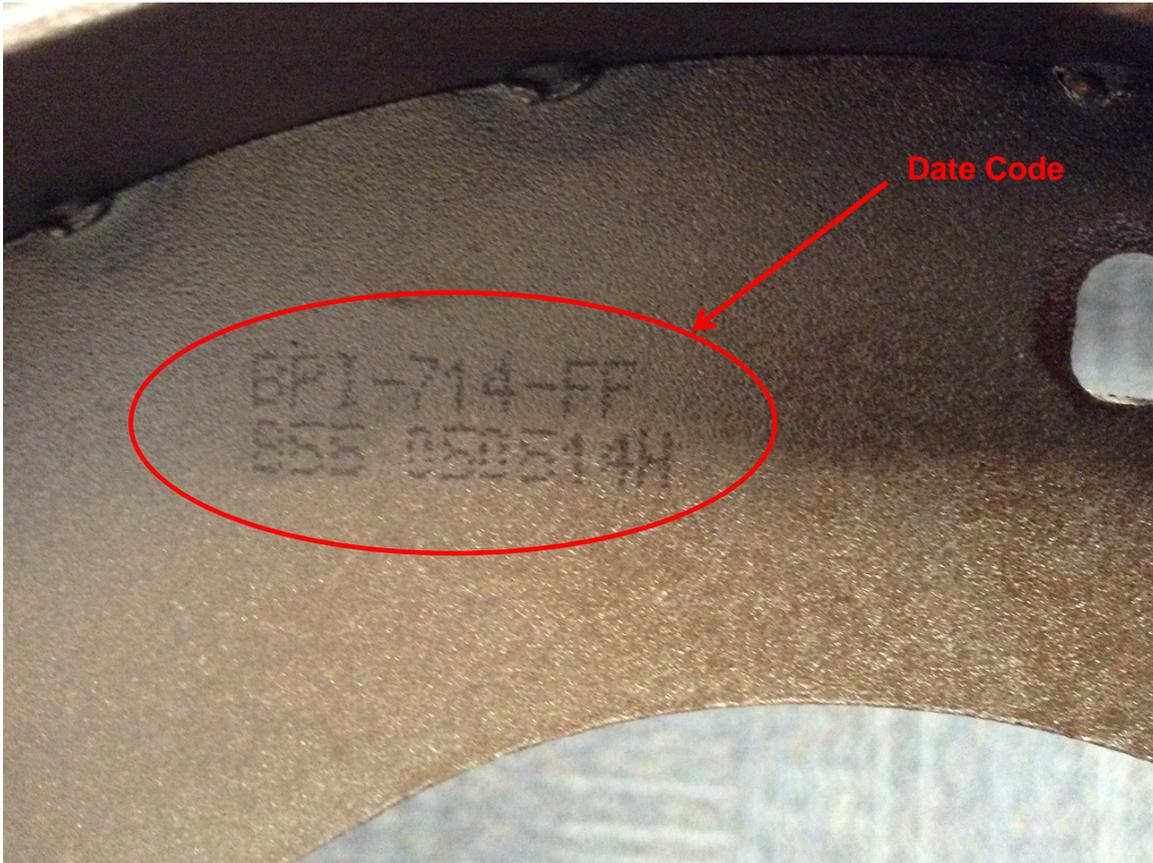

Date Code Example On Brake Shoe Package

