



RECALL CAMPAIGN BULLETIN

Reference:

NTB15-109

Date:

December 8, 2015

VOLUNTARY RECALL CAMPAIGN 2015-2016 GTR SOLD IN PUERTO RICO CERTIFICATION LABEL

CAMPAIGN ID #: P5334
APPLIED VEHICLE: 2015-2016 GTR (R35)

**Check Service COMM to confirm campaign eligibility.
Vehicles affected by this campaign were sold only in Puerto Rico.**

INTRODUCTION

Nissan is conducting a campaign on certain specific 2015 and 2016 GT-R vehicles sold in Puerto Rico to replace the certification label. This service will be performed at no cost to the customer for parts or labor.

IDENTIFICATION NUMBER

Nissan has assigned identification number P5334 to this campaign. This number must appear on all communications and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service Comm for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely.
NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Park the vehicle in a safe place with:
 - Automatic transmission in Park.
 - Ignition OFF.
 - Parking brake ON/applied.

2. Open the driver door.

3. Locate the certification label (Figure 1).

NOTE: The certification label has the VIN on it.



Figure 1

4. Confirm the VIN on the new certification label matches the VIN on the certification label that is currently attached to the vehicle (Figure 2).



Figure 2

5. Clean the area around the current certification label (Figure 3).

- Use 50/50 solution of isopropyl alcohol and water, allow the area to dry.

NOTE: Do not use harsh chemicals that may damage the painted surface.

6. Mark the location of the current certification label with painters tape.

NOTE: Apply tape along one vertical and one horizontal edge.



Figure 3

7. Use a plastic trim tool to peel and remove the current certification label (Figure 4).
 - Take great care not to damage the paint.



Figure 4

8. Clean the area where the old certification label was attached (Figure 5).
 - Use 50/50 solution of isopropyl alcohol and water; allow the area to dry.

NOTE:

- Do not use harsh chemicals that may damage the painted surface.
- It is important that the surface is free of any dirt and oil to ensure proper adhesion of the new label.

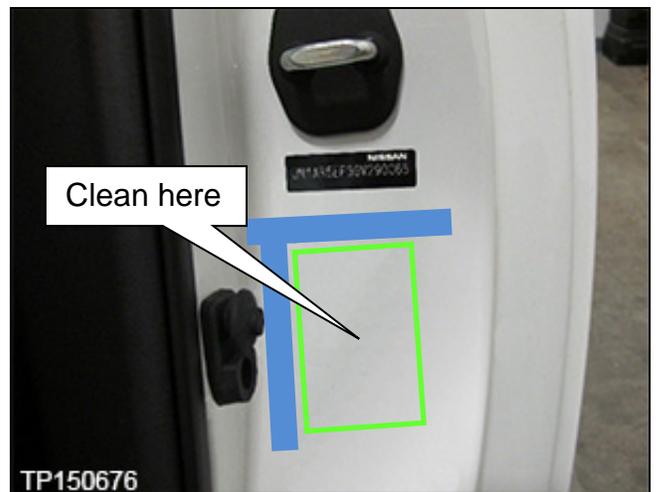


Figure 5

9. Attach the new certification label:
 - a. Peel the new certification label from its backing sheet.
 - b. Line up the new certification label with the painters tape (Figure 6).
 - c. Attach the new certification label from the top down.

IMPORTANT:

- The adhesive on the label is permanent.
- Extra care should be taken when applying the new label since it cannot be moved once it is attached.



Figure 6

PARTS INFORMATION

A replacement certification label is available by emailing a request to dotero@motorambar.net with your dealer code and VIN.

- The above contact information for a replacement certification label is only valid for a request regarding this campaign.
- Do not order multiple certification labels per VIN or request.

CLAIMS INFORMATION

Submit a Campaign (CM) line claim using the following claims coding:

CAMPAIGN ("CM") ID	DESCRIPTION	OP CODE	FRT
P5334	Replace Certification Label	P53341	0.2 hrs.