

TOYOTA

**Toyota Motor Engineering &
Manufacturing North America, Inc.**

Vehicle Safety & Compliance
Liaison Office
Mail Code: S-104
19001 South Western Avenue
Torrance, CA 90501

December 13, 2011

Ms. Nancy Lummen Lewis
Associate Administrator for Enforcement
National Highway Traffic Safety Administration
Attn: Recall Management Division (NVS-215)
1200 New Jersey Ave, SE
Washington, D.C. 20590


Re: Foreign Safety Recall/Other Safety Campaign Report
Certain Toyota Verso Panoramic Roof Frames - Amended

Dear Ms. Lewis:

On November 9, 2011, Toyota submitted a Foreign Safety Recall/Other Safety Campaign Report for certain Toyota Verso vehicles in other foreign markets. The number of affected vehicles has been revised. Toyota vehicles sold in the United States are not affected as those included in the Foreign Recall Report.

Should you have any questions about this report, please contact me at (502) 867-6027.

Sincerely,

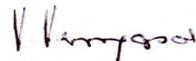

Vinnie Venugopal
General Manager
Toyota Motor Engineering & Manufacturing
North America, Inc.

Enclosures
Foreign Safety Recall/Other Safety Campaign Report

Foreign Safety Recall / Other Safety Campaign Report**Subject: Panoramic Roof issue on certain Toyota Verso Vehicles****1. Vehicle Manufacturer Name:**

Toyota Motor Manufacturing Turkey Inc. ["TMMT"]

2. Affected Vehicles:

Make/ Car Line	Model Year	Country	Action	Production Period	Number of Vehicles
Toyota/ Verso	*1	UK, Germany, Other European countries	Safety Recall (UK, Germany) Other Safety Campaign (Other European countries)	February, 2009 Through March, 2011	33,707

*1: In those countries, there is no system of Model Year.

3. Substantially Similar Vehicles sold in the U.S.:MY/ Make/ Car Line: MY11-12 Lexus CT, MY10-11 Lexus HS, MY10-12 Toyota Prius,
MY11-12 Toyota Scion tC, MY10-12 Toyota Scion xB**4. Description of Problem:**

Due to insufficient adhesion strength of the paint on the panoramic roof frame to which the panoramic roof glass is bonded in the subject vehicles, the paint may begin to peel from the frame, causing the roof glass to partially separate from the frame and result in wind noise. If the vehicle is continuously operated in this condition, the glass may detach from the frame.

5. Description of Corrective Repair Action:

For all of the affected vehicles, the dealer will inspect the paint condition of the panoramic roof frame. If the paint adhesion strength is determined to be insufficient, the panoramic roof assembly will be replaced with a new one.

6. Determination to Conduct Safety Recall / Other Safety Campaign:

- The determination was made by Toyota Motor Corporation;
- Date of determination: November 3, 2011
- Date campaign will commence: Mid November, 2011

7. Reason the similar vehicles sold in the U.S. are not involved in this safety recall / other safety campaign:

This problem was caused by a process unique to the panoramic roof frames for Verso vehicles produced at TMMT, none of which were sold in the United States. In addition, the subject panoramic roof frame is not used on any U.S. model.