



**SUZUKI MOTOR CORPORATION**

Motorcycle Service Group  
Overseas Service Department  
300 Takatsuka, Minami, Hamamatsu, JAPAN 432-8611  
Tel: 81-53-440-2365, Fax: 81-53-440-2318

Page 1 / 3  
Date July. 10, 2013  
Our ref. WN-ALL-1307101

TO : Selected Motorcycle Distributors  
ATTN : Managing Director / Manager, Service Director / Manager

**RE : GSX1300RAL3/AUFL3 ABS Hydraulic Unit Replacement Recall Campaign**


This letter is to inform you of the "ABS Hydraulic Unit Replacement Recall Campaign" for GSX1300RAL3/AUFL3 produced between January 14, 2013 and April 26, 2013.

We have been informed that some ABS Unit has aluminium debris in its inside due to production error from the manufacturer. Aluminium debris can interfere with proper ABS unit operation and it may cause ABS malfunction without ABS indicator light warning in the worst case.

In view of the nature of this problem, we have decided to carry out the recall campaign in your market. Details of this campaign are explained below.

You are required to report to your authority. Please report the progress with attached document ANNEX1.

If you have affected units in your warehouse, you are required to replace ABS Unit before releasing them to your dealers.

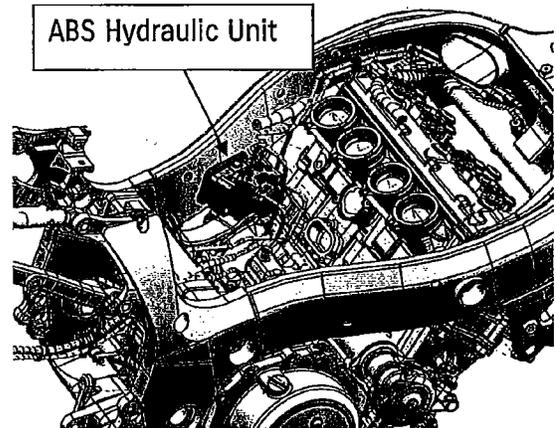

We apologize for any inconvenience this may cause to you and thank you in advance for your kind understanding and cooperation. If you have any question, please don't hesitate to contact us anytime.

Best regards,

Yasunari Suzuki  
Department General Manager  
Overseas Service Department  
SUZUKI MOTOR CORPORATION

**Proposed schedule**

We would like to request you the recall launching schedule as below.

- |                                    |  |
|------------------------------------|--|
| •Parts order to SMC parts dept.    | Please order necessary number of replacement parts |
| •Report to the authority           | Please prepare necessary document                  |
| •Issue service bulletin to dealers | As soon as you prepare the bulletin                |
| •Issue owner letters               | As soon as you prepare the letter                  |
| •Check stock status of the units   | Affected units at your warehouse                   |

**Affected VIN**

With regard to affected VIN range and units quantity in your market, please refer to attached VIN list ANNEX2. All units produced after April 27, 2013 has been produced with ABS Unit which is produced with improved manufacturing process.

**Campaign parts**

50% quantity of the campaign parts will be prepared in our spare parts stocks by July 23. Additional parts will be available by the end of July. For avoiding initial parts shortage, we would like to manage initial parts order. Please place your order with SMC Spare parts Department by E-mail using the attached Parts Order form ANNEX3. Do not use SCAN order system.

Model	Campaign Part No.	Part Name	Quantity
GSX1300RA L3 / AUFL3	55610-15H01-RX0	UNIT ASSEMBLY, HYDRAULIC ABS	1 set/unit

In addition, you are required to source DOT 4 brake fluid locally. (200cc per unit is required).

**Warranty Reimbursement Information**

This is a recall campaign that is acceptable only one time for one unit.

Please submit the warranty claim applications to SMC under the following terms.

Claim category	2 (Campaign)			
Trouble Code	99- WN			
Basic code	MD09R0			
Model	Causal Part No.	Q'ty	Causal Part Name	Flat Rate
GSX1300RAL3 / AUFL3	55610-15H01-RX0	1	UNIT ASSEMBLY, HYDRAULIC ABS	1.0 hr

\*For use of brake fluid, we accept you to submit sublet for 0.1 hour per unit.

**Replacement procedure**

Replacement procedure ANNEX4 is prepared on SCAN FD.  
Please download the files from below.

SCAN FD - Download - Service - Document Files for Motorcycle

ANNEX4: GSX1300RAL3/AUFL3 ABS Hydraulic Unit Replacement.doc

**Implementation date on your country**

We would like to ask you to provide the following information to your window person of overseas motorcycle service group by July 31, 2013. Please fill in attached Recall campaign notification plan form ANNEX1 and e-mail to us.

- 1) Recall campaign notification date to AUTHORITY in your country if require
- 2) Recall campaign notification date to your DEALERS
- 3) Recall campaign notification date to CUSTOMERS

**Attachment**

ANNEX1: Recall\_campaign\_notification\_plan\_form.xls

ANNEX2: Country\_name\_VIN\_List.xls

ANNEX3: Recall\_Campaign\_Parts\_Special\_Order\_Form.xls

ANNEX4: GSX1300RAL3 AUFL3 ABS Hydraulic Unit Replacement Procedure.doc

END