



RECALL CAMPAIGN BULLETIN

Reference:

NTB13-087

Date:

September 23, 2013

VOLUNTARY SAFETY RECALL CAMPAIGN 2013 ARMADA AND TITAN BRAKE MASTER CYLINDER

CAMPAIGN ID #: PC244
APPLIED VEHICLES: 2013 Armada (TA60)
2013 Titan (A60)

Refer to Service COMM to confirm campaign eligibility.

INTRODUCTION

Nissan is conducting a voluntary safety recall campaign on certain specific 2013 Armada and Titan vehicles to inspect and, if needed, replace the brake master cylinder. This campaign will be performed at no charge for parts or labor.

IDENTIFICATION NUMBER


Nissan has assigned identification number PC244 to this campaign. This number must appear on all communications and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service Comm for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

Repair Overview

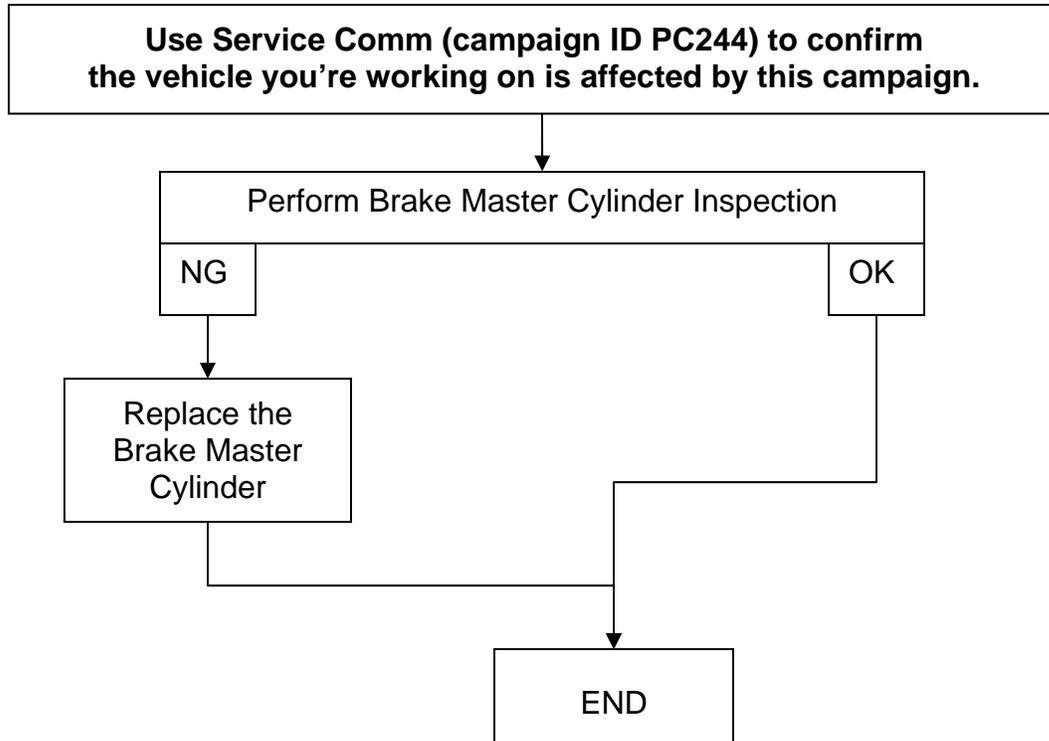

SERVICE PROCEDURE

Brake Master Cylinder Inspection

1. Locate the label on the brake master cylinder.


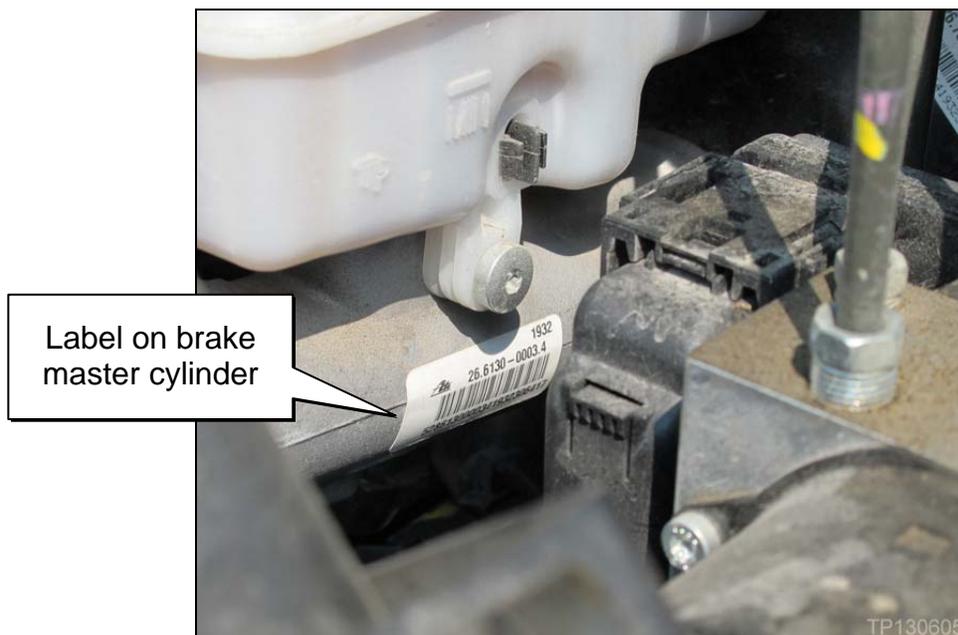


Figure 1

2. Check the Julian date code on the label.

- The Julian date code is a four-digit code in the upper right corner of the label.

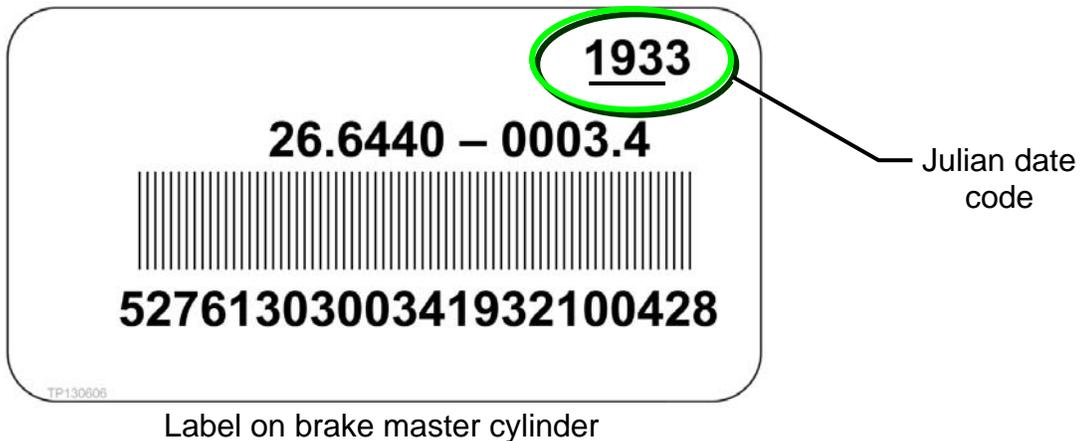

If the **first three digits** of the Julian date code are **049** or lower – **OK**

If the **first three digits** of the Julian date code are **107** or higher – **OK**

- Return the vehicle to the customer.

If the **first three digits** of the Julian date code are **050** through **106** – **NG**

- Replace the brake master cylinder.
- Refer to **BR > REMOVAL AND INSTALLATION > Brake Master Cylinder** in the applicable Electronic Service Manual for replacement instructions.

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
Brake Master Cylinder	46010-7S20A	1

CLAIMS INFORMATION

Submit a Campaign (CM) line claim using the following claims coding:

“CM” I.D.: PC244

DESCRIPTION	OP CODE	FRT
Inspect brake master cylinder (Julian date code)	PC2440	0.2

OR

DESCRIPTION	OP CODE	FRT
Inspect (Julian date code) and replace brake master cylinder	PC2441	1.0

Expense Code:

EXPENSE CODE	DESCRIPTION	MAX. AMOUNT
006	Brake Fluid (1)	\$7.98

(1) Order this item through the Nissan Maintenance Advantage program: Phone: 877-NIS-NMA1 (877-647-6621). Website order via link on the dealer portal www.NNAnet.com and click on the “Maintenance Advantage” link.

Towing Expense:

EXPENSE CODE	DESCRIPTION	AMOUNT
501	Towing	(2)

(2) Bill only actual amount billed for tow expense.

Rental Expense:

EXPENSE CODE	DESCRIPTION	MAX. PER DAY
502	Rental Car	(3)

(3) Only applicable while parts are on back order at \$35.00.