

Mike Martell  
248.512.8086



# Confidential Report

PRIVILEGED AND CONFIDENTIAL

REPORT DATE: October 23, 2006

REPORT RECIPIENT:

Daimler Chrysler

27777 Inkster Road

Farmington Hills, MI 48334

ATTENTION:

Craig Boury

INSURED:

[REDACTED]

DATE OF LOSS:

Saturday, October 7, 2006

Time: 10:45 a.m.

LOSS LOCATION:

[REDACTED]

CITY / STATE OF LOSS:

Foley, Alabama

CLAIM NUMBER:

[REDACTED]

MJM FILE NUMBER:

DAI191687

PREPARED BY:

Dennis Boswell, CFI, CEFI  
Special Investigator

File Status:

- First and Final Report
- Initial Report
- Interim report
- Final report - File closed

Please  
Paper Clip  
to Cain  
15527355

Insured: [REDACTED]  
File No.: DAI191687  
Claim No. [REDACTED]

2

### ASSIGNMENT

This assignment was received from of Daimler Chrysler on Friday, October 13, 2006. The investigation commenced on Tuesday, October 17, 2006. The instructions were to conduct an origin and cause investigation into the fire loss involving the claimant's 2007 Jeep Wrangler Unlimited 4x4 bearing vehicle identification number 1J4GA391X7L [REDACTED]. Additional instructions were to contact [REDACTED] for the location of the Jeep. The 2007 Wrangler was moved to Cockrell's Body Shop at 743 South McKensie Street, in Foley, Alabama. The Origin and Cause Investigation was conducted at that location.

On Wednesday, October 18, 2006, a verbal report of the findings of this investigation were presented to Craig Boury, of Daimler Chrysler. At that time, Craig Boury requested a condensed report with the enclosures and digital photographs on C/DROM. The report is to be forwarded to the address above.

### RISK

The property involved in this fire loss is a 2007 Jeep Wrangler Unlimited 4X4 bearing vehicle identification number 1J4GA391X7L [REDACTED].

### ORIGIN AND CAUSE SYNOPSIS

On Tuesday, October 17, 2006, this Investigator traveled to 743 South McKensie, to Cockrell's Body Shop, located in Foley, Alabama, to conduct an origin and cause investigation into the fire loss involving the claimant's 2007 Jeep Wrangler Unlimited. Upon arrival at this facility, the vehicle was located and then identified by Larry Cox, the manager of the shop, and confirmed by checking the vehicle identification number, which was #1J4GA391X7L [REDACTED].

The investigation commenced at this time to determine the origin and cause of the fire involving this vehicle. The investigation consisted of a heat and flame vector analysis. In this evaluation, all heat and flame patterns are examined, documented, and then analyzed to determine the point of fire origin. Subsequent to the determination of the point of origin, a close examination of the vehicle is undertaken to determine the causation.

Upon completion of the fire origin and cause investigation and based on all the information presently available, gained through the vehicle examination, records review and the interview(s) conducted, it is the following opinion of the investigator.

The fire involving the claimant's vehicle is accidental in nature and is the result of dry grass collecting around the catalytic converter, and was ignited by the heat from the device. The point of origin was the passenger side catalytic converter at the rear of the front wheel well. The fire caused heavy damage to the engine compartment and the passenger compartment. A check of the transmission and engine dip sticks show both were filled at the time of the fire. The battery was destroyed, but the cable and ground wire were burned, but showed signs of failure.

**SERVICE HISTORY**

DATE	REPAIR ORDER	MIILEAGE	ADVISOR	TECHNICIAN	TYPE	OPERATION	OPERATION DESCRIPTION

SALESPERSON NO. \_\_\_\_\_

HOURS: MONDAY - FRIDAY 7:30 - 5:30

STATE REG # 3

**RECOMMENDED SERVICES**

OPERATION	OPERATION DESCRIPTION	MO. MI	TOTAL
00CHZLOF	LOF	MI	
00CHZROTAL	ROTATE AND BALANCE	MI	
00CHZ 6 LOF	LOF	MI	
00CHZOFD	LOF - DIESEL	MI	
00CHZ 5 LOF	LOF	MI	
99CHZLOF	LOF	MI	

Finally, although this work is performed with the customer's vehicle, and you are not responsible for the condition of the vehicle, it is your responsibility to ensure that the vehicle is in good condition at the time of the service. You should advise the customer of any condition of the vehicle that may affect the safety or performance of the vehicle. You should also advise the customer of any condition of the vehicle that may affect the safety or performance of the vehicle. You should also advise the customer of any condition of the vehicle that may affect the safety or performance of the vehicle.

**ARBITRATION AGREEMENT**

Customer and Dealer agree that the services to be performed by the Dealer are subject to the arbitration agreement set forth herein. This agreement shall be binding on the customer and the Dealer, and shall govern the resolution of any dispute arising out of or in connection with the services to be performed by the Dealer. The customer and Dealer agree that the arbitration agreement shall be binding on the customer and the Dealer, and shall govern the resolution of any dispute arising out of or in connection with the services to be performed by the Dealer.

VEHICLE ID NO: 1J4GA391X7L

YEAR MAKE MODEL: 07/PEP/WRANGLER UNLIMITED 4X4

DELIVERY DATE: 8045

STOCK NO: 8045

RECEIVED DATE: 09/29/06

REPAIR DATE: 09/29/06

REPAIR TIME: 10:55am

REPAIR RATE: \_\_\_\_\_

REPAIR TYPE: \_\_\_\_\_

REPAIR PARTS: \_\_\_\_\_

REPAIR LABOR: \_\_\_\_\_

REPAIR TOTAL: \_\_\_\_\_

DATE / TIME PROMISED: 09/29/06 09:00pm

APPOINTMENT:  Yes  No

ADVISOR: PHIL LASALLA

LABOR INSTRUCTIONS: \_\_\_\_\_

1 75CHZ209 PD/9  
 NEW VEHICLE PREPARATION GUIDE EFFECTIVE MARCH 1, 2001  
 CONCORDE, INTREPID, 300M, NEON, PT CRUISER, SEBRING CONV  
 STRATUS, SEBRING SEDAN, TJ WRANGLE, DAKOTA, RAM PICKUP  
 LIBERTY/KJ, GRAND CHEROKEE, RAM VAN/MGN

*Complete*

279.

Review History  
 Maintenance  
 VPP Receipts  
 Waiting on  
 Authorization  
 POO  
 SyncCont Auth  
 \$  
 #  
 Comments:  
 Final Owner  
 Review  
 S Verified  
 O.C.

Insured: [REDACTED]  
File No.: DA191687  
Claim No. [REDACTED]

The information received from the claimant indicates the Jeep Wrangler was out on a test drive with [REDACTED] a sales consultant with [REDACTED] at the time of the fire. The Jeep was off the road, demonstrating the four-wheel drive capabilities of the vehicle. The area was a grassy field. The Jeep had been placed in four-wheel drive and been in the field twenty to thirty minutes. Mr. [REDACTED] stated they stopped in the grass at the side of the road to place the Jeep back into two-wheel drive. As he started to pull off, the Jeep was not running right. Then he saw smoke coming from the passenger side of the Jeep in the area of the wheel well. In just a second, flames were visible and the Jeep and the grass around it was burning. A passerby tried to put the fire out with a fire extinguisher, but by then, there was too much fire.

Due to the age of the vehicle there were no reports in the National Traffic Safety Bureau about recalls or maintenance bulletins. A check was done with the dealership maintenance department. There were no recalls or repair notices in their records for this model.

**EVIDENCE:**

Property / Evidence - Retrieved / Retained from this scene:  
No evidence was recovered from this fire scene

**FILE STATUS:**

As I have completed all investigative requests, this file will now be closed and the report will be forwarded onto the claims representative. It may, however, be easily reopened at any future date upon request.

If you have any questions concerning this investigation, please feel free to contact me.

Respectfully,

Dennis Boswell, CFI, CEFI  
Special Investigator  
Germantown, Tennessee  
901 685-6459

CF:

Bob Buckley  
Regional Manager  
610 299-3869

(Address all correspondence concerning this file to the following address. Please include the MJM file number.)

MJM Investigation Services  
National Operations Center  
3535 Lawton Road, Suite 135  
Orlando, FL 32803

Insured: [REDACTED]  
File No.: DA191687  
Claim No.: [REDACTED]

**ENCLOSURES**

1. Photographs on C/D ROM
2. Access authorization
3. Diagram of the Exhaust system of 2007 Jeep Wrangler Unlimited
4. Key track log for the 2007 Jeep Wrangler stock # 8045
5. Service history 2007 Jeep Wrangler Unlimited

[REDACTED]



MJM

INVESTIGATION SERVICES INC

ACCESS AUTHORIZATION

The following authorization is being provided to MJM Investigation Services and its representatives and/or associates to facilitate the investigation of an insurance claim.

I, the undersigned, do hereby authorize, possessing the lawful authority to do so: the above listed representatives permission to enter the premises located at the address listed below for the purpose of determining the cause of this incident.

This authorization includes specific permission to enter upon said premises to inspect, investigate, photograph, and remove any physical evidence such as samples, appliances, equipment, components or other items which may assist in the evaluation and investigation of this incident; and to allow for the submission of such items for examination, analyses and/or testing.

This authorization shall remain valid for the duration of the claim, or until revoked in writing, and shall authorize subsequent entry and the removal of evidence as often as may be necessary to complete the investigation of this incident. A photocopy of this release shall serve as an original. I affirm having read the above authorization.

(WRANGLER)  
2007 Jeep VIN#: 1J4GA391X7L [Redacted]

Property Address: [Redacted] City: [Redacted] State: [Redacted] Zip: [Redacted]  
(Signature): [Redacted] Date: 10-18-06 Title (Insured - Owner - Tenant - etc.): GSM

[Redacted]  
Address

[Redacted]  
Business Name

Foley AL [Redacted]  
City/State/Zip

Business Address

[Redacted]  
Witnessed By

Business City/State/Zip  
10-17-06  
Date

DAI 191687  
MJM Investigation Services File No

Create Parts List


## 011-Exhaust

### 110-Exhaust System, 3.8L (EGT)


**Notes:**

[EGT] =3.8L V6 SMPI Engine.

Item	Qty Rqd	Part Number	Qty	Line	Series	Body	Engine	Trans	Description
1	┌	6102172AA	4	J, T, U		72, 74	EG0		SCREW AND WASHER, Hex Head, M10x1.5x50
2	┌	6508305AA	4	J, T, U		72, 74	EG0		LOCK NUT, M10-1.50
3	┌	52059930AG	1	J, T, U		72, 74	EG0		PIPE AND CONVERTER, Exhaust, To Manifold
4									EXTENSION, Exhaust Pipe To Muffler
	┌	52059 938AF	1	J, T, U		74	EG0		
	┌	52059 939AD	1	J, U		72	EG0		
5									INSULATOR, Exhaust
	┌	52059 929AA	5	J, T, U		72, 74	EN0		
	┌	52059 929AA	4	J, T, U		72, 74	EG0		
6	┌	52059937AE	1	J, T, U		72, 74	EG0		MUFFLER AND TAILPIPE, Exhaust
7									CLAMP, Exhaust
	┌	52110 201AA	1	J, T, U		74	EG0		
	┌	52110 201AA	1	J, T, U		72, 74	EN0		
	┌	52110 201AA	1	J, U		72	EG0		
	┌	52110 201AA	1	J, T, U		72, 74	EG0		

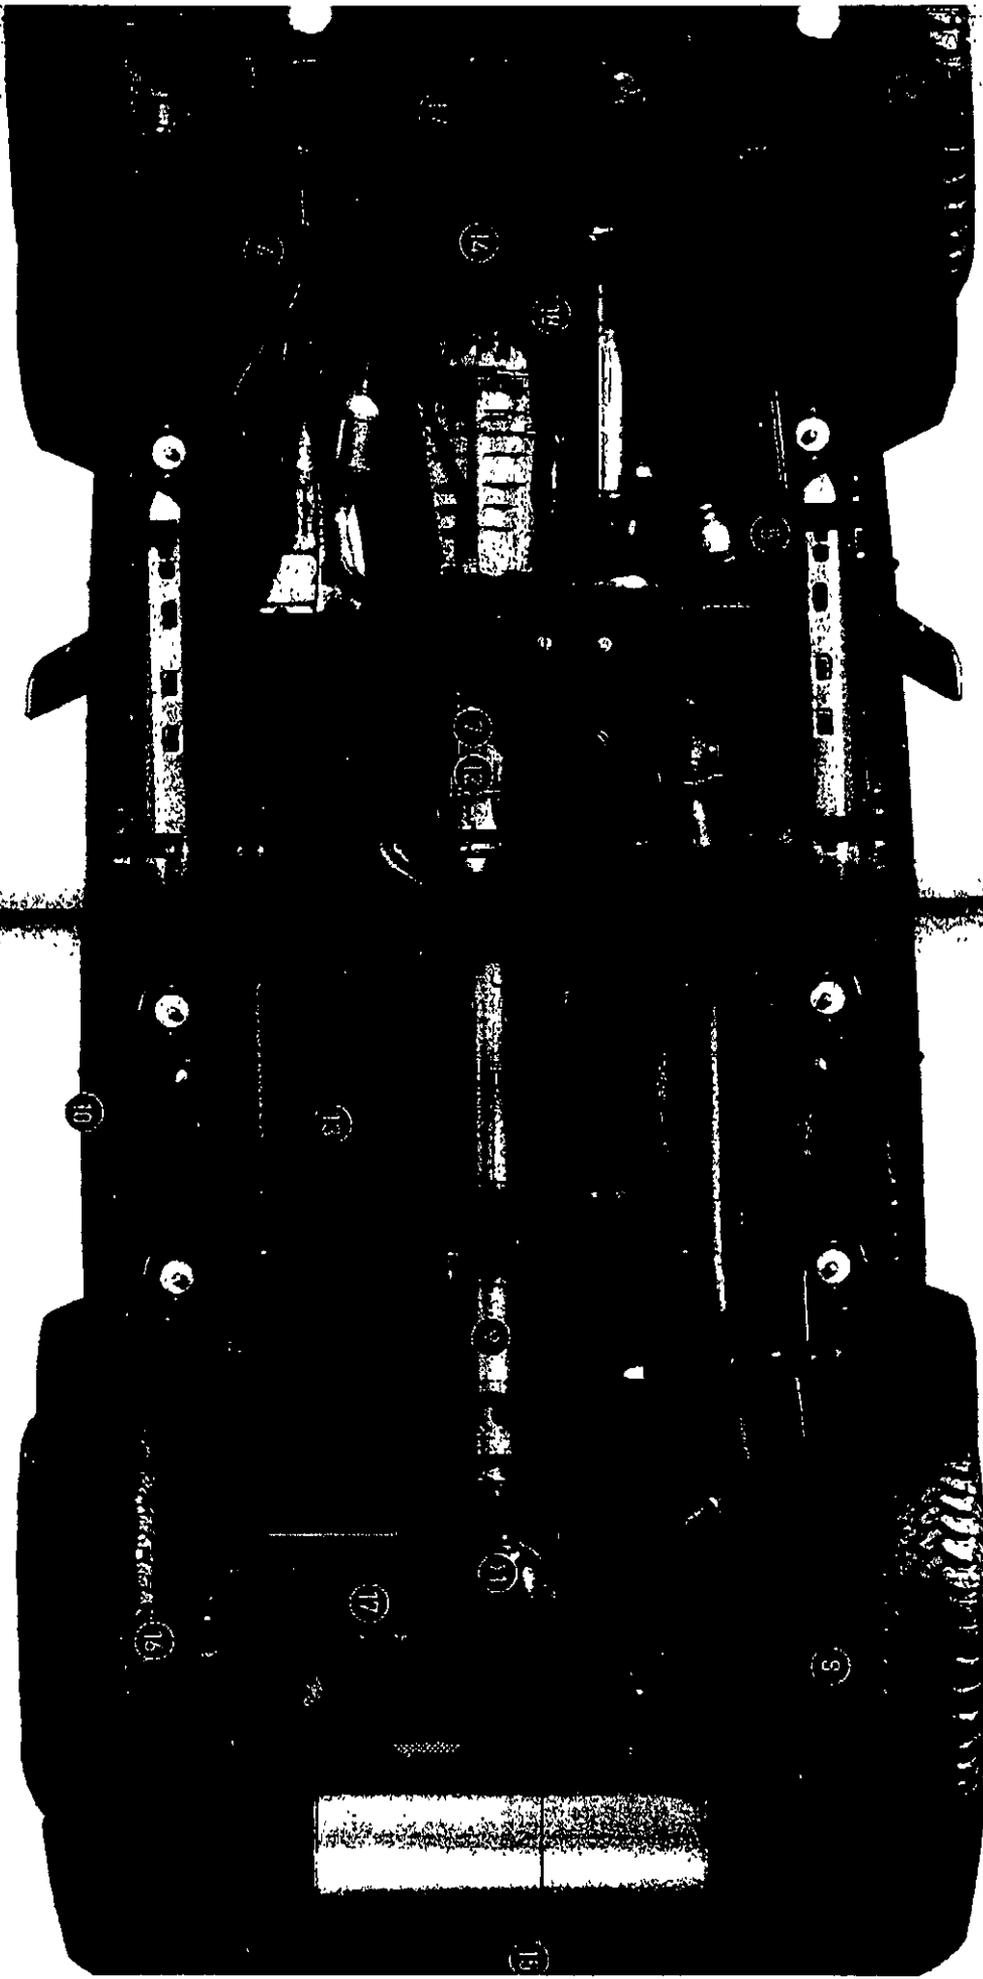

Jeep Wrangler Unlimited 3.0 shown.

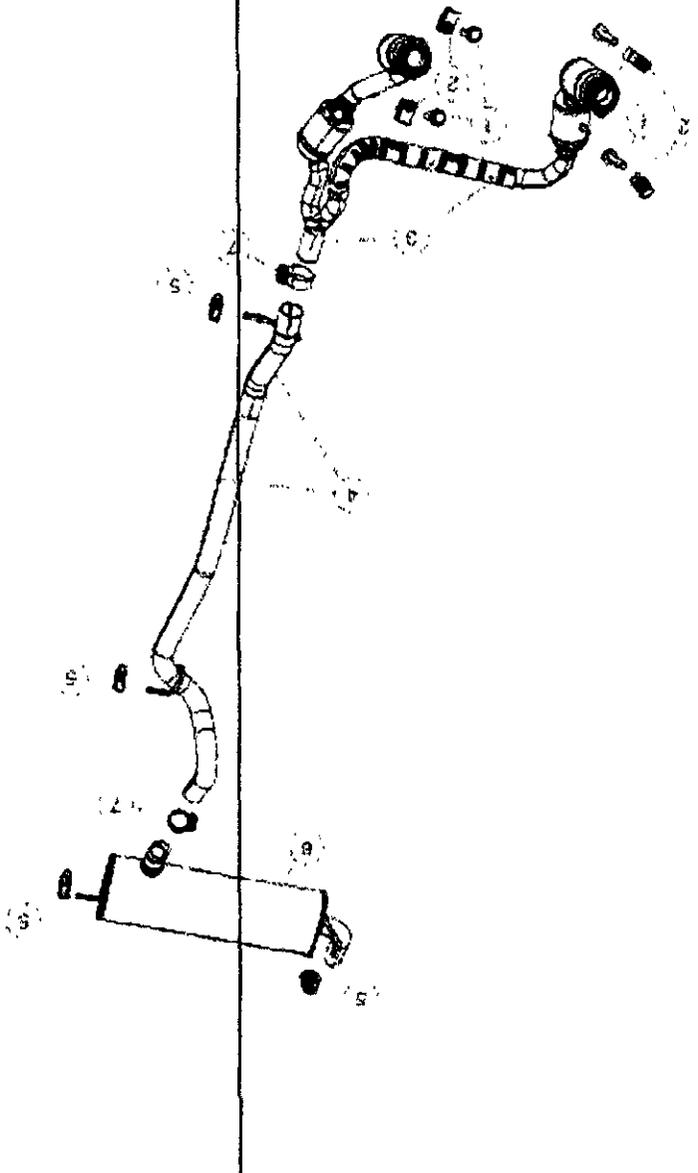

**Chrysler, Jeep®, Dodge**

**NEW VEHICLE PREPARATION**

*Inspection and Road Test • Passenger Cars and Trucks*

CUSTOMER NAME \_\_\_\_\_

DEALERSHIP NAME \_\_\_\_\_ Dealer Code 41337 Date \_\_\_\_\_

<input type="checkbox"/>	<u>8045</u>	<u>M0357</u>	<u>JE107</u>	<u>Wanaler</u>	<u>1J4GA391X7L</u>	<input type="checkbox"/>
REPAIR ORDER NUMBER	DEALER STOCK NUMBER	KEY CODES	MAKE AND YEAR	MODEL	VEHICLE IDENTIFICATION NUMBER	

**PERFORM THE INSPECTION AND ADJUSTMENTS AS LISTED BELOW**  
 NOTE: Refer To The New Vehicle Preparation Manual For Proper Preparation Procedures. Refer To The Appropriate Service Manual For Specifications And Service Procedures. Conditions Which Can Be Corrected By The Minor Adjustments Specified Below Are Considered Part Of Normal New Vehicle Preparation. Items That Require Correction Beyond The Minor Adjustments Specified Are Eligible For Warranty Reimbursement. This Form Must Be Attached To The Appropriate Internal Repair Order.

**VEHICLE READINESS**

- Install Ignition Off Draw (IOD) Fuse
- Inspect Paint and Body For Damage and Fit
- Adjust Tire Pressures (Refer to Door Placard or Tire Inflation Pressure Chart<sup>1</sup>)
- Install All Shipped Loose Items

- Child Safety Door Locks\* - Place in Unlocked Position
- Integrated Child Seat /Belt\*
- All Seat Belts, Seat Adjusters, Heated Seat\*, and Memory Mirror/Seat\*
- Visually Inspect Interior Parts For Damage, Fit, Etc.

**ROAD TEST**  
 Road Test vehicle on a variety of road conditions. Record mileage before and after the road test.  
 ODOMETER READING BEFORE \_\_\_\_\_ AFTER \_\_\_\_\_

- Check The Following For Proper Operation:
- Engine Starts With All Keys
  - All Warning Indicator Lights and Gauges
  - Engine Only Starts In Park and Neutral or With Clutch Depressed
  - Brake Transmission Interlock Mechanism\*
  - Cold Engine Performance
  - Engine During Warm-Up Performance
  - Warm Engine Performance
  - Clutch/Transmission/Transfer Case\*
  - Service Brake and Parking Brake
  - Steering and Handling
  - Noises, Vibrations, Squeaks, or Rattles
  - Front and Rear\* Heater/A/C\*
  - Cruise Control\*
  - Compass Mini Trip Computer\*/Overhead Console\*
  - Other Functional Items\*

- Check The Following Exterior Items For Proper Operation:
- All Doors/Exterior Locks - Adjust Strikers if Necessary
  - Power Sliding Door\*/Liftgate\*
  - Remote Keyless Entry (RKE)\* /Vehicle Security System\*
  - All Exterior Lamps: (Headlamps, Turn Signals, Hazard Flashers, Park/Tail/License Plate Lamps, Reverse (Back-up) Lamps, Fog Lamps, Stop Lamps, Daylight Running Lamps\*, And Clearance Lamps\*)
  - Front/Rear Defogger\*
  - Trunk, Lamp\*, and Trim Appearance - Adjust Striker if Necessary
  - Spare Tire Pressure and Jack and Tool Installation

**FUNCTIONAL OPERATION**

- Starting Inside The Vehicle. Check The Following For Proper Operation:
- All Interior Lamps and Horn
  - Passenger Airbag System Cutoff Switch and Light\*
  - Front and Rear\* Windshield Wipers and Washers
  - Inside and Outside Rear View Mirror
  - Cigar Lighter and Power Outlet(s)\*
  - Sunroof\*/Convertible Top\*
  - Audio System
  - All Windows and Interior Door Locks
  - Set Clock(s) and Compass Variance/Calibration\*

**UNDER HOOD**

- Check The Following:
- Hood Latch and Safety Catch - Adjust if Necessary
  - All Fluid Levels
  - Absence of Fluid Leaks
  - Battery State-of-Charge
  - Loose Attachments, Routing, and Clearance

**UNDER VEHICLE**

- Check The Following:
- Loose Attachments, Routing Clearance, and Damage
  - Absence of Fluid Leaks

**VEHICLE STORAGE**

- Remove Ignition Off Draw (IOD) Fuse

I CERTIFY THAT ALL OPERATIONS HAVE BEEN COMPLETED AND THIS VEHICLE HAS BEEN INSPECTED AND ROAD TESTED, AND THAT ADJUSTMENTS WERE PERFORMED IN ACCORDANCE WITH DAIMLERCHRYSLER PROCEDURES.

TECHNICIAN NUMBER	TECHNICIAN SIGNATURE

**PRE-DELIVERY DETAIL - THE FOLLOWING ARE NON-REIMBURSABLE ITEMS THAT SHOULD BE PERFORMED JUST PRIOR TO FINAL DELIVERY TO ENSURE CUSTOMER SATISFACTION**

- Install Ignition Off Draw (IOD) Fuse
- Test Battery State-Of-Charge
- Remove Exterior Transportation Protective Materials
- Wash and Clean Vehicle Exterior
- Inspect Paint and Body For Damage and Fit - Touch-up if Necessary
- Remove Interior Protective Covers, Unnecessary Labels, Tags, Etc.
- Clean Vehicle Interior
- Fill Vehicle With Fuel (Use Specified Grade)
- Perform All Incomplete Rapid Response Transmittals (RRT) and Recalls Before Delivery (Submit for reimbursement on a separate claim)


DEALERSHIP AUTHORIZED SIGNATURE	DATE
	<u>9/30/06</u>

History by Stock #, User, and Date

Machine: KEYTRACK

Date Range: <All Dates>

Stock #	User Id	Reason	Check Out Data	Time Out	Time In	ET Out (h:m)	Mileage
8045	PROMISE	Add		9/29/2006 10:54:34 am	9/29/2006 11:19:31 am	0:24	
8045	JUSTIN MOR	Demo-Used		9/29/2006 02:32:49 pm			
8045	MIKEM	Unrequested Access			9/29/2006 05:05:37 pm		
8045	JOEY,EVE	Out for Service		9/30/2006 09:24:27 am	9/30/2006 09:43:31 am	0:19	
8045	MOSILLSBEE	Demo-New		9/30/2006 01:45:36 pm	9/30/2006 02:02:40 pm	0:17	
8045	RENAE	Demo-Used		9/30/2006 02:34:00 pm	9/30/2006 03:11:42 pm	0:37	
8045	HENRY P	In house detail		10/02/2006 09:13:23 am	10/02/2006 11:33:22 am	2:19	
8045	JEFF	Demo-New		10/02/2006 01:04:17 pm	10/02/2006 01:13:08 pm	0:8	
8045	GREGG W	Demo-New		10/02/2006 02:39:38 pm			
8045	MIKEM	Unrequested Access			10/02/2006 03:08:38 pm		
8045	JEFF	Demo-New		10/02/2006 06:04:13 pm	10/02/2006 07:15:01 pm	1:10	
8045	RENAE	Demo-Used		10/03/2006 10:37:08 am	10/03/2006 10:43:12 am	0:6	
8045	JASON	Demo-New		10/03/2006 04:07:47 pm	10/03/2006 04:40:02 pm	0:32	
8045	RENAE	Demo-Used		10/03/2006 05:30:46 pm			
8045	JUSTIN MOR	Unrequested Access			10/03/2006 05:50:49 pm		
8045	MATT	4 - Lane Detail		10/04/2006 11:25:13 am	10/04/2006 02:19:28 pm	2:54	
8045	JEFF SYKES	Demo-New		10/05/2006 11:16:05 am	10/05/2006 11:49:18 am	0:33	
8045	TOMMY T	Demo-New		10/05/2006 01:32:51 pm			
8045	RENAE	Unrequested Access			10/05/2006 02:55:21 pm		
8045	GREGG W	Demo-New		10/05/2006 03:02:21 pm			
8045	ELIJAH	Unrequested Access			10/06/2006 10:22:19 am		
8045	STEVE S	Demo-New		10/06/2006 10:51:59 am	10/06/2006 11:56:56 am	1:4	
8045	MATT	Demo-New		10/06/2006 04:44:50 pm	10/06/2006 04:58:04 pm	0:13	
8045	JASON	Demo-New		10/06/2006 05:29:17 pm	10/06/2006 06:09:35 pm	0:40	
8045	GREGG W	Demo-New		10/07/2006 10:19:58 am			

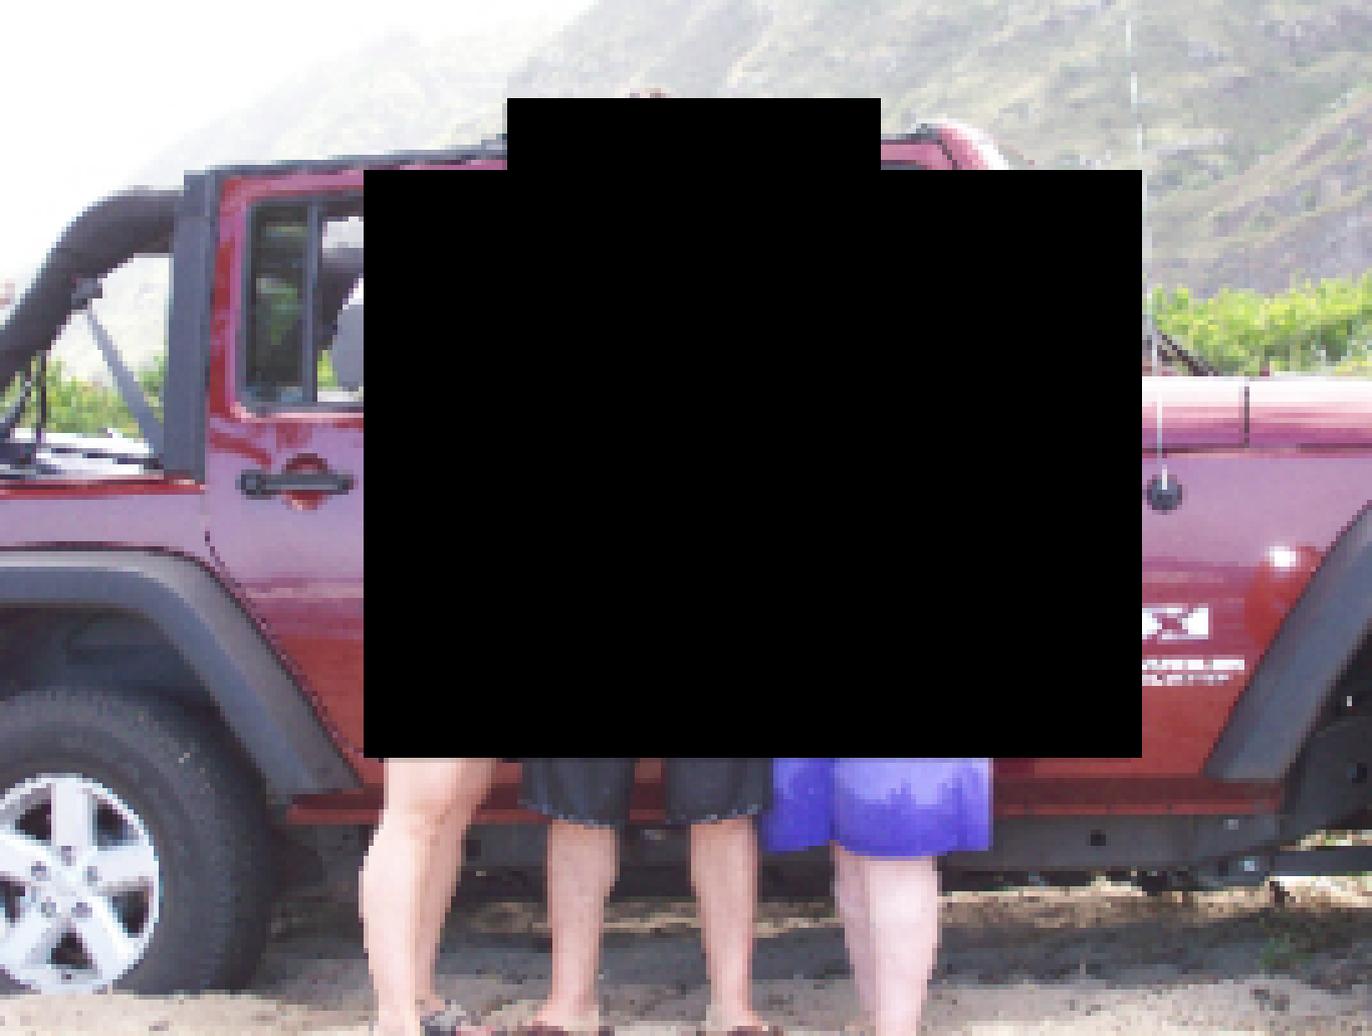































CCP-343-170

DO DO



PGD 59

5

V6 LE

CAMRY

CARD




















































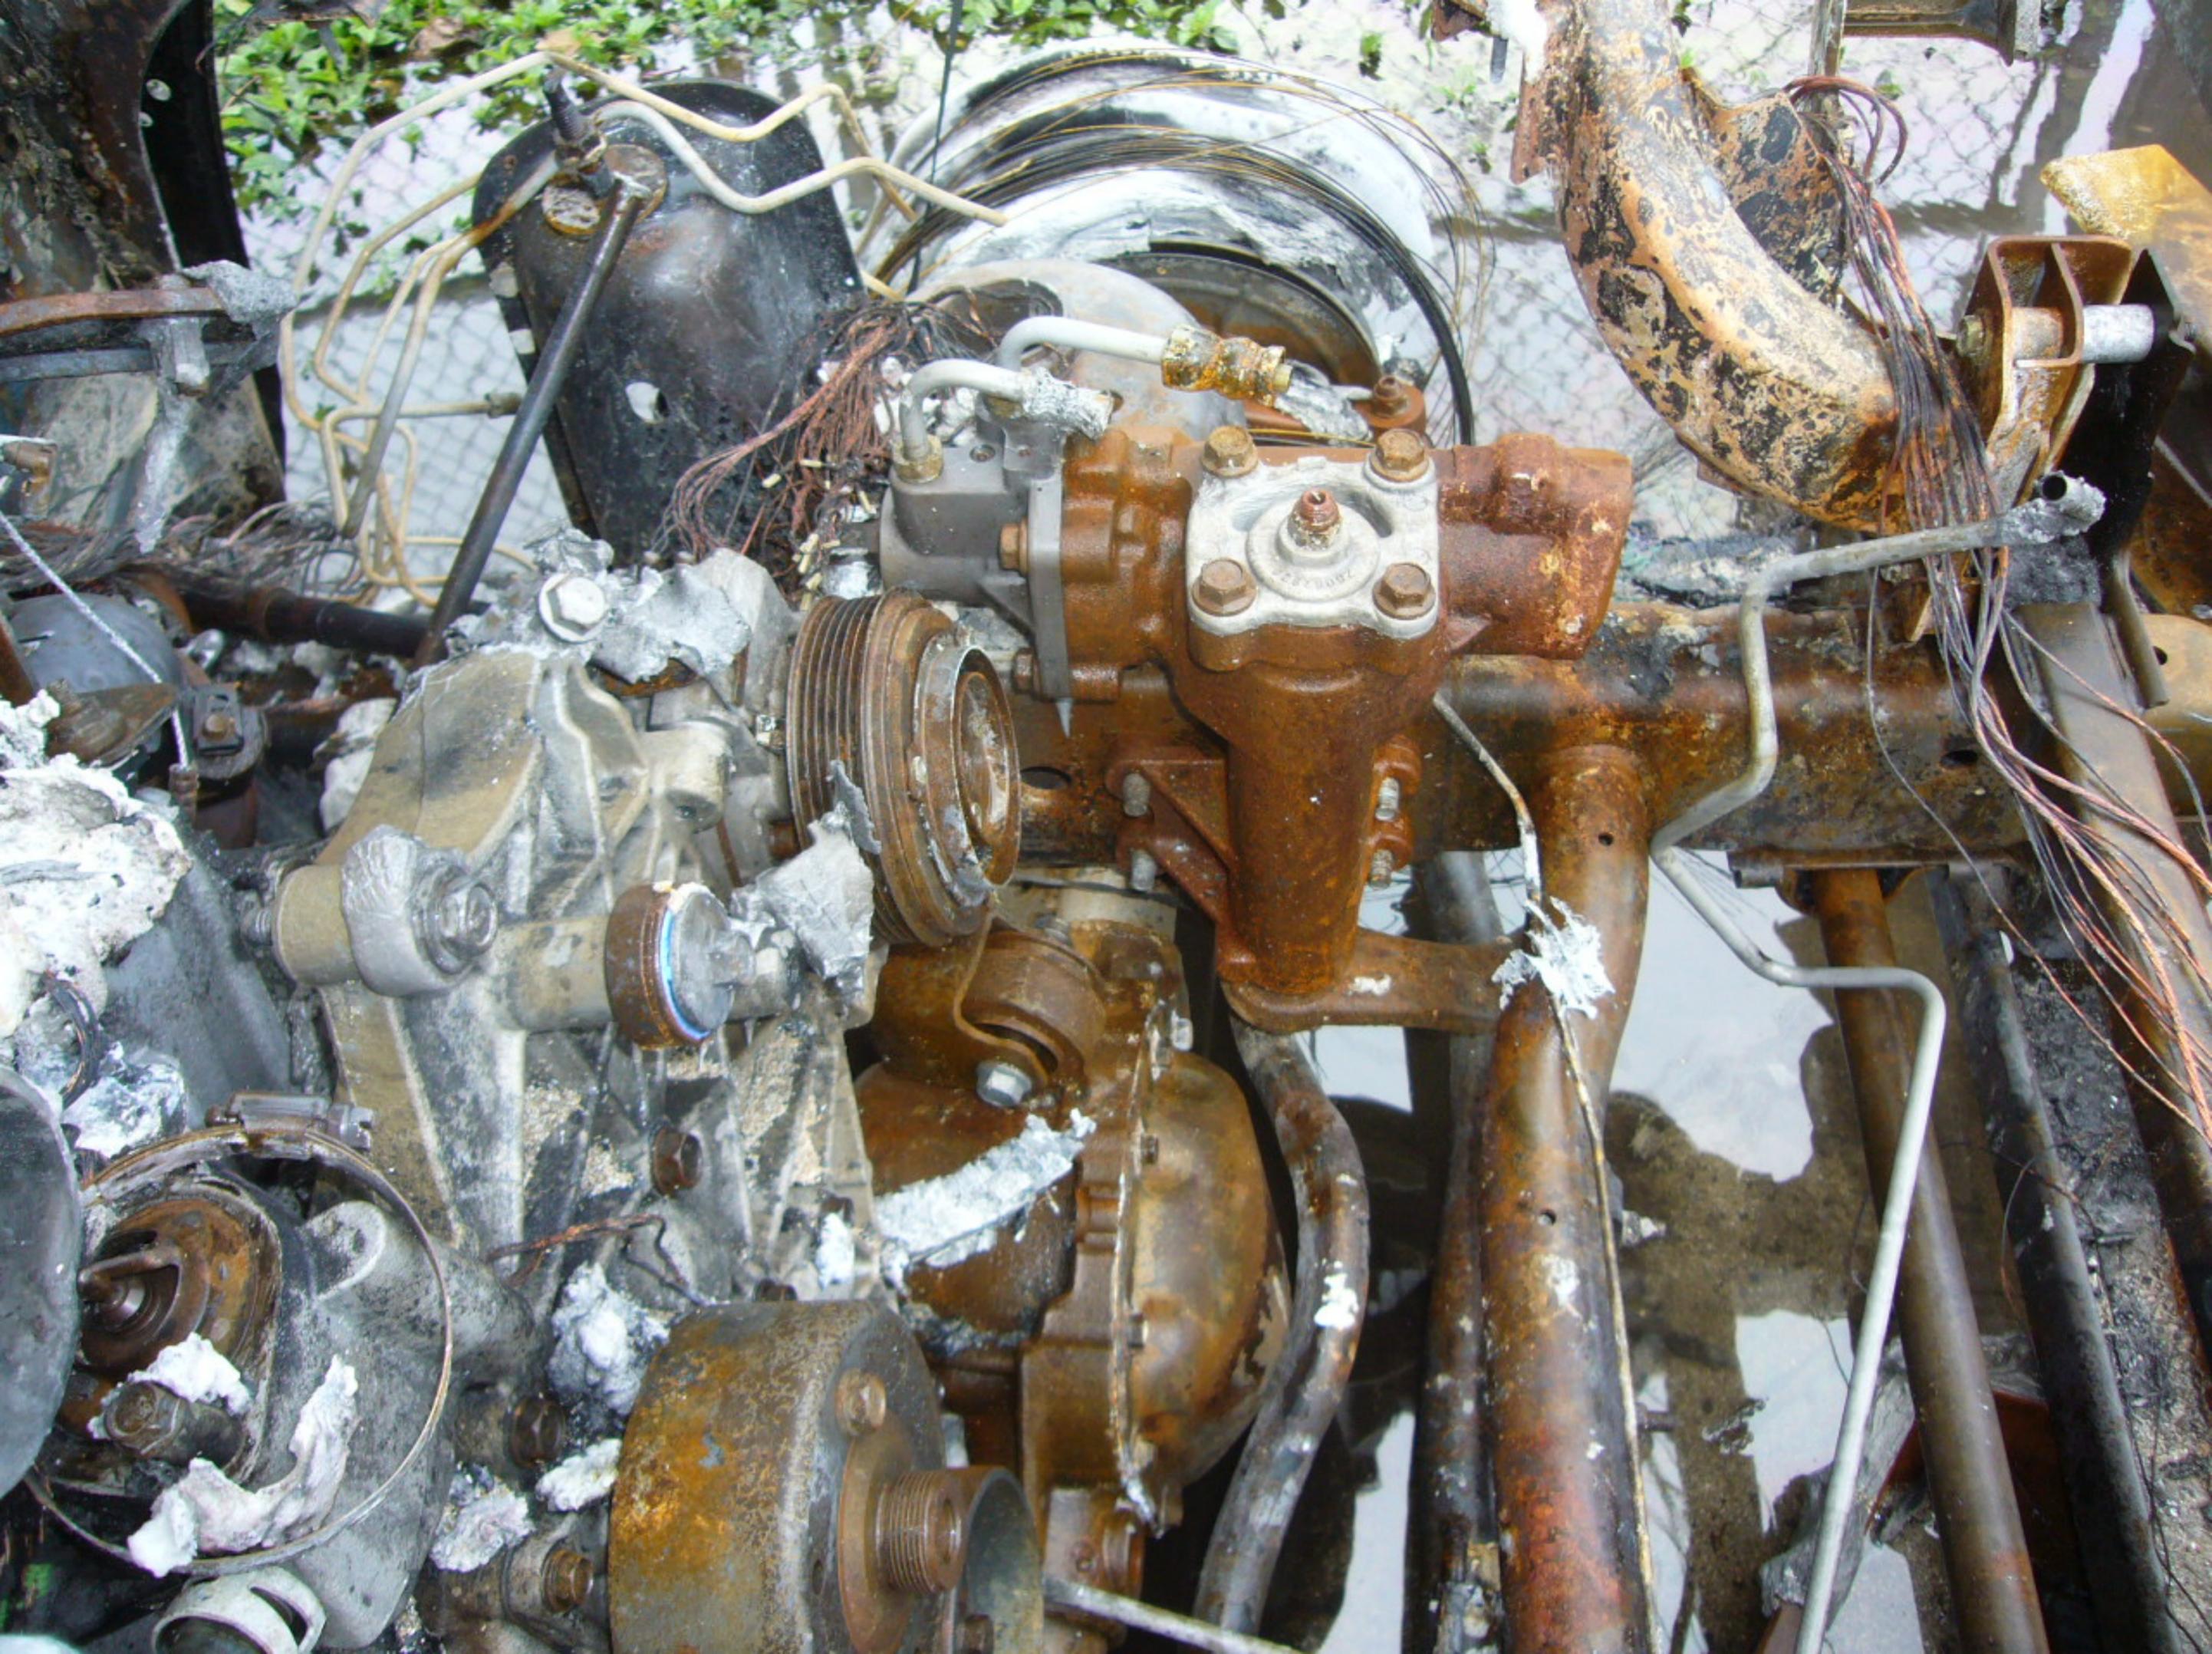

























CONCORD

PGD 594

CAMRY

V6 LE

















162 98156

























































































































Handwritten markings in red and black ink, including the number "0721" and other illegible characters.

Handwritten markings in red and black ink, including the number "2010" and other illegible characters.






































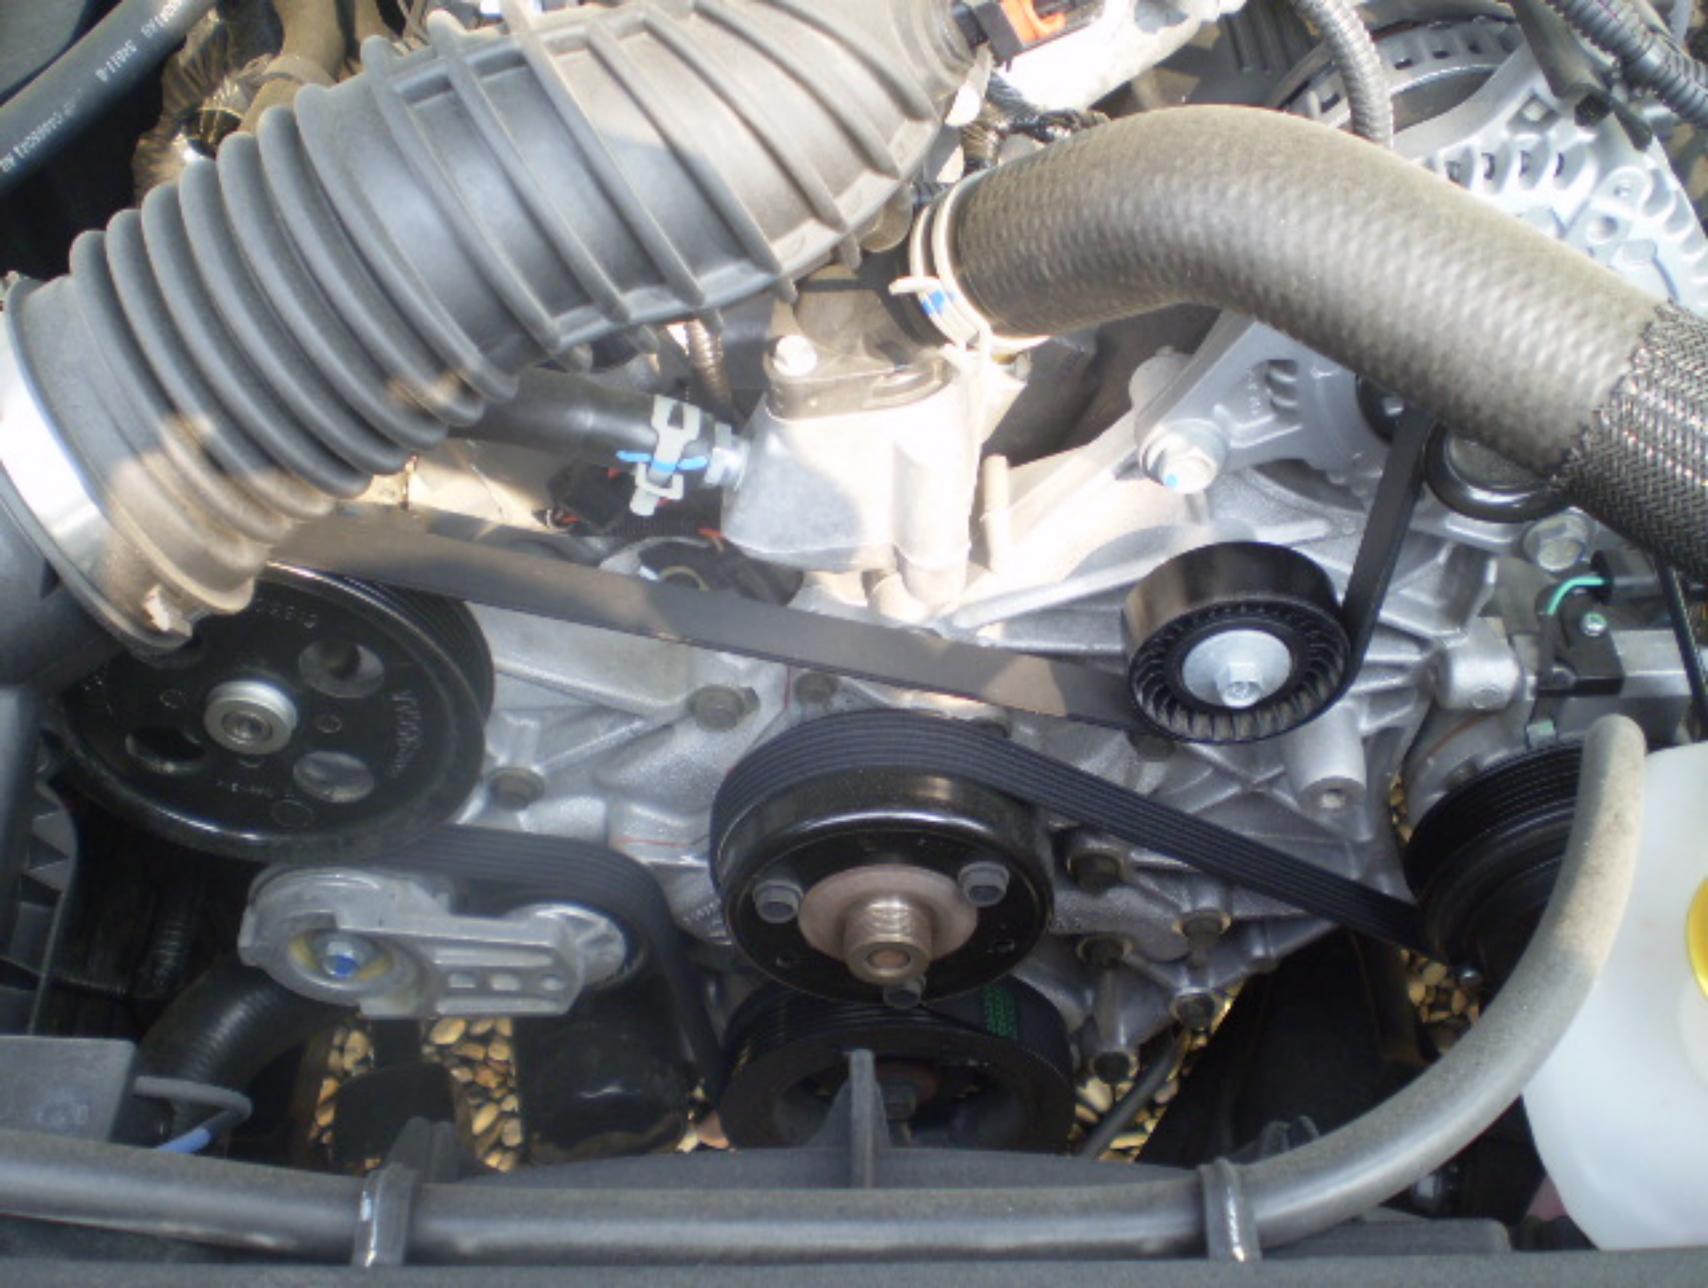







9A 1.8

ENGINE OIL  
SAE 5W-20

1.8

1.8

1.8



ENGINE OIL

CY 4880

42332

A/C

5/16 IN

A/C

3/4 IN

A/C

1/2 IN

A/C

3/8 IN

A/C

1/4 IN

A/C

3/16 IN

A/C

1/8 IN

A/C

3/32 IN

A/C

1/16 IN

A/C

3/64 IN

A/C

1/32 IN

A/C

1/64 IN

A/C

1/128 IN


A/C

1/256 IN

A/C

1/512 IN

A/C

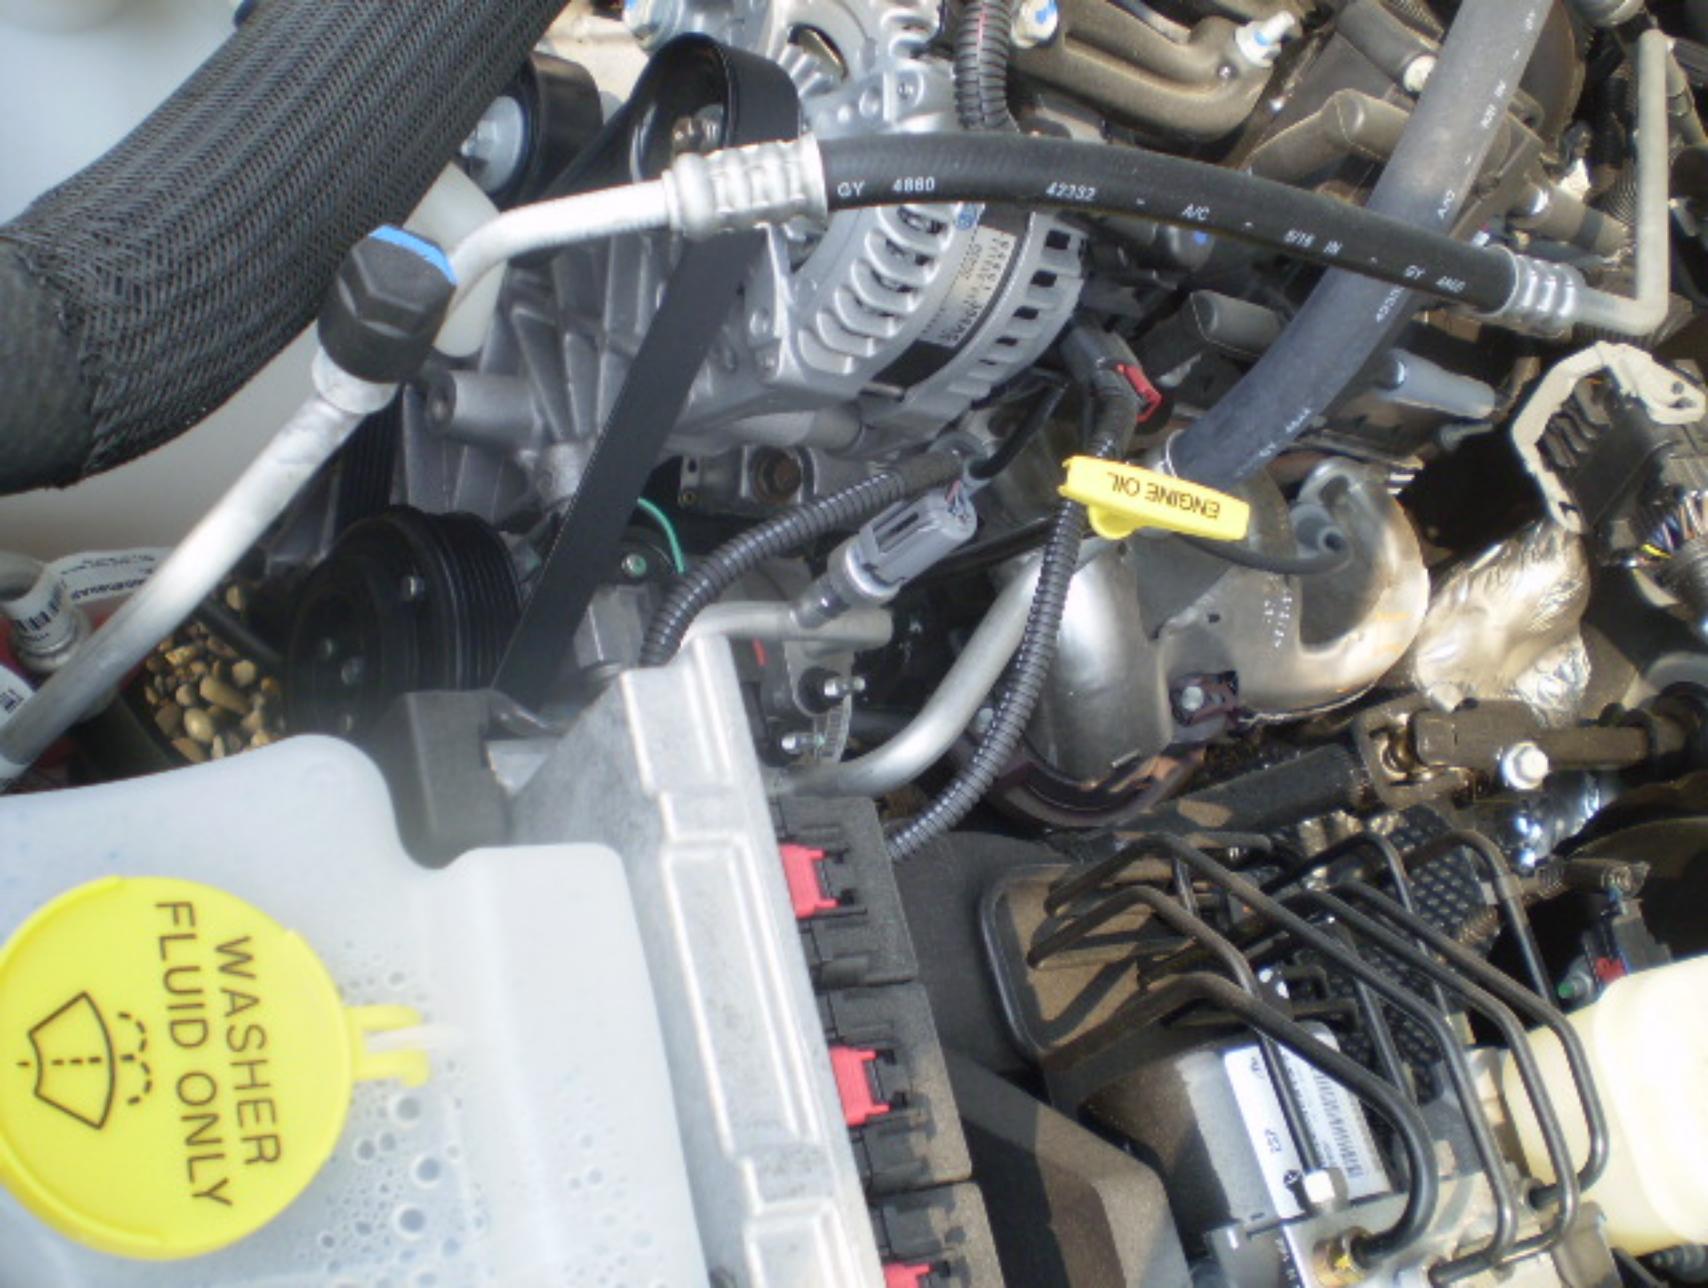



PN: 2007652 - 2  
714639AD2X2K

PN: 2007652 - 2  
714639AD2X2K

# State Farm Mutual Automobile Insurance Company



State Farm Mutual Automobi  
Insurance Company  
101 State Farm Place  
Ballston Spa, NY 12020

May 16, 2007

Daimler Chrysler Motors Corporation  
Attn: Special Investigation Dept  
PO BOX 218004  
Auburn Hills, MI 48321-8004

RE: Claim Number: [REDACTED]  
Named Insured: [REDACTED]  
Name of Operator: [REDACTED]  
Vehicle: 2007 Jeep Wrangler Sport  
VIN: 1J8GA69137L [REDACTED]  
Date of Loss: 05/12/2007  
Policy Number: [REDACTED]

RECEIVED  
JUN 04 REC'D  
SPECIAL INVESTIGATIONS

To Whom It May Concern:

Please be advised, on behalf of [REDACTED] Company is handling a claim for the vehicle listed above. This vehicle was involved in a fire on May 12, 2007 on Stag Hill Rd in Mahawah NJ.

In order to determine the cause of the fire, including a determination as to whether the defect in the vehicle was in existence at the time of the fire, an inspection and testing of the vehicle will be conducted by Patrick Dugan of New England Fire Cause and Origin, an authorized representative of the above. The inspection will take place at Stag Hill Rd in Mahawah NJ.

As you may have an interest in this matter, from both a safety precaution standpoint and as potential defendants in litigation, you are invited to have an expert attend and participate in the inspection and testing procedures.

To coordinate the inspection date and time, please contact Aaron Redsicker at 201-487-8901 ext 21. Should you have any questions pertaining to this matter, or wish to discuss the same in further detail, you may contact the undersigned at (800) 594-0252 extension 2219. **Failure to respond to this notification within ten business days** from the date of this letter will be construed as forfeiture of your right to be present at this examination.

I would like to caution that should your expert fail to appear at the inspection, you will forfeit any right to subsequently claim prejudice/spoliation under Nally vs. Volkswagen of America, Inc., 405 Mass 191 (1989).

Sincerely,

A handwritten signature in black ink, appearing to read "Adelle Piccirillo", with a long horizontal line extending to the right.




Adelle Piccirillo  
Claim Representative  
State Farm Mutual Automobile Insurance Company  
(800) 594-0252 Ext 2824

STATE FARM INSURANCE COMPANIES  
101 State Farm Place  
PO Box 8017  
Ballston Spa, New York 12020



POSTNET  
FIRST CLASS

02 1A  
0004634727  
\$ 00.41<sup>0</sup>  
MAY 31 2007  
MAILED FROM ZIP CODE 12020

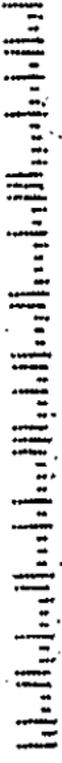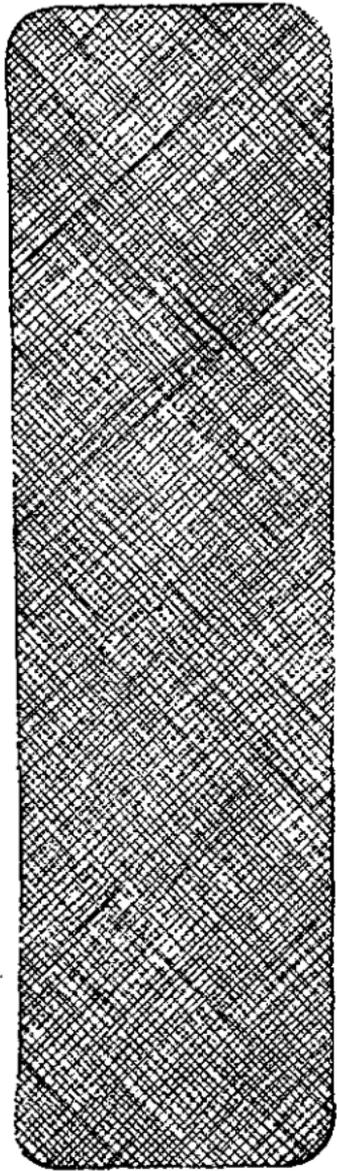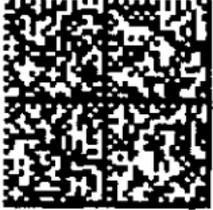

4832148004 2198

1 JAGA59157L121419\*



315031

SPECIAL  
HOLD



216077

SPECIAL  
HOLD

2000  
SPECIAL HOLD




SPECIAL  
HOLD

SPECIAL  
HOLD

SPECIAL  
HOLD

SPECIAL  
HOLD

Jeep

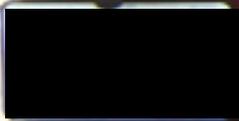



Farmers

SPECIAL  
HOLD

SPECIAL  
HOLD



315031

315031  
Stat

11/11/11  
11/11/11

GREEN LABEL





VEHICLE EQUIPMENT

ITEMS IN THIS STRUCTURE, VEHICLE OR EQUIPMENT  
MAY BE EVIDENCE. PLEASE CONTACT AN INSURANCE  
REPRESENTATIVE OR PERSON IN CHARGE OF THE  
INVESTIGATION PRIOR TO ANYTHING BEING REMOVED,  
DISTURBED, DAMAGED, MANIPULATED, ALTERED,  
OR REVERSELY TESTED ETC.

IF YOU HAVE ANY QUESTIONS CONTACT  
YANDELL FIRE INVESTIGATIONS @ 1-800-266-2414





315031

State Farm - Team P L

2007 JEEP WRANGLER

1234567890123456

SPECIAL

315031












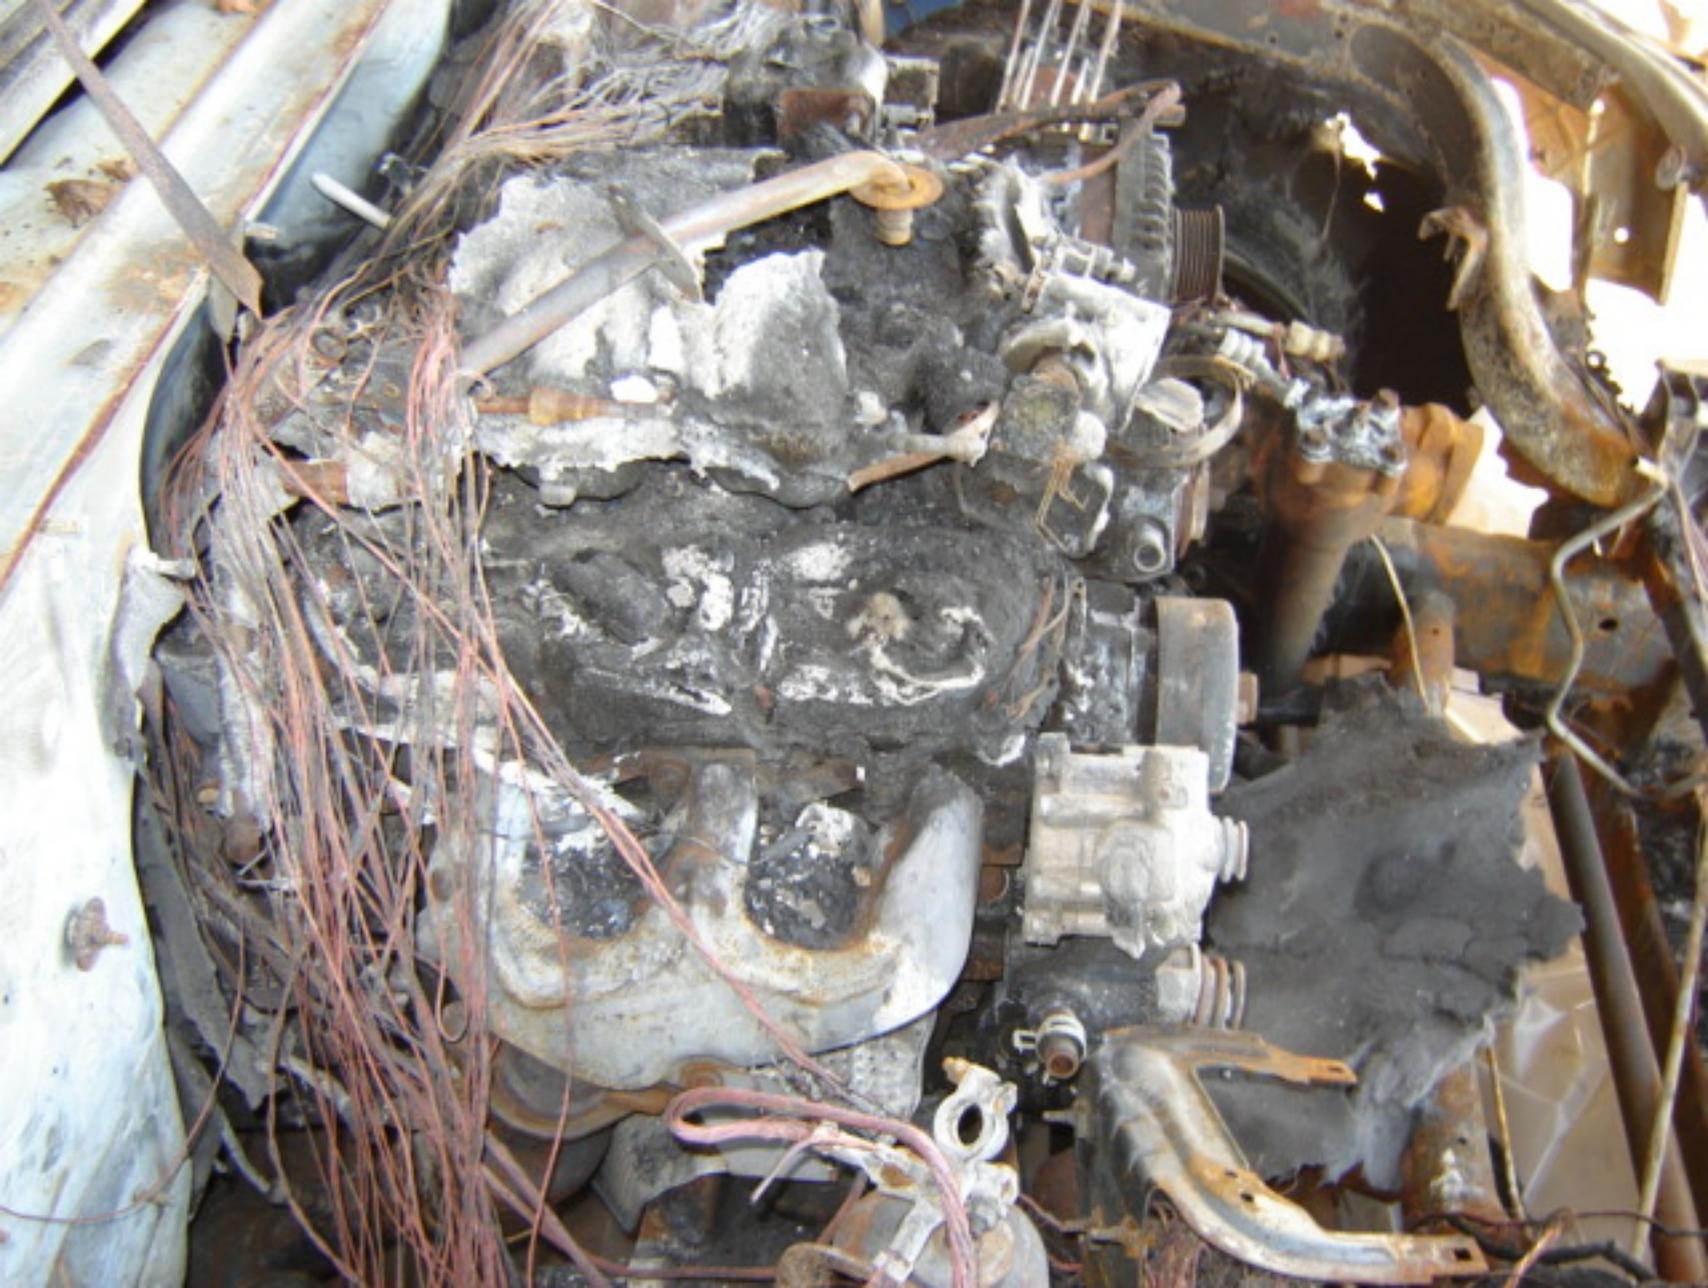



















































ITT INDUSTRIES

CAUTION-FUEL-FI



# CATHCART & DOOLEY

16570752

A Professional Corporation  
Attorneys at Law  
2807 Classen Boulevard  
Oklahoma City, Oklahoma 73106

WILLIAM R. CATHCART  
CARY D. DOOLEY  
VIRGINIA CATHCART HOLLEMAN  
SCOTT CALDWELL

Telephone (405) 524-1110

Facsimile (405) 524-4143

DATE: August 1, 2007


TO: Roy Porterfield

FAX NUMBER: 248/512-8748

FROM: Erin Clogston

RE: [REDACTED] v. Jeep

OUR FILE NO.: 173.07263

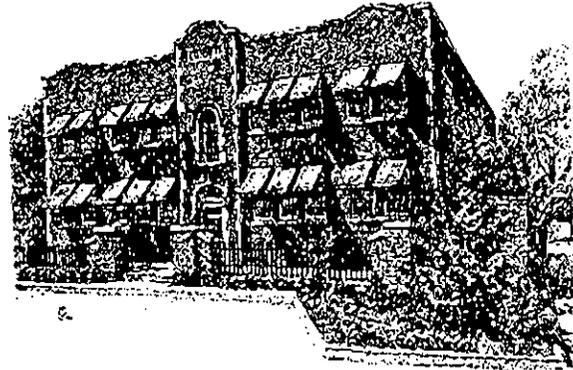

TIME: \_\_\_\_\_

TOTAL PAGES (INCLUDING COVER): \_\_\_\_\_

ORIGINAL:  WILL BE SENT BY FAX ONLY  
 WILL FOLLOW VIA U.S. MAIL  
 WILL FOLLOW VIA CERTIFIED MAIL

COMMENTS: Please see the attached.