

TOYOTA

**Toyota Motor Engineering &
Manufacturing North America, Inc.**

Vehicle Safety & Compliance
Liaison Office
Mail Code: S-104
19001 South Western Avenue
Torrance, CA 90501

August 10, 2011

Mr. Claude Harris
Acting Associate Administrator for Enforcement
National Highway Traffic Safety Administration
1200 New Jersey Ave, SE
Washington, D.C. 20590


Re: Foreign Safety Recall/Other Safety Campaign Report
Certain Toyota Corolla

Dear Mr. Harris:

In accordance with 49 CFR 579.12, attached is a copy of our Foreign Safety Recall/Other Safety Campaign Report for certain Toyota Corolla vehicles in other foreign markets. Toyota vehicles sold in the United States are not affected as those included in the Foreign Recall Report.

Should you have any questions about this report, please contact me at (502) 867-6027.

Sincerely,

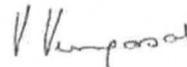

Vinnie Venugopal
General Manager
Toyota Motor Engineering & Manufacturing
North America, Inc.

Enclosures
Foreign Safety Recall/Other Safety Campaign Report

Foreign Safety Recall / Other Safety Campaign Report

Subject: Engine Control Module (ECM) issue on certain Toyota Corolla Vehicles

1. Vehicle Manufacturer Name:

Tianjin FAW Toyota Motor Co., Ltd [“TFTM”]

2. Affected Vehicles:

Make/ Car Line	Model Year	Country	Action	Production Period	Number of Vehicles
Toyota/ Corolla	*1	China	Safety Recall	October, 2010 through January, 2011	33,809

*1: In those countries, there is no system of Model Year.

3. Substantially Similar Vehicles sold in the U.S.:

Make/ Car Line: Toyota Corolla, Corolla Matrix
Model Year: 2011 Model Year

4. Description of Problem:

In the Engine Control Module (ECM) of the subject vehicle, due to insufficient electrostatic protection of the ECM, there is a possibility that the ECM may become electrostatically charged, which could lead to the engine stopping while driving and an inability to restart the vehicle.

5. Description of Corrective Repair Action:

For all of the affected vehicles, the dealer will install a ground cable in the ECM.

6. Determination to Conduct Safety Recall / Other Safety Campaign:

- The determination was made by Toyota Motor Corporation;
- Date of determination: August 8, 2011
- Date campaign will commence: Mid August, 2011

7. Reason the similar vehicles sold in the U.S. are not involved in this safety recall / other safety campaign:

This problem only affects Corolla vehicles produced at the TFTN plant. These vehicles are equipped with ECM's which are located in an area of the vehicle that is susceptible to electrostatic charge and have insufficient protection against electrostatic charge build-up. Those vehicles were not imported to the U.S. The substantially similar vehicles sold in the U.S. are equipped with ECM's which are in a different location that is well-grounded and provides proper electrostatic protection.