

# Recall Campaign

NHTSA#: 13V-071

TC#: N/A

Job Code 9901111

Flat Rate RC005-inspect only

0.25 hour

RC013-inspect & repair

0.50 hour

---

---

**REQUIRES PARTS TO BE ORDERED FROM Starcraft for every unit.**

---

---

**ACTION REQUIRED:**

Inspect breaker gap for minimum 3/8" gap. Repair if gap is less than 3/8"

**MODELS / UNITS:**

**2013 Autumn Ridge Travel Trailers**

325RLSA **D282**5098

315RKS **D283**5130-5131

346RESA **D284**5149-5150, 5152, 5156, 5159

**2013 Travel Star Travel Trailers**

286RLWS **D2J2**5055, 5060-5061

**KIT CONTENTS**

Instruction sheet

**Note: Kit can only be ordered using the order form**

**TOOLS/MATERIAL REQ.:**

light  
square head screwdriver  
tool to measure gap  
metal cutting tool

## Instructions


1. Make sure all power to the unit is turned off.
2. Remove the center screw along with the (4) exterior screws so the breakers can be removed.



3. Pull the breaker out of the load center panel.



4. Using a screwdriver or similar tool that is 3/8" wide, measure the gap between the breaker plates (**Fig 4a**). The minimum gap should be 3/8". If the gap is 3/8" or more, return the breaker and screws to the original position, and there is no additional repair required. If the gap is less than 3/8" proceed to step 5.

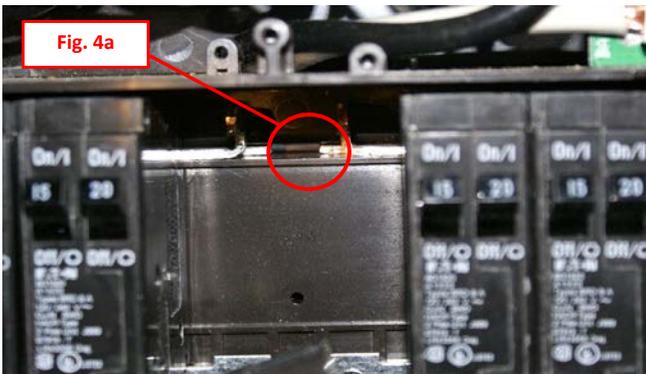

5. Remove the remaining breakers. Remove the screw holding the breaker plate. Remove the plate.



- Using a tin snips or similar tool, trim the end of the breaker plate. NOTE: Be sure to trim the end of the plate that is in the center of the load center where the gap is measured.



- Re-install the trimmed plate and re-measure the gap. If the gap is still less than  $\frac{3}{8}$ " , remove the plate and trim off more. If the gap is  $\frac{3}{8}$ " or more, reassemble the load center.

NOTE: Make sure all breakers and screws are securely in place.