

RECEIVED

By Recall Management Division at 12:47 pm, Oct 17, 2013



PORSCHE

13V-502
(4 pages)

VIA FEDERAL EXPRESS

Ms. Nancy Lewis
Associate Administrator for Enforcement
National Highway Traffic Safety Administration
Attention: Recall Management Division (NVS-215)
1200 New Jersey Ave., S.E.
Washington, DC 20590

Porsche Cars North America, Inc.
980 Hammond Drive
Suite 1000
Atlanta, Georgia 30328
(770) 290-3500 Fax: (770) 290-3700

October 9, 2013

Subject: Notification of Voluntary Safety Recall
2014 Boxster, Boxster S
2014 Cayman, Cayman S
2014 911 Carrera, 911 Carrera S
2014 911 Carrera Cabriolet, 911 Carrera S Cabriolet
2014 911 Carrera 4, 911 Carrera 4S
2014 911 Carrera 4 Cabriolet, 911 Carrera 4S Cabriolet
Replacing front passenger seat

Dear Ms. Lewis:

Porsche Cars North America, Inc. ("Porsche"), on behalf of Dr. Ing. h.c. F. Porsche AG ("Porsche AG"), hereby informs you of Porsche's intention to conduct a voluntary safety related recall and remedy campaign involving certain 2014 model year Porsche vehicles. This information is submitted in accordance with the provisions of Part 573 of Title 49 of the Code of Federal Regulations.

573.6 (c) (1) Manufacturer's Name
Dr. Ing. h.c. F. Porsche AG
70435 Stuttgart
Germany

Importer / Agent
General Counsel and Secretary
Porsche Cars North America, Inc.
980 Hammond Drive
Suite 1000
Atlanta, GA 30328

573.6 (c) (2)

Identification of Vehicles

Make: Porsche

Model Year: 2014

Models: Boxster
Boxster S
Cayman
Cayman S
911 Carrera
911 Carrera S
911 Carrera Cabriolet
911 Carrera S Cabriolet
911 Carrera 4
911 Carrera 4S
911 Carrera 4 Cabriolet
911 Carrera 4S Cabriolet

Production Dates: September 2, 2013, to September 23, 2013

VIN Range:	From:	To:
	WPOAA2A82EK172625	WPOAA2A8XEK172632
	WPOAB2A89EK192318	WPOAB2A86EK192373
	WPOCA2A8XES120653	WPOCA2A84ES120695
	WPOCB2A83ES140501	WPOCB2A87ES140551
	WPOAA2A98ES106637	WPOAA2A94ES106697
	WPOAB2A96ES120789	WPOAB2A99ES120902
	WPOCA2A91ES140265	WPOCA2A9XES140278
	WPOCB2A97ES154782	WPOCB2A9XES154839
	WPOAA2A96ES106670	N/A
	WPOAB2A98ES120776	WPOAB2A95ES120900
	WPOCA2A9XES140264	N/A
	WPOCB2A95ES154778	WPOCB2A93ES154830

Vehicle Type: Passenger Car

Bodystyles: 2-Door Coupes and Cabriolets

Component Supplier: Lear Corporation GmbH
74354 Besigheim
Germany

573.6 (c) (3) Number of Vehicles Potentially Containing the Defect

81

573.6 (c) (4) Percentage of Vehicles Actually Containing Defect

To be determined

573.6 (c) (5) Description of Defect

The supplier of the seats, Lear, informed Porsche that due to a problem caused by a sub-supplier some seats were equipped with defective wiring harnesses. The defective plug of the harness may cause intermittent contact problems which will lead to the deactivation of the passenger seat frontal and knee airbags and the illumination of the respective warning lamp in the instrument cluster.

573.6 (c) (6) Basis for Determination

Information from Lear and subsequent additional analysis by Porsche and Lear. Details to be determined.

573.6 (c) (7) Noncompliance Test Result

Not applicable.

573.6 (c) (8) Proposed Remedial Program

The affected vehicles will be recalled to the workshop and the front passenger seat will be replaced.

The anticipated mailing and notification dates are as follows:

November 2013.

Ms. Nancy Lewis
Notification of Recall – Replacing Front Passenger Seat
October 9, 2013
Page 4 of 4

573.6 (c) (9) Remedy Proposal for the Replacement of Tires

Not applicable.

573.6 (c) (10) Recall Communications


A representative copy of all bulletins and other communications sent to dealers and owners will be submitted within five (5) days of dealer/owner notification.

573.6 (c) (10) Manufacturer Campaign Number

AD04.

Should you have any questions or require further information, please do not hesitate to contact me at (770) 290-3627.

Sincerely,

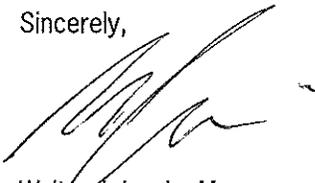

Walter J. Lewis, Manager
Regulatory Affairs

Enclosure

cc: Jennifer Timian, NHTSA - ODI via facsimile