



ProLo Hatch Rear Support Receiver Replacement Instructions

Tools Needed: Electric screw driver with Phillips head bit

Parts Needed: ProLo Hatch Rear Support Receiver Kit #?????? (1- Plastic Receiver, 2 Springs, 4 Screws, Instructions)


Step 1: Rotate the red handle counter clockwise 90 degrees to the release position.



Step 2: The red release handle must be in this position for the hatch to open.



Step 3: Push the hatch lid open separating the metal bracket from the plastic receiver.

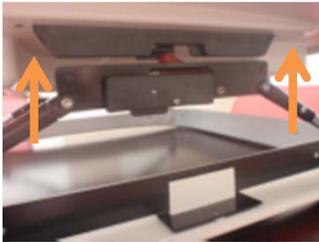

Step 4: Using an electric screwdriver with a Phillips head bit, remove the four (4) screws holding the plastic receiver to the lid and discard the screws




Step 5: Remove the plastic receiver from the lid and discard.




Step 6: Remove the Plastic Receiver and two (2) springs from the parts kit. Place the two (2) springs in the holes on the back side of the new receiver.



Step 7: Turn the receiver over and note the slot widths.

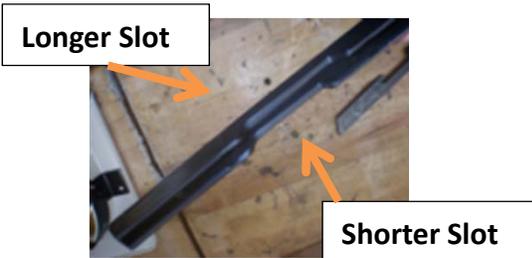

Step 8: Place the receiver against the lid. The shorter slot should be closest to the handle. There are two posts on the underside of the receiver. Rotate the receiver into position and match the posts with the mating holes on the lid.

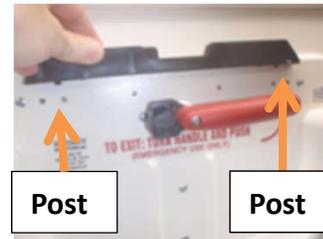



ProLo Hatch Rear Support Receiver Replacement Instructions

Step 9: Rotate the handle clockwise to secure the receiver to the lid.



Step 10: Using the electric screw driver with Phillips head bit, fasten the four (4) screws into the holes in the receiver. Tighten each until the screw is fully seated. **Do Not Over Tighten Screws**



Step 11: Rotate the handle 90 degrees counter clockwise and guide the metal bracket into the groove on the plastic receiver.



Step 12: Close the lid and rotate the red handle 90 degrees clockwise to secure the lid and ensure proper alignment of the receiver and metal bracket on the lid to the red handle.



Step 13: Verify proper installation. With the lid closed, rotate the red handle counter clockwise 90 degrees (as shown in Step 1). The metal bracket should release from the plastic receiver and move approximately 1/4".



Step 14: Close the lid, guide the metal bracket into the groove on the plastic receiver (as shown in Step 12). Rotate the red handle 90 degrees clockwise to secure the lid (as shown in Step 13). The replacement is complete.



For Technical Support, E mail: tech.support@smiglobal.net

Specialty Manufacturing Group, Inc.
10200 Pineville Rd, Pineville, NC 28134
Toll Free 800-951-STOP (7867)
Phone 704-889-7518
Fax 704-889-2760
<http://www.smiglobal.net>

Ω End of Document Ω