



TIE - Technical Journal

Title Recall 228: S80 tire pressure labels,US**Ref No** US23353.1.1 en-US**Issuer** -**Partner** 3 US 7510 Volvo Cars North America**Func Group** 8971 **Func Desc** instruction plate; information plate**Status** Released**Status Date** 2010-07-22**Issue Date** 2010-07-20**Reference** VIDA**Attachment**

File Name	File Size
RTJ 23353 Recall 228.pdf	0.5760 MB

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
124							2007 -2010		0012667 -0132429	0 -0

CSC

Code	Description
XW	Service action/Recall/Service action/Recall

DTC**Text****CSC = Customer Symptom Code****DTC = Diagnostic Trouble Code****Note! If using a printed copy of this Retailer Technical Journal, first check for the latest online version.****DESCRIPTION:**

Volvo Cars of North America has identified that in certain S80's the tire pressure information is in non-compliance with legal requirements. A vehicle must have the correct tire pressure described on the B-pillar tire pressure label and in the owner's manual. The tire pressure information printed on these labels and in the owner's manual is too low, i.e 35 psi (240kpa) instead of 36 psi (250kpa) for B6304T4/2 (T6) and 36 psi (250kpa) instead of 38 psi (260kpa) for B8444S (V8). In addition to this the TPMS (Tire pressure monitoring system) software in the S80 vehicles have the incorrect trigger level i.e it reacts on 35 psi (T6) and 36 psi (V8) instead of the 36 psi (T6) 38 psi (V8).

SERVICE:

Remove the existing labels, affix new labels, and download a CEM Upgrade according to the attached instruction.

Note:


When purchasing/installing the above software VIDA may leave a message stating that the latest version of the software has already been installed. In cases like this, only the action of installing the corrected labels is necessary.



Volvo Car Customer Service	
	RTJ Instruction
	RTJ No.23353
	Date July-2010 Issue 01
Title	Recall 228: S80 tire pressure labels,US



Materials	Quantity	Part No.
Cleaning agent	0.1	1161721 Note: Consumables, according to standard

Note! Some variation in the illustrations may occur, but the essential information is always correct

Removal

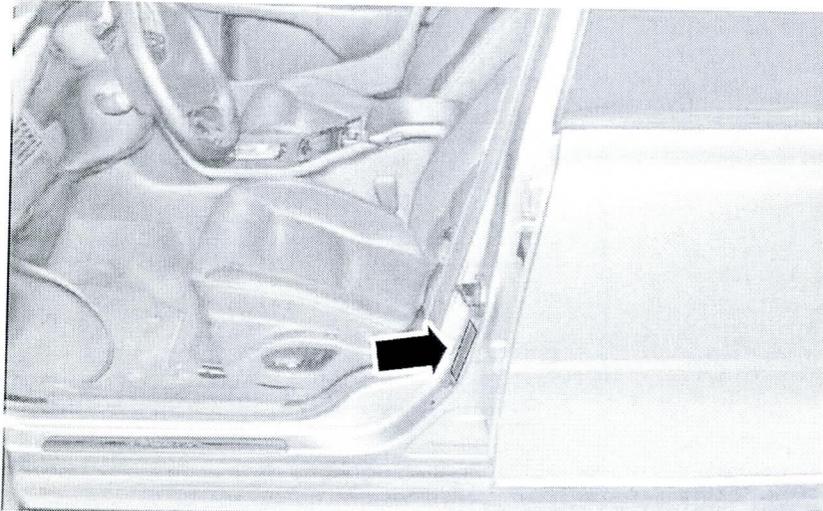


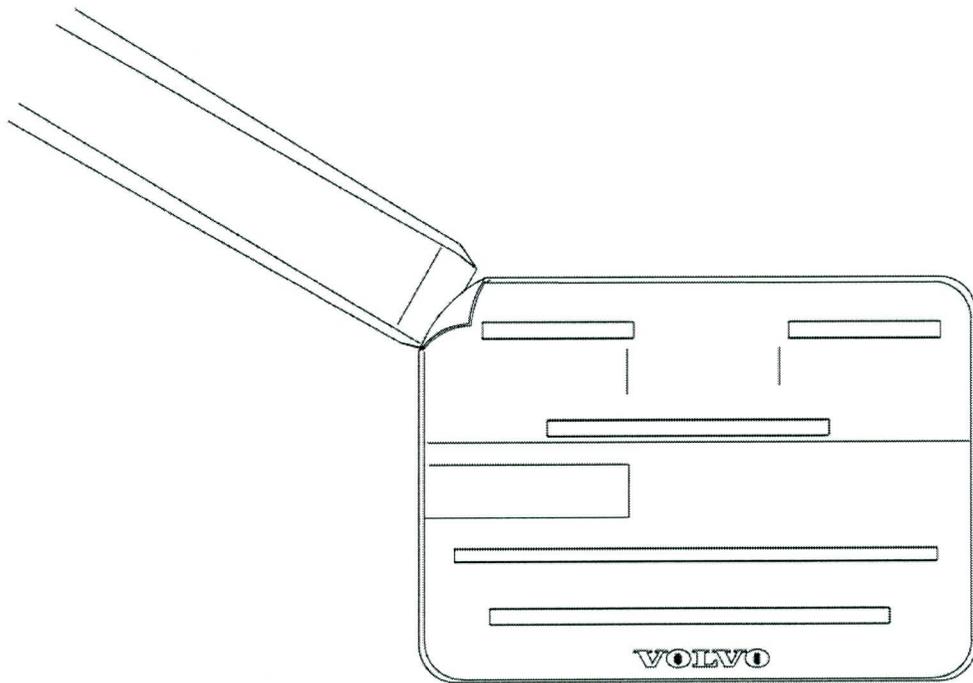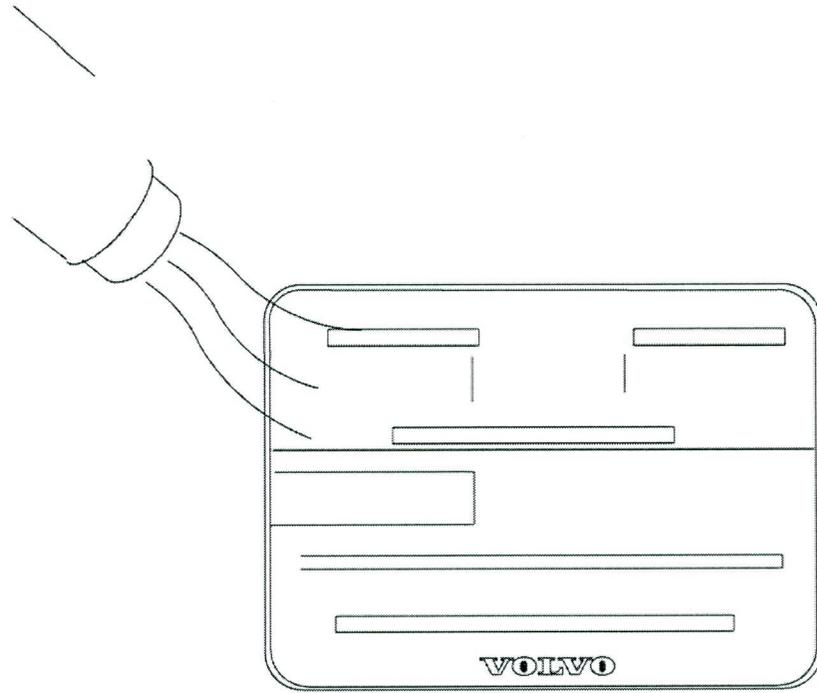

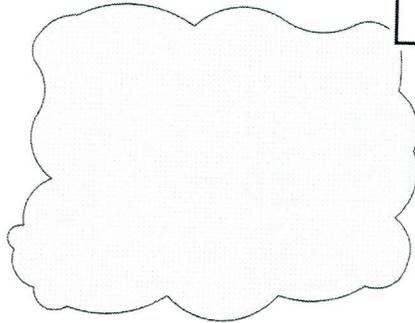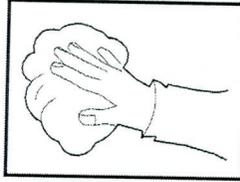


Use: Cleaning agent, 1161721

Installation:

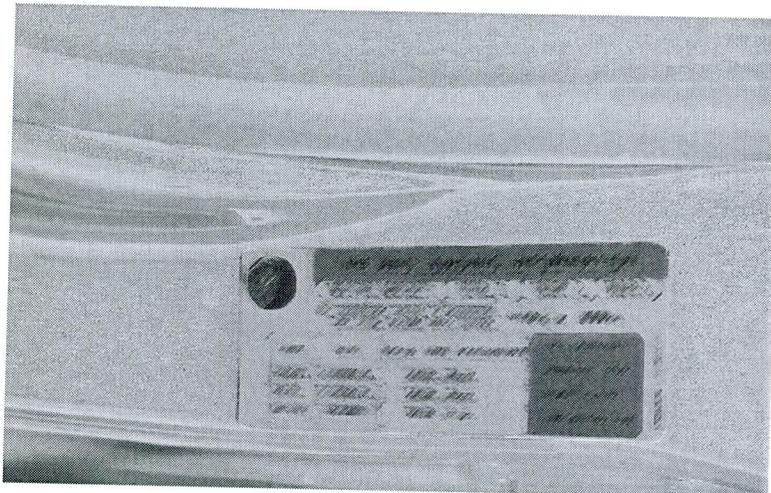


New label supplied by customer

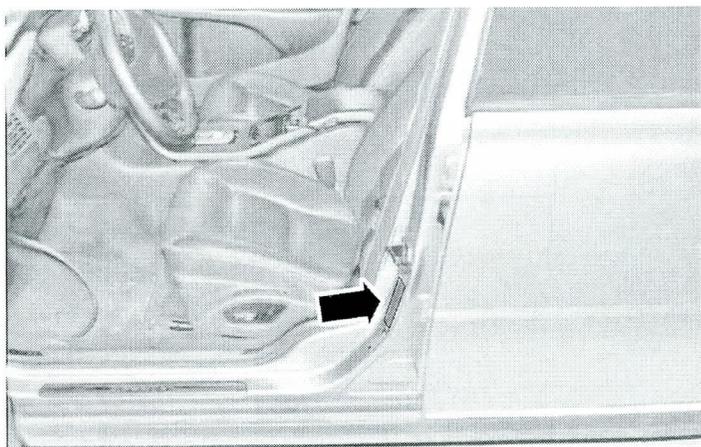


Owners manual upgrade:

Manual and new label supplied by customer.

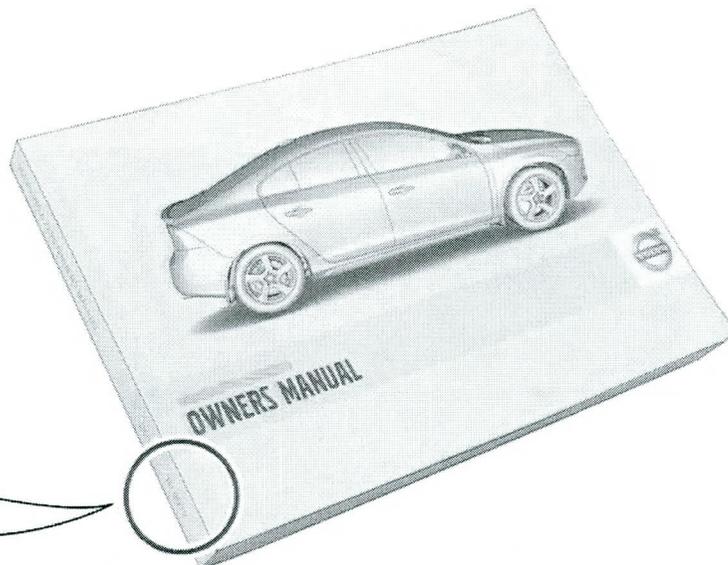

TP11451	Page.249
TP8872	Page.221
TP9138	Page.218
TP9549	Page.227
TP9877	Page.240
TP10023	Page.244
TP10682	Page.247

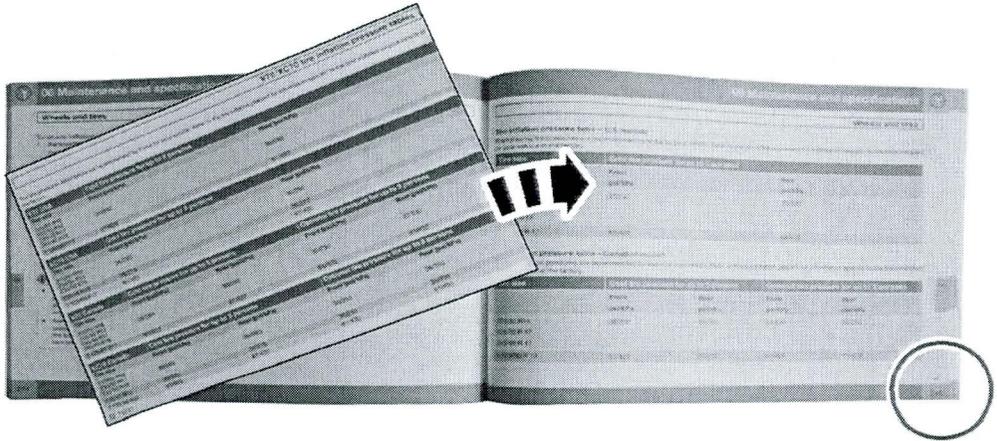

Final action:

Perform CEM upgrade according to VIDA.