

2015 Rogue Certification Label  
Voluntary Noncompliance Recall Campaign

Reference: R1510  
Date: June 12, 2015



Innovation  
that excites

Attention: Dealer Principal, Sales, Service & Parts Managers

\*\*\*\*\*Dealer Announcement\*\*\*\*\*

**A STOP SALE CONDITION IS IN EFFECT.**

Nissan is conducting a Voluntary Noncompliance Recall Campaign in U.S. on approximately 110 MY2015 Nissan Rogue Select vehicles to replace the certification labels.

The certification labels on the affected vehicles contain an incorrect description of the wheel and tire size for vehicles equipped with optional 17-inch wheels. Approximately 110 MY2015 Nissan Rogue Select vehicles manufactured at the Kyushu plant in Japan between November 17, 2014 and December 12, 2014 and sold in the U.S. are included in the noncompliance recall.

**IMPORTANT: It is a violation of Federal law for dealers to sell or deliver vehicles in their inventory covered by this notification until the campaign action is performed.**

\*\*\*\*\* What Dealers Should Do\*\*\*\*\*

1. Dealers should identify any vehicles in inventory using the attached inventory list.
2. Dealers should hold any affected inventory until new certification labels arrive.
  - Affected dealers will receive corrected labels via Fed-Ex on June 12<sup>th</sup>, 2015.
3. Dealers should use the attached repair procedure to correct any vehicles currently in dealer inventory.
4. Once repaired, dealer should submit the claim, using the claims coding provided, and release the vehicle for sale.

**NOTE:** Nissan will begin sending owners of the affected vehicles replacement labels later this month, along with detailed instructions on how to affix the label to the vehicle. If an owner requires assistance, a Nissan dealer will perform this service at no charge to the customer. Dealers performing this service for customers can use the claims information in the attached procedure.

\*\*\*\*\* Vehicle Identification – Dealer Inventory \*\*\*\*\*

**11** 2015 Rogue vehicles subject to this voluntary noncompliance recall campaign are currently in dealer inventory and can be identified through the following method:

- **VIN List** – As a courtesy, posted with this announcement is a list of affected dealer inventory VINs by region, district, and Dealer Code.

**NOTE:** Retailed and Dealer inventory vehicles will not show active in SERVICE COMM.

**\*\*\*\*\* Dealer Responsibility \*\*\*\*\***

It is the dealer's responsibility to check the status on each 2015 Rogue Select vehicle which is currently in inventory. Nissan requests dealers to perform this repair on vehicles in inventory prior to being retailed to ensure certification compliance.

**Thank you for your prompt attention to this matter and we apologize for the inconvenience.**

**NISSAN NORTH AMERICA, INC.**

Aftersales DIVISION



# R1510 Rogue Select Certification Label

## Installation Instructions

### NOTE:

- Enclosed please find a replacement Certification label **specific to your vehicle**. Make sure the VIN on the new Certification label matches the VIN on the old Certification label.
- **DO NOT REMOVE THE EXISTING LABEL.** Affix the replacement label over the existing label.

1. Park the vehicle in a safe place with the ignition OFF, the parking brake ON, and your automatic transmission in "P" (manual transmissions in gear).
2. Open the driver's door.
3. Locate the existing Certification label (see figure 1)
4. Clean the label and the area around it with a mild detergent and water.

### NOTE:

- Care should be taken not to use harsh chemicals that may damage the existing label.
  - It is important the surface be free of dirt and oil to ensure proper adhesion of the new label.
5. Completely dry the label and the area around it.
  6. Peel the new label from the backing sheet and affix it directly over the top of the existing label (see Figure 2).

**NOTE:** The adhesive on the label is permanent. Extra care should be taken when applying the new label since it **cannot** be moved once it is attached.



Figure 1

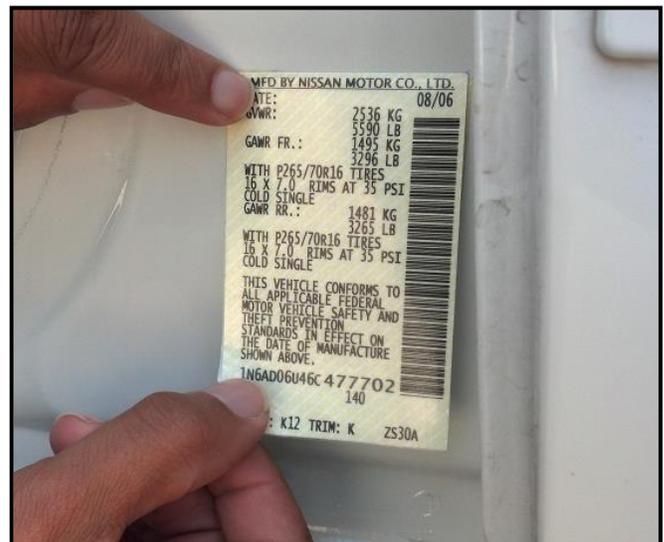


Figure 2

Figure 2

**CLAIMS INFORMATION**

**"PM" I.D.: R1510**

<b>Claim Type:</b>	<b>CM</b>			
<b>PNC:</b>	<b>R1510</b>			
<b>Symptom:</b>	<b>ZZ</b>			
<b>Diagnosis:</b>	<b>99</b>			
<b>Description:</b>	<b>Op Codes</b>	<b>Flat Rate Time</b>	<b>Parts Required on claim</b>	<b>Expense Code Required</b>
<b>Install Certification Label.</b>	<b>R15100</b>	<b>0.2 Hrs.</b>	<b>No</b>	<b>No</b>