




Safety Notice

Affected Models	MV800 units with T14MV trailer, see attached list for serial numbers
Attention	Dealership Owners, Managers, Parts and Service Managers
Description	Please see the attached customer notice.
Parts Required	N/A
Estimated Repair Time	30 minutes
Compensation	parts/labor/mileage
Dealership Notes	<p>URGENT: Please perform this update as soon as possible in the interest of safety. Ditch Witch requests that you update all machines in your area by January 31, 2016.</p> <p>A notification will be mailed to owners of affected models in one week. A list of units in your area is included. Please note "What You Should Do" section of the attached customer notice. If you have any questions, contact the Trenchless Product Support Group.</p>

1. Pry harness bar (shown) up enough to remove harness and disconnect trailer harness (215-0018) from tongue harness (215-0030).

IMPORTANT: Remove ring and washer (not shown) from trailer harness to fit through hole in trailer footboard.

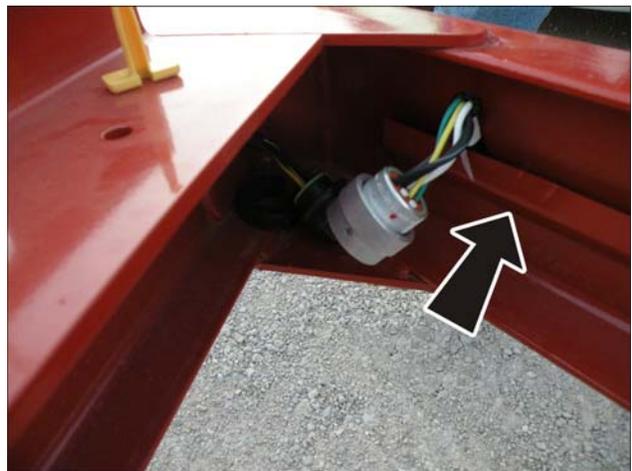

inmv800001s.jpg

Safety Notice 2

2. Remove rubber grommet from hole in trailer footboard (shown).



inmv800002s.jpg

3. Remove harness from clip (shown) and pull harness through hole in trailer footboard.



inmv800003s.jpg

4. Use yellow tool (259-439) to move black/white wire from pin F to pin H (shown).



inmv800004s.jpg



inmv800005s.jpg

5. Route trailer harness back through hole in trailer footboard.
6. Reconnect trailer harness to tongue harness (shown).
7. Secure harness into harness clip and harness bar and reinsert grommet.
8. Test to ensure proper function.



inmv800006s.jpg

Serial Numbers

1DSB122Y2F1702128	1DSB122Y0F1702113
1DSB122Y5F1702141	1DSB122Y1F1702119
1DSB122Y7F1702142	1DSB122Y3F1702137
1DSB122Y1F1702153	1DSB122Y7F1702139
1DSB122YXF1702152	1DSB122Y8F1702134
1DSB122Y2F1702162	1DSB122Y8F1702151
1DSB122Y5F1702169	1DSB122YXF1702118
1DSB122Y2F1702176	1DSB122Y9F1702109
1DSB122Y5F1702155	1DSB122Y5F1702138
1DSB122Y6F1702164	1DSB122Y0F1702161
1DSB122Y6F1702181	1DSB122Y4F1702146
1DSB122Y8F1702117	1DSB122YXF1702135
1DSB122Y9F1702160	1DSB122Y0F1702144
1DSB122YXF1702166	1DSB122Y1F1702122
1DSB122Y2F1702114	1DSB122Y9F1702143
1DSB122Y8F1702120	1DSB122Y1E1701809
1DSB122Y8F1702148	1DSB122Y1F1702105
1DSB122Y4F1702115	1DSB122Y3F1702106
1DSB122Y4F1702129	1DSB122Y4F1702101
1DSB122Y6F1702116	1DSB122Y5F1702107
1DSB122Y0F1702158	1DSB122Y5F1702110
1DSB122Y3F1702154	1DSB122Y6F1702102
1DSB122Y6F1702150	1DSB122Y7F1702111
1DSB122Y7F1702108	1DSB122Y8E1701807
1DSB122Y9F1702157	1DSB122Y8F1702103
1DSB122Y0F1702127	1DSB122YXF1702104
1DSB122Y0F1702130	1DSB122YXE1701808
1DSB122Y3F1702123	1DSB122Y6F1702147
1DSB122Y3F1702140	1DSB122Y0F1702189
1DSB122Y4F1702132	1DSB122Y1F1702184
1DSB122Y5F1702124	1DSB122Y2F1702145
1DSB122Y7F1702125	1DSB122Y3F1702185
1DSB122Y9F1702126	1DSB122Y4F1702177
1DSB122YXF1702121	1DSB122Y4F1702180
1DSB122Y0F1702175	1DSB122Y5F1702186
1DSB122Y1F1702136	1DSB122Y6F1702178
1DSB122Y2F1702131	1DSB122Y7F1702187
1DSB122Y6F1702133	1DSB122Y7F1702190
1DSB122Y9F1702112	1DSB122Y8F1702179
1DSB122Y7F1702156	1DSB122Y9F1702188
1DSB122YXF1702149	1DSB122YXF1702183